



**CONESTOGA-ROVERS
& ASSOCIATES**

11100 Metro Airport Center Drive, Suite #160
Romulus, Michigan 48174
Telephone: (734) 942-0909 Fax: (734) 942-1858
www.CRAworld.com

TRANSMITTAL

DATE: May 26, 2000 REFERENCE NO.: 8889-10
PROJECT NAME: GM Clark Avenue Facility
To: Ms. Bridget Pitlock
General Motors Corporation
WFG-Remediation Team
Mail Code: 482-310-004
485 W. Milwaukee
Detroit, Michigan 48202

Please find enclosed: ☒ Draft ☐ Final
☐ Originals ☐ Other
☐ Prints
Sent via: ☐ Mail ☐ Same Day Courier
☒ Overnight Courier ☐ Other

QUANTITY	DESCRIPTION
1	Draft City of Detroit Proposed Right-of-Way Phase I ESA

☒ As Requested ☒ For Review and Comment
☐ For Your Use ☐

COMMENTS:

Privileged and Confidential
Prepared at General Motors Counsel's Request

Copy to: Glenn Turchan, file
Completed by: Sue Neiheisel
[Please Print]

Signed: Sue Neiheisel

Filing: Correspondence File



Privileged and Confidential
Prepared at General Motors
Counsel's Request

DRAFT

**CITY OF DETROIT PROPOSED RIGHT-OF-WAY
PHASE I ENVIRONMENTAL SITE ASSESSMENT**

**GENERAL MOTORS CORPORATION
CLARK AVENUE FACILITY
DETROIT, MICHIGAN**

**MAY 2000
REF. NO. 8889 (42)**

Prepared By:
Conestoga-Rovers & Associates
11100 Metro Airport Center Drive, Suite #160
Romulus, Michigan 48174
(734) 942-0909 Office (734) 942-1858 Fax

TABLE OF CONTENTS

	<u>Page</u>
1.0 INTRODUCTION.....	1
2.0 ENVIRONMENTAL DATABASES SEARCH AND HISTORICAL RECORDS REVIEW	3
2.1 ENVIRONMENTAL DATABASES SEARCH.....	3
2.1.1 FEDERAL DATABASES	3
2.1.2 STATE DATABASES	8
2.2 HISTORICAL RECORDS REVIEW	10
2.2.1 SANBORN FIRE INSURANCE MAPS	10
2.2.2 PROPERTY TITLE SEARCH	12
2.2.3 AERIAL PHOTOGRAPHS	12
3.0 SITE REVIEW	14
3.1 HISTORICAL SITE ASSESSMENTS.....	14
3.1.1 USEPA PRELIMINARY ASSESSMENT AND VISUAL SITE INSPECTION.....	14
3.2 REVIEW OF SITE RECORDS/SITE INSPECTION.....	15
3.2.1 SITE OVERVIEW	15
3.2.2 ENVIRONMENTAL SETTING	15
3.2.3 UNDERGROUND STORAGE TANKS (USTS)	17
3.2.4 ABOVEGROUND STORAGE TANKS (ASTS).....	17
3.2.5 UTILITY SERVICES	18
3.2.6 RAW MATERIAL USE AND STORAGE	18
3.2.7 SOLID WASTE	19
3.2.8 HAZARDOUS WASTE	19
3.2.9 POLYCHLORINATED BIPHENYLS (PCBS).....	20
3.2.10 ASBESTOS-CONTAINING MATERIAL (ACM)	20
3.2.11 INDUSTRIAL WASTEWATER/SANITARY SEWERS.....	21
3.2.12 STORMWATER.....	21
3.2.13 IONIZING RADIATION	21
3.2.14 SPILLS/RELEASES.....	22
3.2.15 CERCLA LIABILITY POTENTIAL.....	22
4.0 SUMMARY OF IDENTIFIED PAOCs	23

LIST OF FIGURES
(Following Report)

FIGURE 1.1 SITE LOCATION

FIGURE 1.2 SITE PLAN

LIST OF APPENDICES

APPENDIX A ENVIRONMENTAL DATABASE SEARCH

APPENDIX B SANBORN MAPS

APPENDIX C AERIAL PHOTOGRAPHS

APPENDIX D MDEQ - WMD CLOSURE CERTIFICATION APPROVAL

LIST OF ACRONYMS

ACM	Asbestos-Containing Material
AOC	Area of Concern
ASTs	Aboveground Storage Tanks
BTEX	Benzene, Toluene, Ethylbenzene, and Xylenes
CORRACTS	RCRA Corrective Actions and Associated TSDs
CRA	Conestoga-Rovers & Associates
DWSD	Detroit Water and Sewer Department
ERIIS	Environmental Risk Information and Imaging Service
ERNS	Emergency Response Notification System
ESA	Environmental Site Assessment
FA	Feasibility Analysis
IA	Initial Abatement
GC	Gas Chromatograph
GM	General Motors Corporation
LUST	Leaking Underground Storage Tank
MDEQ	Michigan Department of Environmental Quality
MDEQ-USTD	Michigan Department of Environmental Quality - Underground Storage Tank Division
MDEQ-WMD	Michigan Department of Environmental Quality - Waste Management Division
MSDS	Material Safety Data Sheets
MSP-FMD	Michigan State Police - Fire Marshal Division
MTBE	Methyl-tert-butyl-ether
NFRAP	No Further Remedial Action Planned
NPL	National Priority List
PA	Preliminary Assessment
PAOC	Potential Area of Environmental Concern
PCBs	Polychlorinated Biphenyls
PNAs	Polyaromatic Hydrocarbons
RAP	Remedial Action Plan
RCRA	Resource Conservation and Recovery Act
RCRA Pad	Former RCRA Container Storage Pad
RCRA-LG	Resource Conservation and Recovery Information System - Large Quantity Generator

LIST OF ACRONYMS (CONT'D)

RCRA-SG	Resource Conservation and Recovery Information System - Small Quantity Generator
RCRA-TSD	Resource Conservation and Recovery Information System - Treatment, Storage, and Disposal Facilities
SARA Title III	Superfund Amendment and Reauthorization Act of 1986
SCL	State Equivalent CERCLIS List
SPL	State Equivalent Priorities List
SVE	Soil Vapor Extraction
SWLF	Solid Waste Landfill
SWMUs	Solid Waste Management Units
TCE	Trichloroethene
TEX	Toluene, Ethylbenzene, and Xylenes
TRI	Toxic Release Inventory
TSD	RCRA Transfer, Storage and Disposal Facilities
USEPA	United States Environmental Protection Agency
USTs	Underground Storage Tanks
VOCs	Volatile Organic Compounds
VSI	Visual Site Inspection
WRTK	Worker Right to Know
WWTP	Wastewater Treatment Plant

1.0 INTRODUCTION

Conestoga-Rovers & Associates (CRA) was retained by General Motors Corporation (GM) to conduct a Phase I Environmental Site Assessment (ESA) for a portion of the Clark Avenue Facility located at 2860 Clark Avenue in Detroit, Michigan. The purpose of the Phase I ESA was to identify potential areas of environmental concern (PAOC). PAOCs are areas where there may have been a release of contaminants into the environment at levels that could adversely impact human health or the environment, based on the following objective criteria; (i) written records regarding a release; or (ii) knowledge of a release reported by GM personnel; or (iii) currently visible evidence of a release associated with a route into the environment. A Site location map is provided on Figure 1.1. The Site is defined as the area of the Clark Avenue Facility which was designated for re-development as a portion of Parcel B-3 (Site). Figure 1.2 presents a Site Plan of the area being reviewed under this Phase I ESA.

The Site is part of a larger property which was known as the GM Clark Avenue Facility. The GM Clark Avenue Facility was headquarters of the GM Cadillac Motor Car Division until that function was re-located in 1993. The overall GM Clark Avenue Facility, including the Site, is currently being re-developed as an industrial park.

The Phase I ESA has been conducted in accordance with GM Specifications and general accordance with ASTM Standard E1527-95 for conducting environmental assessments. The assessment of the Site included visual observations of the property and adjacent facilities, an environmental database search and historical records review; review of available aerial photography, and interviews with key employees of GM. The following tasks were conducted during this assessment:

- review of federal and state environmental databases and historical records;
- review of past and current property usage and adjacent property occupancy;
- review of available aerial photography;
- inspection of the Site demolition, and records for the Site;
- observations of any conditions that represented potential environmental concerns;
- review of historic raw material usage and storage and spill/release incidents;
- review of the historic compliance status of any environmental permits and registrations;
- review of historic waste handling, accumulation, storage, and disposal practices;
- review of historic wastewater discharges;

**Privileged and Confidential
Prepared at General Motors
Counsel's Request**

- review of the historic use of equipment that potentially contained polychlorinated biphenyls (PCBs);
- review of the historic use of potential asbestos-containing materials (ACM); and
- review of aboveground and underground storage tank records.

CRA accepted information obtained from GM employees as accurate unless written documentation or field observations contradicted it.

This report summarizes the information gathered by CRA during the Phase I ESA and identifies PAOCs associated with the Site. PAOCs have been identified through the following methods:

- i) review of documentation for the Site;
- ii) re-evaluation of environmental areas of interest identified during historic investigations at the Clark Avenue Facility; and
- iii) inspection of environmental conditions during Site demolition and concrete slab removal.

This Phase I ESA has been prepared for the use of GM, and may not be relied upon by any other party without written concurrence from CRA.

2.0 ENVIRONMENTAL DATABASES SEARCH AND HISTORICAL RECORDS REVIEW

2.1 ENVIRONMENTAL DATABASES SEARCH

CRA contracted VISTA Information Solutions, Inc. (VISTA) to conduct a search of federal and state environmental databases. The Site is an approximately 3/4 acre portion of the GM Clark Avenue Facility located at 2860 Clark Avenue as presented on Figures 1.1 and 1.2. Based on the address of the Site, the database searches were completed to assist in the identification of conditions at the Site and within a radius distance specified in ASTM Standard E1527-95, ranging from less than 1/4 mile to 1 mile. The VISTA Report is included as Appendix A. The following databases were searched with the findings as noted:

2.1.1 FEDERAL DATABASES

1. National Priority List (NPL) - The NPL, also known as the Superfund List, is a United States Environmental Protection Agency (USEPA) listing of uncontrolled or abandoned hazardous waste sites. The list is primarily based on a score that a Site receives from the USEPA's Hazardous Ranking System. These Sites are targeted for possible long-term remedial action under the Superfund Act of 1980.

FINDING: The Site was not reported to be on the NPL. The GM Clark Avenue Facility was not reported to be on the NPL. No sites within a 1-mile radius of the Site were reported to be on the NPL.

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

2. Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) - The CERCLIS List is a comprehensive listing of known or suspected uncontrolled or abandoned hazardous waste sites. These sites have either been investigated or are currently under investigation by the USEPA for the release or threatened release of hazardous substances. Once a site is placed in CERCLIS, it may be subjected to several levels of review and

**Privileged and Confidential
Prepared at General Motors
Counsel's Request**

evaluation and may ultimately be placed on the NPL. In addition to site events and milestone dates, the CERCLIS List contains financial information from the SCAP. As of February 1995, CERCLIS sites designated "No Further Remedial Action Planned" have been removed from the CERCLIS List.

FINDING: The Site was not reported to be on the CERCLIS List. The GM Clark Avenue Facility was not reported to be on the CERCLIS List. No sites within a half-mile radius of the Site were reported to be on the CERCLIS List.

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

3. No Further Remedial Action Planned (NFRAP) Sites Report - The NFRAP Sites Report, also known as the CERCLIS Archive, contains information pertaining to sites which have been removed from the USEPA's CERCLIS Database. NFRAP sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly without the need for the site to be placed on the NPL, or the contamination was not serious enough to require federal Superfund action or NPL consideration.

FINDING: The Site was not reported to be listed in the NFRAP Sites Report. The GM Clark Avenue Facility was not reported to be in the NFRAP Site Report. No sites within a half-mile radius of the Site were reported to be listed in the NFRAP Sites Report.

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

4. Resource Conservation and Recovery Act (RCRA) - Treatment, Storage and Disposal Facilities (RCRA-TSD) Report - The EPA's RCRA Program identifies and tracks hazardous waste from the point of generation to the point of disposal. The RCRA Facilities database is a compilation by the EPA of facilities, which report generation, storage, transportation, treatment or disposal of hazardous waste. RCRA TSDs are facilities which treat, store, and/or dispose of hazardous waste.

FINDING: The Site is a portion of the GM Clark Avenue Facility, which was reported to be in the RCRIS-TS Report (see Section 3.2.8 for discussion). No sites within a 1-mile radius of the Site were reported to be listed in the RCRA-TSD Report.

CONCLUSION: The Site is a portion of the GM Clark Avenue Facility, which was reported in the database search to be listed in the RCRA-TSD Report. Specific discussion regarding waste disposal is presented in Section 3.2.8.

5. Resource Conservation and Recovery Act (RCRA) - Corrective Action (CORRACTS) Report - The EPA maintains this database of RCRA facilities which are undergoing "corrective action". A "corrective action order" is issued pursuant to RCRA Section 3008(h) when there has been a release of hazardous waste or constituents into the environment from a RCRA facility. Corrective actions may be required beyond the facilities boundary and can be required regardless of when the release occurred, even if it predates RCRA.

FINDING: The Site is a portion of the GM Clark Avenue Facility, which was reported to be in the CORRACTS Report (See Section 3.2.8 for discussion). No sites within a 1-mile radius of the Site were reported to be listed in the CORRACTS Report.

CONCLUSION: The Site is a portion of the GM Clark Avenue Facility, which was reported in the CORRACTS database search. Specific discussion regarding waste disposal is presented in Section 3.2.8.

6. Resource Conservation and Recovery Act - Large Quantity Generators (RCRA-LG) Report - The EPA's RCRA Program identifies and tracks hazardous waste from the point of generation to the point of disposal. The RCRA Facilities database is a compilation by the EPA of facilities, which report generation, storage, transportation, treatment or disposal of hazardous waste. RCRA Large Quantity Generators are facilities that generate at least 1,000 kilograms (kg) per month of non-acutely hazardous waste (or 1 kg/month of acutely hazardous waste).

**Privileged and Confidential
Prepared at General Motors
Counsel's Request**

FINDING: The Site was not reported to be listed in the RCRA-LG Report. The GM Clark Avenue Facility was reported to be listed in the RCRA-LG Report with a generator number of MID005356704. No adjacent sites were reported to be listed in the RCRA-LG Report. The only site reported within a 1/4-mile radius of the Site was the City of Detroit Fire Engine 10 located at 3396 Vinewood Street.

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

7. Resource Conservation and Recovery Act - Small Quantity Generators (RCRA-SG) Report - The EPA's RCRA Program identifies and tracks hazardous waste from the point of generation to the point of disposal. The RCRA Facilities database is a compilation by the EPA of facilities, which report generation, storage, transportation, treatment or disposal of hazardous waste. RCRA Small Quantity Generators are facilities that generate less than 1,000 kilograms (kg) per month of non-acutely hazardous waste.

FINDING: The Site was not reported to be listed in the RCRA-SG Report. The GM Clark Avenue Facility was not reported to be listed in the RCRA-SG Report. No adjacent sites were reported to be listed in the RCRA-SG Report. The following sites within a 1/4-mile radius of the Site were reported to be listed in the RCRA-SG Report:

<u>Facility</u>	<u>Address</u>
Shrader Ralph Division Dri-Slide	3450 Lovett Street
Wester Manufacturing Company	3428 Scotten Street
Detroit Edison Company Detroit Group	4141 Magnolia Street
Munoz Machine Products Site 1	2555 Clark Street
Tompkins Products	1040 West Grand Blvd.

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

8. Emergency Response Notification System (ERNS) - ERNS is a national computer database system that is used to store information on the sudden and/or accidental release of hazardous substances, including petroleum, into the environment. The ERNS reporting system contains preliminary information on specific releases including the spill location, the substance released and the responsible party. The information in the ERNS Report pertains only to those releases that occurred between October 1986 to August 1999.

FINDING: The Site is a portion of the GM Clark Avenue Facility, which was reported to be listed in the ERNS for releases which occurred in June 1992, February 1991, August 1990 and September 1990 (see Section 3.2.14 for discussion).

CONCLUSION: The Site is a portion of the GM Clark Avenue Facility, which was reported in the database search to be in the ERNS Report. Specific discussion regarding spills is presented in Section 3.2.14.

9. Toxic Release Inventory (TRI) System - The January 1998 TRI Report contains information on the industrial release and/or transfer of toxic chemicals as reportable under Title III of the Superfund Amendments and Reauthorization Act of 1986 (SARA Title III).

FINDING: The Site was not reported to be listed in the TRI Report. No adjacent sites were reported to be listed in the 1992 TRI Report. One site within a 1-mile radius of the Site was reported to be listed in the January 1998 TRI Report; which is identified as Secodyne located at 3255 Goldner Avenue for the release of acrylamide and formaldehyde.

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

2.1.2 STATE DATABASES

1. State Equivalent Priority List (SPL) – This database is provided by the Michigan Department of Environmental Quality (MDEQ), Environmental Response Division (ERD). The SPL Database is comparable to the US EPA National Priority List (NPL) as defined in Section 2.1.1(1).

FINDING: The Site was not reported to be listed on the SPL. The GM Clark Avenue Facility was not listed on the SPL. No sites within a 1-mile radius were listed on the SPL.

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

2. State Equivalent CERCLIS List (SCL) – This database is provided by the MDEQ. The Michigan Environmental Response Act (Act 451) provides for the identification, risk assessment, and evaluation of sites of environmental contamination in the State.

FINDING: The Site was not reported to be listed on the SCL Database. The GM Clark Avenue Facility was not reported to be on the SCL Database. No adjacent sites were reported to be on the SCL Database. The following sites within a 1-mile radius of the Site were reported to be on the SCL Database:

<u>Facility</u>	<u>Address</u>
Welcome Center Ambassador Prop	1428 21st Street
Parcels at Poplar 23rd	Poplar and 23rd
Ambassador Bridge Customs	Howard Street at 21st Street
Lawton Property	4445 Lawton

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

3. Michigan Facility and Tank Data Report - The Michigan Facility and Tank Data Report is a comprehensive listing of all registered active and inactive underground storage tank (USTs) located within the State of Michigan.

FINDING: The Site is a portion of the GM Clark Avenue Facility, which was reported to be listed in the Michigan Facility and Tank Data Report for having removed 39 USTs. Specific discussion related to on-Site USTs is included in Section 3.2.3. The following sites within a 1/4-mile radius of the Site were reported to be listed in the Michigan Facility and Tank Data Report:

<u>Facility</u>	<u>Address</u>	<u>Number of USTs</u>	<u>Status</u>
F&H Mini Mart, Inc.	4615 Michigan Avenue	2	In Use
		2	Closed
R&M Shearing & Processing	4086 Michigan Avenue	1	Temporarily Out of Use
Royal Cleaners	4701 Michigan Avenue	2	In Use
		2	Temporarily Out of Use
United Meat & Deli	3273 Hubbard Street	2	In Use
Amoco Oil #7074	3458 Junction Street	3	Closed
Detroit Fire Dept. #10	3396 Vinewood Street	1	In Use
Automotive Replacement/Auto Ware	3540 Vinewood Street	2	In Use
Marvin Nelson	829 West Grand Blvd.	3	Removed
		4	In Use

CONCLUSION: The Site is a portion of the GM Clark Avenue Facility, which was reported to be listed in the Michigan Facility and Tank Data Report. Section 3.2.3 presents specific discussion of Site-related issues.

- Michigan Leaking Underground Storage Tank (LUST) Report - The Michigan LUST Report, consisting of listings maintained by the Michigan Department of Environmental Quality, is a comprehensive listing of all reported active and inactive LUSTs located within the State of Michigan.

FINDING: The Site is a portion of the GM Clark Avenue Facility, which was reported to be listed in the Michigan LUST Report (see Section 3.2.3 for discussion). No adjacent sites were reported to be listed in the Michigan LUST

Report. The following sites within a ½-mile radius of the Site were reported to be listed in the Michigan LUST Report:

<u>Facility</u>	<u>Address</u>
F&H Mini Mart	4615 Michigan Avenue
Nelson Standard Service	829 West Grand Boulevard
Dewitt Products Company	5860 Plumer Street
BP Oil	4400 West Vernor Highway
Jerry Churchhill, Inc.	2455 24 th Street
Dave's Mini Mart	3801 West Vernor Highway

CONCLUSION: The Site is a portion of the GM Clark Avenue Facility, which was reported to be listed in Michigan LUST Report. Section 3.2.3 presents specific discussion of Site-related issues.

5. Michigan Solid Waste Landfills (SWLF) Report - The Michigan SWLF Report is a comprehensive listing of all inactive and active solid waste landfills and processing facilities located within the State of Michigan.

FINDING: The Site was not reported to be listed in the Michigan SWLF Report. The GM Clark Avenue Facility was not reported to be in the Michigan SWLF. No sites within a half-mile radius of the Site were reported to be listed in the Michigan SWLF Report.

CONCLUSION: No concerns exist at the Site based on the VISTA database search.

2.2 HISTORICAL RECORDS REVIEW

2.2.1 SANBORN FIRE INSURANCE MAPS

Sanborn Fire Insurance Maps assist in the identification of historic land use and commonly indicate the existence and location of aboveground and underground storage tanks, structures, improvements and facility operations. Sanborn Maps were reported to be available for the Site and were reviewed by CRA for the years 1884, 1897, 1921,

**Privileged and Confidential
Prepared at General Motors
Counsel's Request**

1951, 1988, and 1991. Copies of the available Sanborn Maps are presented in Appendix B.

The 1884 Sanborn Map indicated that the Site was occupied by residential dwellings. The Site was bordered to the east by Scotten Avenue, and beyond by residential dwellings, and the William W. Dwight & Company, wholesale lumber and hardwood dealers. The Site was bordered to the south by railroad tracks, and beyond by residential dwellings and a varnish works, including a kiln. The Site was bordered to the west by Clark Avenue, and beyond by the Detroit Car Wheel Company and the Michigan Car Company, including several foundries, sheds, dry kilns, car timber piles, a blacksmith shop, a wood machine shop, a repair shop, and a metal shavings conveyor and storage area. The land use of the property north of the Site was not indicated on the map.

The 1897 Sanborn Map indicated that the Site was occupied by the Michigan Peninsular Car Company and its lumber yard, residential dwellings, an engine house, several stores, and Standard Oil Company. The Site was bordered to the west by Clark Avenue and the remainder of the Michigan Peninsular Car Company. The remaining adjacent land use was not indicated on the map.

The 1921 Sanborn Map indicated that the Site was occupied by a portion of the Cadillac Motor Car Company which consisted of an assembly building, a car storage and service stock building ~~and several bunk houses~~. ~~Additional stores, residential dwellings, garages, a filling station, and a gasoline tank were also indicated to be present on the northeast portion of the Site; however, Standard Oil Company was no longer indicated to be present.~~ The adjacent property to the west of the Site was occupied by other portions of the Cadillac Motor Car Company, including a powerhouse, a heat treat building, and a machine shop. The remaining adjacent land use was not indicated on the map.

The 1951, 1988, and 1991 Sanborn Maps indicated that the Site was occupied by a portion of the General Motors Corporation Cadillac Motor Car Division. The buildings and operations located on the Site included ~~auto experimental buildings, a salvage building,~~ an assembly building, ~~office,~~ several paint dip tanks and a car storage and service stock building. The adjacent property was occupied by other portions of the GM

✓
Cadillac Motor Car Division, including factory buildings, ~~oil storage areas, a power house, an engineering building, machine shops, and several tool sheds.~~
land

CONCLUSION: Based on the review of Sanborn Maps, the Site has been used for industrial purposes since the late 1800's.

2.2.2 PROPERTY TITLE SEARCH

CRA contracted Milliken & Michaels Credit Services to conduct a search of property title records and other documents (lease agreements, easements, etc.), dated from at least 1940 (or the date of the first recorded deed) to the present, associated with ownership or occupation of the Central Areas of the GM Clark Avenue Facility. The title search was prepared for a larger property than that which is defined in this Phase I ESA as the Site, and is therefore not included in this report.

Based on the title search conducted, the majority of the Site has been owned by GM since the early 1900's.

2.2.3 AERIAL PHOTOGRAPHS

Aerial photographs from the years 1937, 1949, 1952, 1956, 1961, 1966, 1970, 1972, 1975, 1981, 1985, 1990, and 1995 were reviewed to determine the historic uses of the Site and to identify activities and land uses at surrounding properties which may have impacted the Site. The following information was interpreted from the review of available aerial photographs. Selected aerial photographs are presented in Appendix C.

The 1937 aerial photograph identified the area around the Site to be a combination of residential, commercial, and industrial property. The Site was occupied by what appeared to be the GM Clark Avenue Facility buildings ~~and several large parking lots.~~
The Site appeared to be bordered by industrial property to the east; industrial property and Conrail Railroad to the south, and commercial, residential and industrial property beyond the Grand Trunk Western Railroad and Michigan Avenue to the north and northwest. One industrial property north of the crossing of the Grand Trunk Western Railroad and Michigan Avenue appeared to have a series of eight above ground storage tanks located at the northeast corner of the property.

**Privileged and Confidential
Prepared at General Motors
Counsel's Request**

The remaining aerial photographs showed minimal changes in Site buildings and parking lots until 1990, when demolition of building structures was observed. Surrounding property use was a consistent mixture of residential, industrial, and commercial. In the 1985 photograph, the eight aboveground storage tanks observed on the industrial property north of the Site appeared to have been removed.

CONCLUSION: Based on the review of the identified aerial photographs, the majority of the Site has been used for industrial purposes since the 1930's.

3.0 SITE REVIEW

A re-development program is currently underway at the GM Clark Avenue Facility, located at 2860 Clark Avenue in Detroit, Michigan. All aboveground structures ~~at the~~ ~~site~~ have been demolished and removed. The demolition of the concrete floor slab, and associated sub-grade concrete structures, was substantially completed in December 1996. This Site review is based on Site conditions encountered in the period from September 1996 to December 1996 and includes a review of available information from GM files; and PAOCs identified during demolition activities.

The Site review is presented in the following sections:

- Section 3.1 Historical Site Assessments
- Section 3.2 Review of Site Records/Site Inspection
- Section 3.3 CRA Evaluation of Historical Environmental Areas of Interest Identified by Previous Investigations
- Section 3.4 Potential Areas of Concern Identified During Demolition Oversight Activities

3.1 HISTORICAL SITE ASSESSMENTS

3.1.1 USEPA PRELIMINARY ASSESSMENT AND VISUAL SITE INSPECTION

In October and November 1991, the United States Environmental Protection Agency (USEPA) conducted a Preliminary Assessment (PA) and Visual Site Inspection (VSI) of the Clark Avenue Facility. The PA/VSI included a review of the history and operations, inspection of current conditions, and summary of environmental concerns. The PA/VSI identified Solid Waste Management Units (SWMUs) and Areas of Concern (AOCs) (as identified by USEPA in the PA/VSI), at the Clark Avenue Facility. Eleven SWMUs and no AOCs were identified by the USEPA at the Clark Avenue Facility. Of the 11 SWMUs, four were located near the vicinity of the Site. The exact location of the four SWMUs could not be determined. No releases from these units were identified during the PA/VSI.

*not surveyed + therefore
after Jan*

3.2 REVIEW OF SITE RECORDS/SITE INSPECTION

The Phase I ESA presented in this report is based upon Phase I ESA Site inspection activities completed by CRA during the period from September 1996 to December 1996, concrete slab removal oversight activities (i.e., during concrete floor slab removal) completed by CRA during the period from July 1996 to December 1996, and a detailed review of records for the Site.

3.2.1 SITE OVERVIEW

The Site is located in a mixed residential, commercial, and industrial area of Detroit, Michigan (see Figure 1.1). The Site is comprised of approximately 3/4 acre of industrial zoned land formerly owned by GM.

The Site was part of the headquarters of the GM Cadillac Motor Car Division until 1993. The Site was used by GM as a portion of an automobile assembly plant including ~~painting~~, parts plating, ~~receiving docks~~, and administrative offices.

Between 1988 and 1989, a total of 19 buildings were demolished at the Clark Avenue Facility. The remaining 39 buildings were removed in the final phase of demolition that began in 1995 and continued until early 1996. Final demolition of the concrete floor slab and associated concrete structures was generally complete by December 1996. Re-development of the Site is on-going. There are two parcels which have been re-developed and are located on the west side of Clark Avenue.

storage laboratory, and buffing operations

3.2.2 ENVIRONMENTAL SETTING

A. Setting

The Site is located in a mixed residential, commercial, and industrial area of Detroit, Michigan. The Site is zoned for industrial purposes. The Site is currently covered with any remaining concrete floor slab or crushed granular concrete (recycled on Site). Access to the Site is available from Michigan Avenue onto Clark Avenue.

The Site is bordered on all sides by industrial zoned property historically owned and operated by GM. No adverse impact to the Site from adjacent businesses or properties was observed by CRA during Site visits.

Aerial photographs were reviewed for the Site for several years between 1937 and 1995. The aerial photographs show the various states of construction and demolition of Site buildings. The photos from 1990 and 1995 show the progressive demolition of Site buildings. No potential on-Site fill areas were observed in any of the aerial photographs.

Portions of the Clark Avenue Facility were built prior to 1920. Over the years the plant had significantly increased in size. Adjacent areas which had been utilized for residential, commercial, or industrial purposes had been acquired and incorporated into the Facility operations. Review of available records indicated that past activities around the Site have included an ink plant, die cast operation, milk can factory, tanning house, foundry, "job shop" plater, and a paint company.

B. Building Description

All above grade on-Site structures had been completely demolished. Demolition of the concrete floor slab was substantially complete by December 31, 1996.

C. Zoning

The Site is in a portion of Detroit, Michigan which is zoned for industrial activities. Industrial activities have been ongoing at the Site from at least the mid-1800s.

The Site is located in a Federal Empowerment Zone targeted for significant inner-city re-development. Re-development construction activities are currently ongoing.

D. Site Soils

The Site is located in the City of Detroit, Wayne County, Michigan in an area typified by flat lake plain sediments. Surface soils of the area are identified as the Pewamo-Blount-Metamore association, which is identified to contain nearly level

poorly drained soils. On-Site soils include engineered fill and some sandy or silty deposits which directly overlies the regionally extensive lacustrine clay plain of southeastern Michigan.

E. Geology

The overburden is comprised of a relatively thin layer of fill or silty sand which overlies a regionally extensive lacustrine clay plain.

F. Hydrogeology

Surficial groundwater in this area of Wayne County is generally considered to be perched water (i.e., groundwater not in an "aquifer" pursuant to Act 451). This is due to the fact that the groundwater zone is discontinuous and has only a limited yield.

The natural flow direction for this perched water is to follow surface topography with direct discharge to surface water features such as ditches, streams, or rivers. Utility trenches, including storms and sanitary sewers will serve to artificially collect perched water where present.

The lacustrine clay layer serves as an effective aquitard to the downward migration of any perched groundwater.

3.2.3 UNDERGROUND STORAGE TANKS (USTS)

Review of files and reports indicated that no USTs were located on the Site. The Michigan Department of Environmental Quality – Underground Storage Tank Division (MDEQ – USTD) reported in June 1996 that 39 registered USTs had been removed from the GM Clark Avenue Facility.

3.2.4 ABOVEGROUND STORAGE TANKS (ASTS)

Review of available files and reports indicated that all ASTs have been removed from the Site. Since the environmental deactivation of assembly operations at the Site began

in 1987, a total of 2 ASTs have been removed from the Site and disposed as identified below:

#	<i>Plant AST</i>		<i>Contents</i>	<i>Date</i>
	<i>Number</i>	<i>Capacity</i>		<i>Removed</i>
1	41	12,400 gal.	Sulfuric Acid	unknown
2	51	10,000 gal.	Hydrochloric Acid	unknown

Figure 1.2 presents the historic AST locations.

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to ASTs.

3.2.5 UTILITY SERVICES

Process and potable water were supplied to the Site by the City of Detroit [Detroit Water and Sewer Department (DWSD)]. No evidence of water wells were noted in the review of available information and the use of groundwater wells is prohibited by City ordinance.

Sanitary and treated process wastewaters were discharged to sanitary sewer outfalls at McKinstry Street, Clark Avenue, and Scotten Avenue. Process wastewaters were treated at a GM-operated wastewater treatment facility south of the Site prior to sewer discharge. No evidence of a septic system was noted in the review of available information.

Electricity ^{was} provided by The Detroit Edison Company (Detroit Edison). Natural gas ^{was} provided to the Site by Michigan Consolidated Gas Company (Michcon).

3.2.6 RAW MATERIAL USE AND STORAGE

Based on information contained in records, a ~~wide~~ variety of raw materials have been historically used and stored on Site. These materials include plating compounds, ~~paints, thinners,~~ acids, caustics, ~~sealants, adhesives, boiler treatment materials, and various~~

^{and}

~~petroleum products including diesel fuel, gasoline, fuel oils, coolants, and hydraulic oils.~~ The majority of the raw materials associated with the Site had historically been received in bulk, via tanker truck or rail car, and in various-sized containers. Raw materials received in bulk were stored in the on-Site ASTs.

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to raw material use and storage.

3.2.7 SOLID WASTE

Based on information, solid waste generated at the Site consisted of general office wastes, metal shavings, scrap metal, and miscellaneous packaging materials. The records indicate that solid waste was disposed of at various landfill facilities throughout Michigan and Ohio.

No records or evidence of on-Site solid waste disposal was found by CRA in the records.

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to solid waste.

3.2.8 HAZARDOUS WASTE

The Site is a portion of the GM Clark Avenue Facility, which was assigned EPA ID# MID005356704 as a RCRA Transportation, Storage and Disposal Facility in the RCRA-LG database. The GM Clark Avenue Facility began operating as a RCRA Large Quantity Generator in 1987, accumulating wastes for no more than 90 days. The former RCRA container storage pad was located at the GM Clark Avenue Facility but not on the Site. A Closure Certification was submitted to the MDEQ-Waste Management Division (WMD) in December 1996 and approved. A copy of the Closure Certification approval is included as Appendix D. A request for termination of hazardous waste generator identification number was submitted to the MDEQ-WMD in May 2000.

and accepted by

The Site is a portion of the GM Clark Avenue Facility, which was reported to be listed in the CORRACTS database, as discussed in Section 2.1. Seven facility violations were reported from January 1985 to December 1992. Based on information reviewed, all violations have been resolved.

Based on the information reviewed there are no PAOCs on-Site related to hazardous waste.

3.2.9 POLYCHLORINATED BIPHENYLS (PCBS)

A comprehensive PCB maintenance and inspection program was conducted at the Site by Clark Avenue Facility staff. All PCB capacitors were removed from the Site and properly disposed before demolition of the buildings. Figure 1.2 presents the number of PCB capacitors by historic building location, according to plant files. Available GM files indicate that no PCB transformers existed on the Site.

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to PCBs.

3.2.10 ASBESTOS-CONTAINING MATERIAL (ACM)

Industrial Environmental Consultants prepared a comprehensive ACM survey, dated August 9, 1991. TolTest, Inc. conducted a second survey in 1994 and the results were incorporated into the Site asbestos abatement program which was implemented prior to demolition.

Prior to demolition activities, all ACM was reported to be properly abated and disposed.

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to ACM.

3.2.11 INDUSTRIAL WASTEWATER/SANITARY SEWERS

The Site was serviced by the DWSD. Industrial wastewater and sanitary sewer systems were present at the Site. Sanitary wastewater consisted of domestic wastewater generated by Site sinks and toilets. Industrial wastewater consisted of general and oily wastewaters generated throughout the facility.

and plating operations
Sources of industrial wastewater discharge included roof drain discharges, wash bays, wash tanks, and floor drains. Since its construction in 1970, the wastewater treatment plant (WWTP) located southwest of the Site treated all industrial wastewater generated at the Site prior to the permitted discharge to the DWSD sewer system through three sewer discharge outfalls. *electroplating*
~~The WWTP was capable of treating general and oily wastewaters generated throughout the Site.~~

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to wastewater or sewers.

3.2.12 STORMWATER

Stormwater from the roofs of Site structures was directed through roof drains and downspouts to exterior Site surfaces or through underground piping to the storm sewer system. Stormwater runoff from exterior Site surfaces flowed into on-Site catch basins which discharged to the wastewater treatment facility. The stormwater run-off was then treated along with the industrial process wastewater before discharge to the DWSD sewer system (Permit No. 004-086).

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to stormwater issues.

3.2.13 IONIZING RADIATION

No record of radon gas testing exists in the files. The USEPA has determined the City of Detroit to be in a Level 3 radon zone. The predicted indoor screening levels of radon gas are expected to be less than 2 pCi/L.

According to GM files, no man-made sources of radiation were reported to be used on Site.

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to ionizing radiation.

3.2.14 SPILLS/RELEASES

The Site is a portion of the GM Clark Avenue Facility, for which a spill reporting and minimization effort was maintained. A review of records indicated that spills at the GM Clark Avenue Facility for the time period of 1978 through 1998 were documented.

The Site is a portion of the GM Clark Avenue Facility, which was reported to be listed in the January 1998 TRI Report for the release of hydrochloric acid, sulfuric acid, cyanide compounds, nickel compounds, copper compounds, and chlorine. The TRI Report did not identify any specific location for the releases; however, several of these constituents were related to Site activities, specifically the historic plating area, which is located north of the Site.

The Site is a portion of the GM Clark Avenue Facility, which was reported to be listed in the ERNS database for a release of gasoline in June 1992, cyanide waste water in February 1991, gasoline in August 1990, and stoddard solvent in September 1990. The ERNS Report did not identify any specific location for the releases; however, based on Site activities, it is unlikely that these releases occurred on Site.

Based on the information reviewed during this Phase I ESA, there are no PAOCs on Site related to spills or releases.

3.2.15 CERCLA LIABILITY POTENTIAL

The Site or the GM Clark Avenue Facility is not listed on the NPL or in the Docket database; therefore, this area is not a PAOC.

4.0 SUMMARY OF IDENTIFIED PAOCs

Based on the Phase I ESA including the Site inspection, information provided by GM representatives and regulatory agencies, documents reviewed, the environmental database searches, and demolition oversight activities, no PAOCs have been identified for the Site.


**Privileged and Confidential
Prepared at General Motors
Counsel's Request**

All of Which is Respectfully Submitted,
CONESTOGA-ROVERS & ASSOCIATES

Frank Ring, P.E.

Glenn Turchan, P. Eng.

former

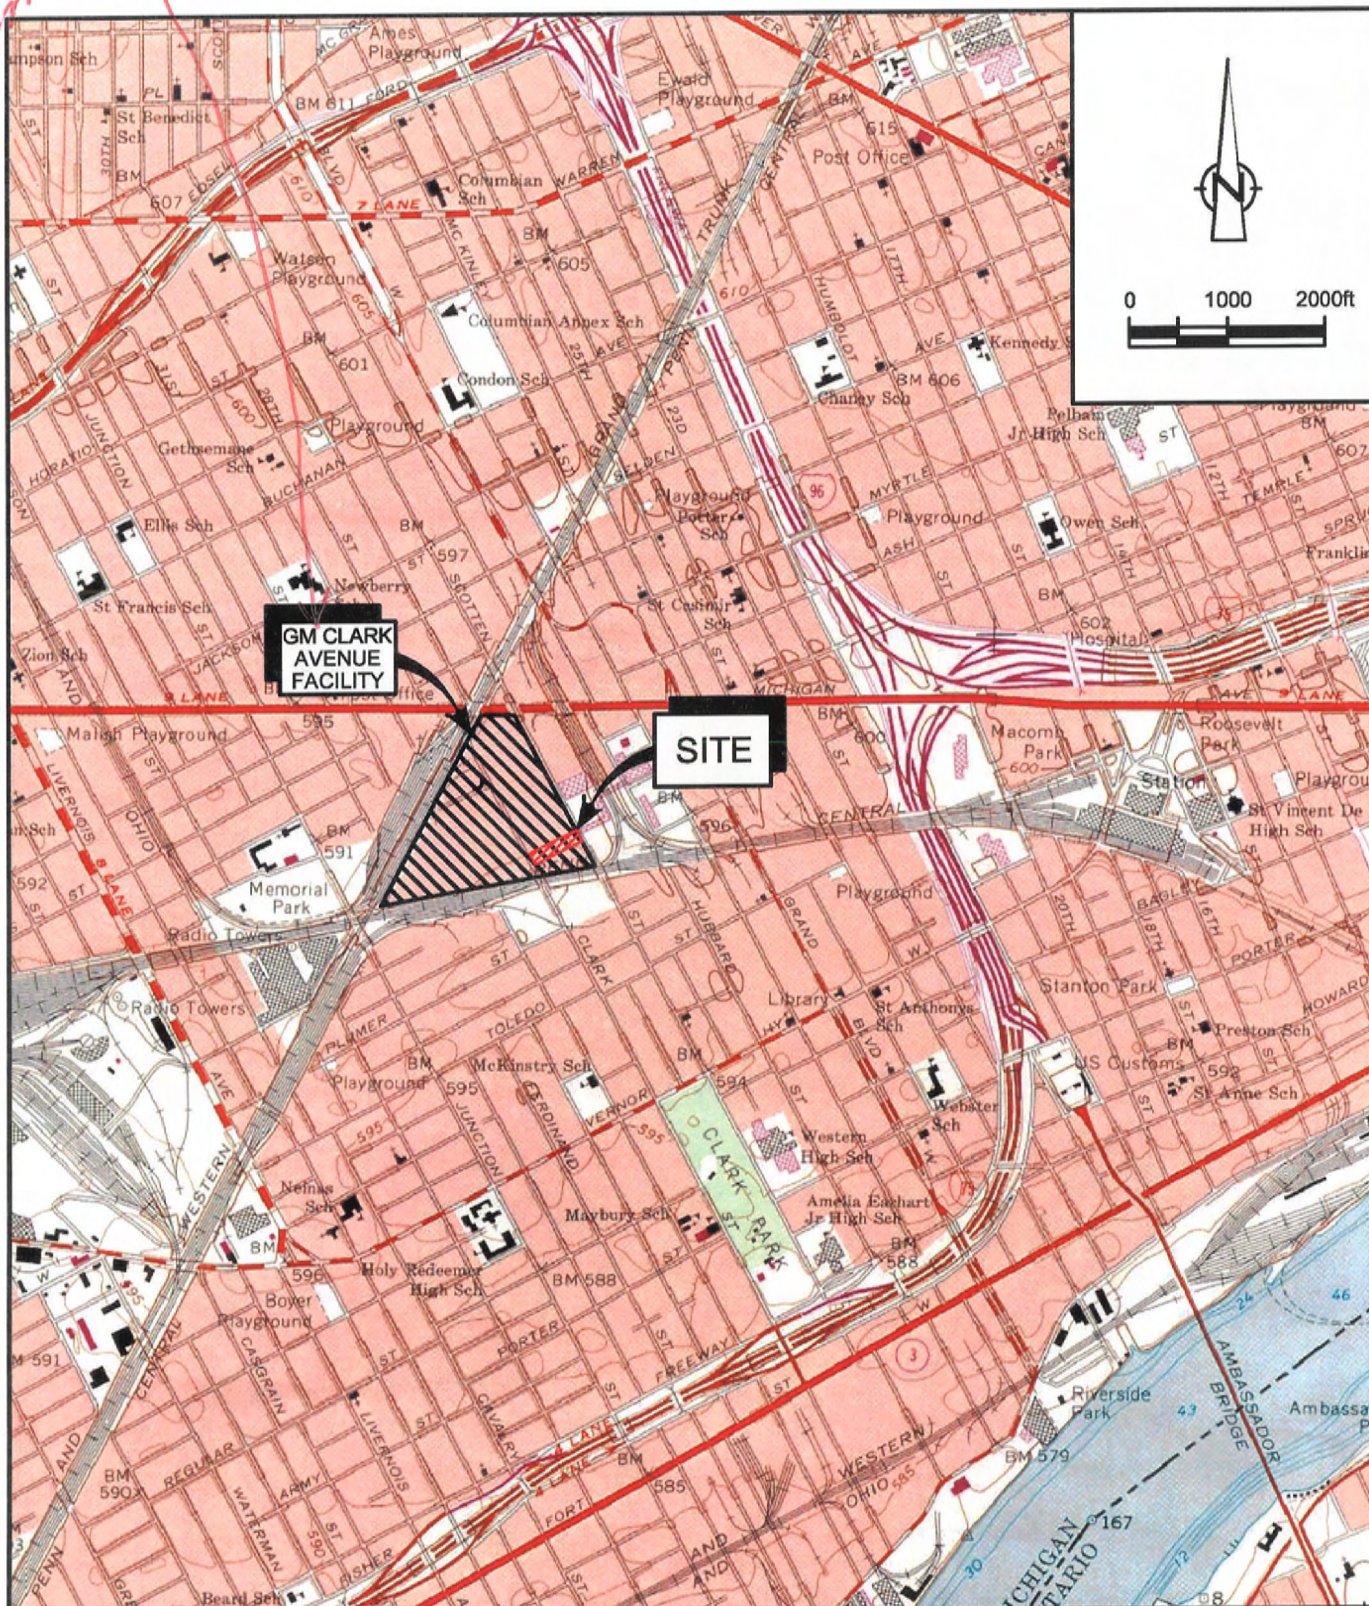



SOURCE: USGS QUADRANGLE MAP;
DETROIT, MICHIGAN



CRA

08889-10(042)GN-DE001 MAY 26/2000

figure 1.1
SITE LOCATION
CITY OF DETROIT PROPOSED RIGHT-OF-WAY
GM CLARK AVENUE FACILITY
Detroit, Michigan

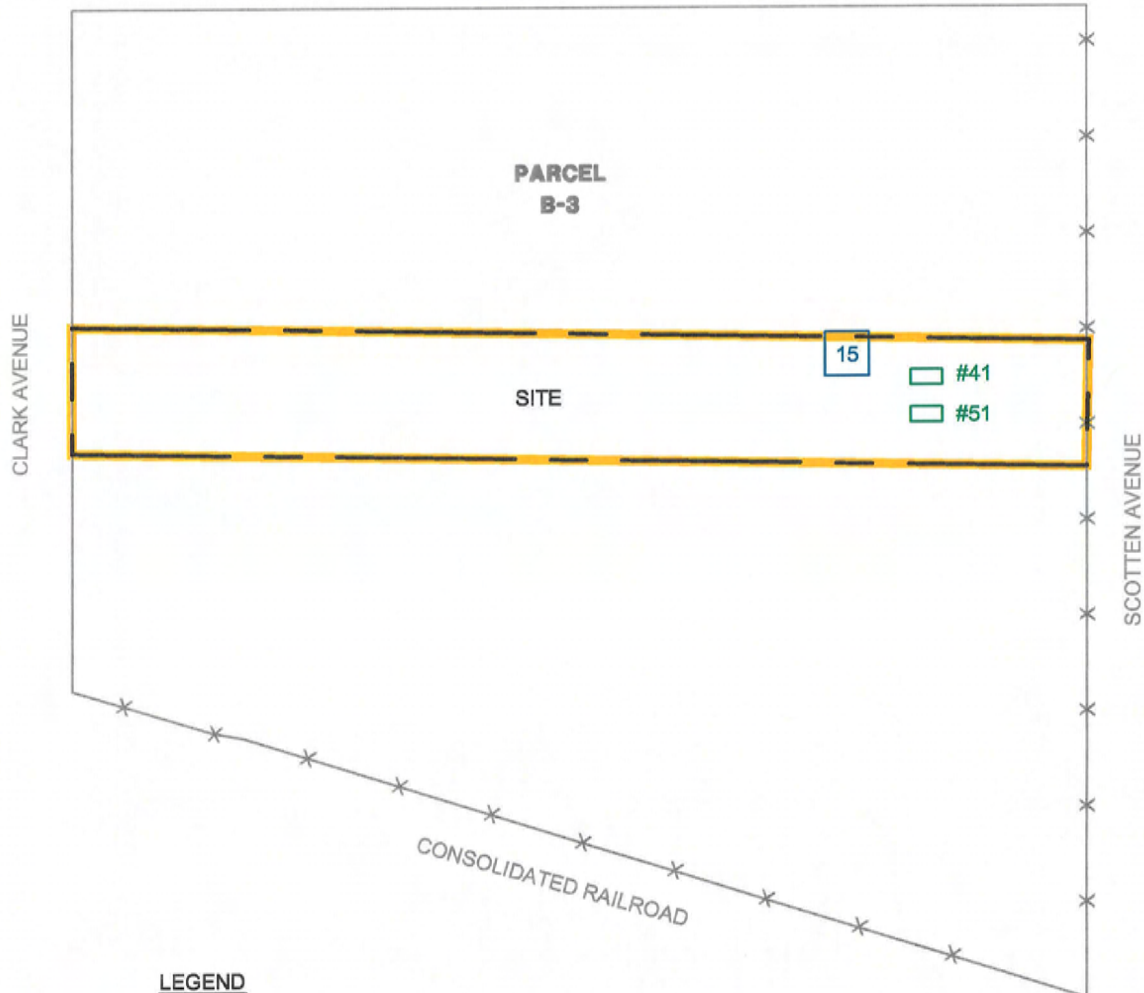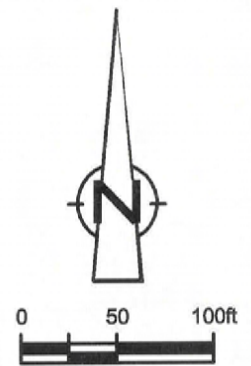

LEGEND

15

NUMBER OF PCB CONTAINING CAPACITORS REMOVED,
BY BUILDING, FROM 1993 ANNUAL PCB SUMMARY LOG

#41

APPROXIMATE AST LOCATION BASED ON A DRAWING
BY THE CHESTER ENGINEERS DATED MARCH 1988



SITE BOUNDARY

figure 1.2

SITE PLAN
CITY OF DETROIT PROPOSED RIGHT-OF-WAY
GENERAL MOTORS CLARK AVENUE FACILITY
Detroit, Michigan

CRA

APPENDIX A

ENVIRONMENTAL DATABASE SEARCH

CRA SITE ASSESSMENT REPORT

PROPERTY INFORMATION	CLIENT INFORMATION
Project Name/Ref #: 8889-10 8889-10 2860 Clark Avenue Detroit, MI 48232 Latitude/Longitude: (42.329779, 83.102242)	Kelly Splain Conestoga-Rovers Associates 8615 W. Bryn Mawr Chicago, IL 60631

Site Distribution Summary	within 1/4 mile	1/4 to 1/2 mile	1/2 to 1 mile	>1 mile
Agency / Database - Type of Records				
A) Databases searched to 1.25 mile:				
US EPA NPL National Priority List	0	0	0	0
US EPA CORRACTS (TSD) RCRA Corrective Actions and associated TSD	1	0	0	0
STATE SPL State equivalent priority list	0	0	0	0
STATE SCL State equivalent CERCLIS list	0	0	1	3
US EPA CERCLIS / NFRAP Sites currently or formerly under review by US EPA	0	0	1	3
US EPA TSD RCRA permitted treatment, storage, disposal facilities	0	0	0	0
STATE REG CO LUST Leaking Underground Storage Tanks	5	3	19	24
STATE/ REG/CO SWLF Permitted as solid waste landfills, incinerators, or transfer stations	0	0	0	0
US EPA TRIS Toxic Release Inventory database	1	0	1	0
US EPA ERNS Emergency Response Notification System of spills	1	2	10	6
B) Databases searched to 0.5 mile:				
STATE UST Registered underground storage tanks	7	4	-	-
US EPA GNRTD RCRA registered small or large generators of hazardous waste	4	6	-	-

This report meets the ASTM standard E-1527 for standard federal and state government database research in a Phase I environmental site assessment. A (-) indicates a distance not searched because it exceeds these ASTM search parameters.

LIMITATION OF LIABILITY

Customer proceeds at its own risk in choosing to rely on VISTA services, in whole or in part, prior to proceeding with any transaction. VISTA cannot be an insurer of the accuracy of the information, errors occurring in conversion of data, or for customer's use of data. VISTA and its affiliated companies, officers, agents, employees and independent contractors cannot be held liable for accuracy, storage, delivery, loss or expense suffered by customer resulting directly or indirectly from any information provided by VISTA.



For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000


Version 2.6.1

Page #1



CRA SITE ASSESSMENT REPORT

Map of Sites within Quarter Mile

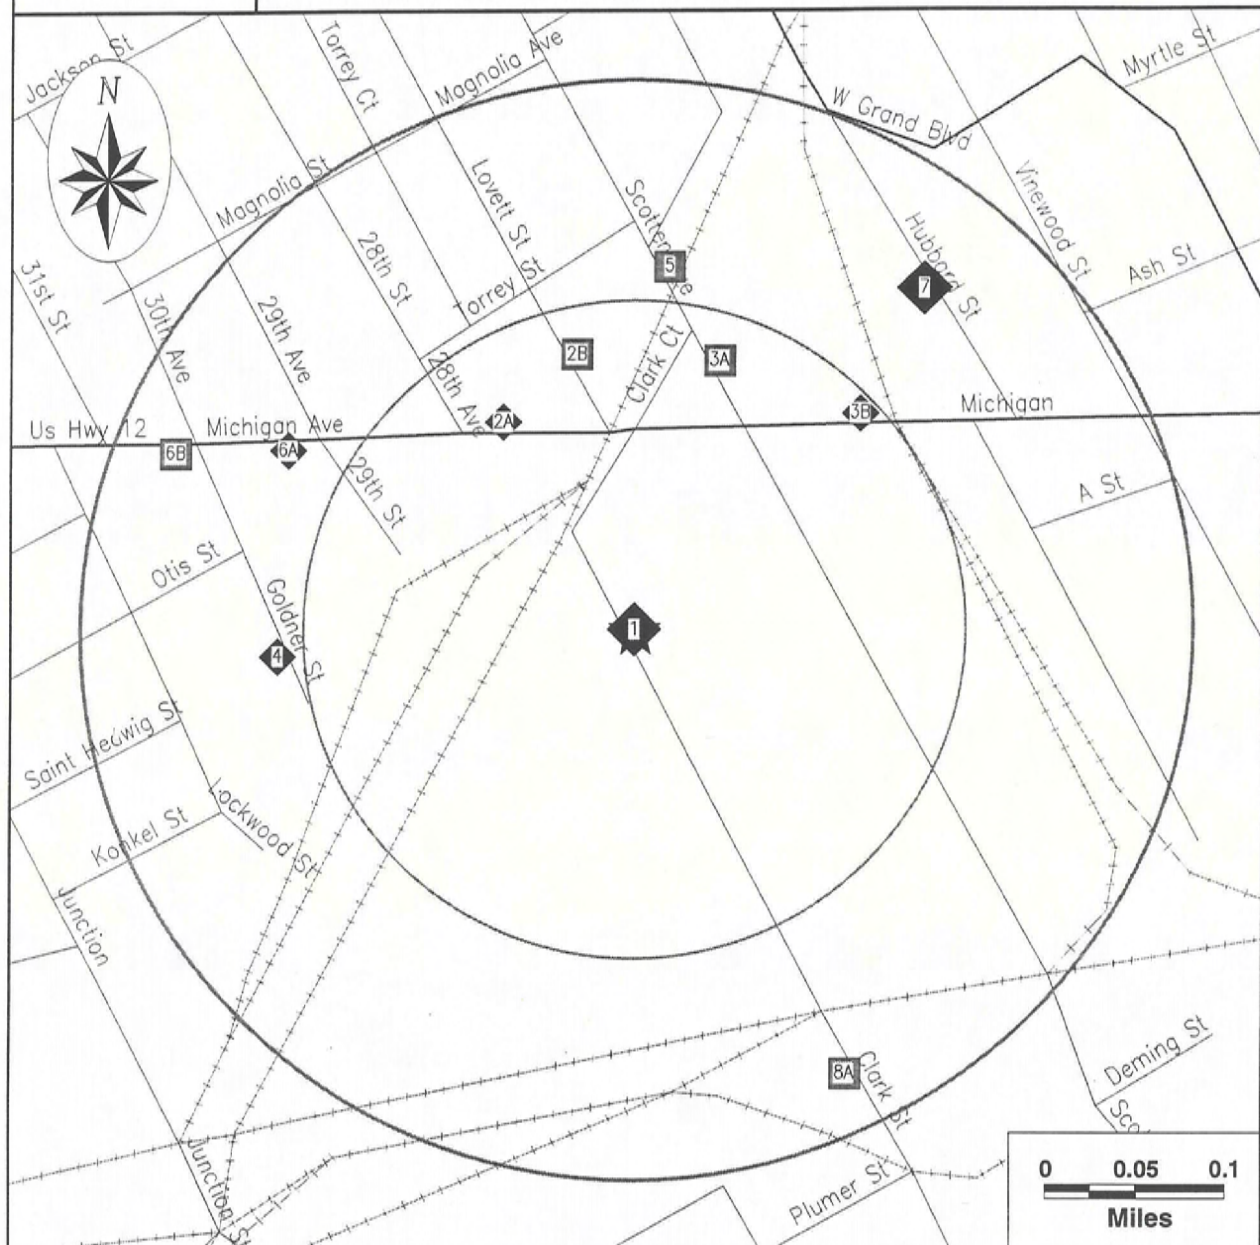

Subject Site	Category:	A	B	C	D
	Databases Searched to:	1 mi.	1/2 mi.	1/4 mi.	1/8 mi.
★	Single Sites	◆	■	△	○
	Multiple Sites	◆◆	■ ■	△ △	○ ○
	Highways and Major Roads	NPL, SPL, CORRACTS (TSD)	CERCLIS, NFRAP, TSD, LUST, SWLF, SCL	RCRA VIOL, TRIS, UST	ERNS, GENERATORS
	Roads				
	Railroads				
	Rivers or Water Bodies				
	Utilities				


If additional databases are listed in the cover page of the report they are also displayed on this map. The map symbol used corresponds to the database category letter A,B,C,D.

For More Information Call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403

Report ID: 249401901


Date of Report: May 24, 2000


Page #3

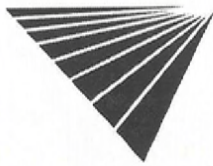

CRA SITE ASSESSMENT REPORT


Sites Represented as Polygons

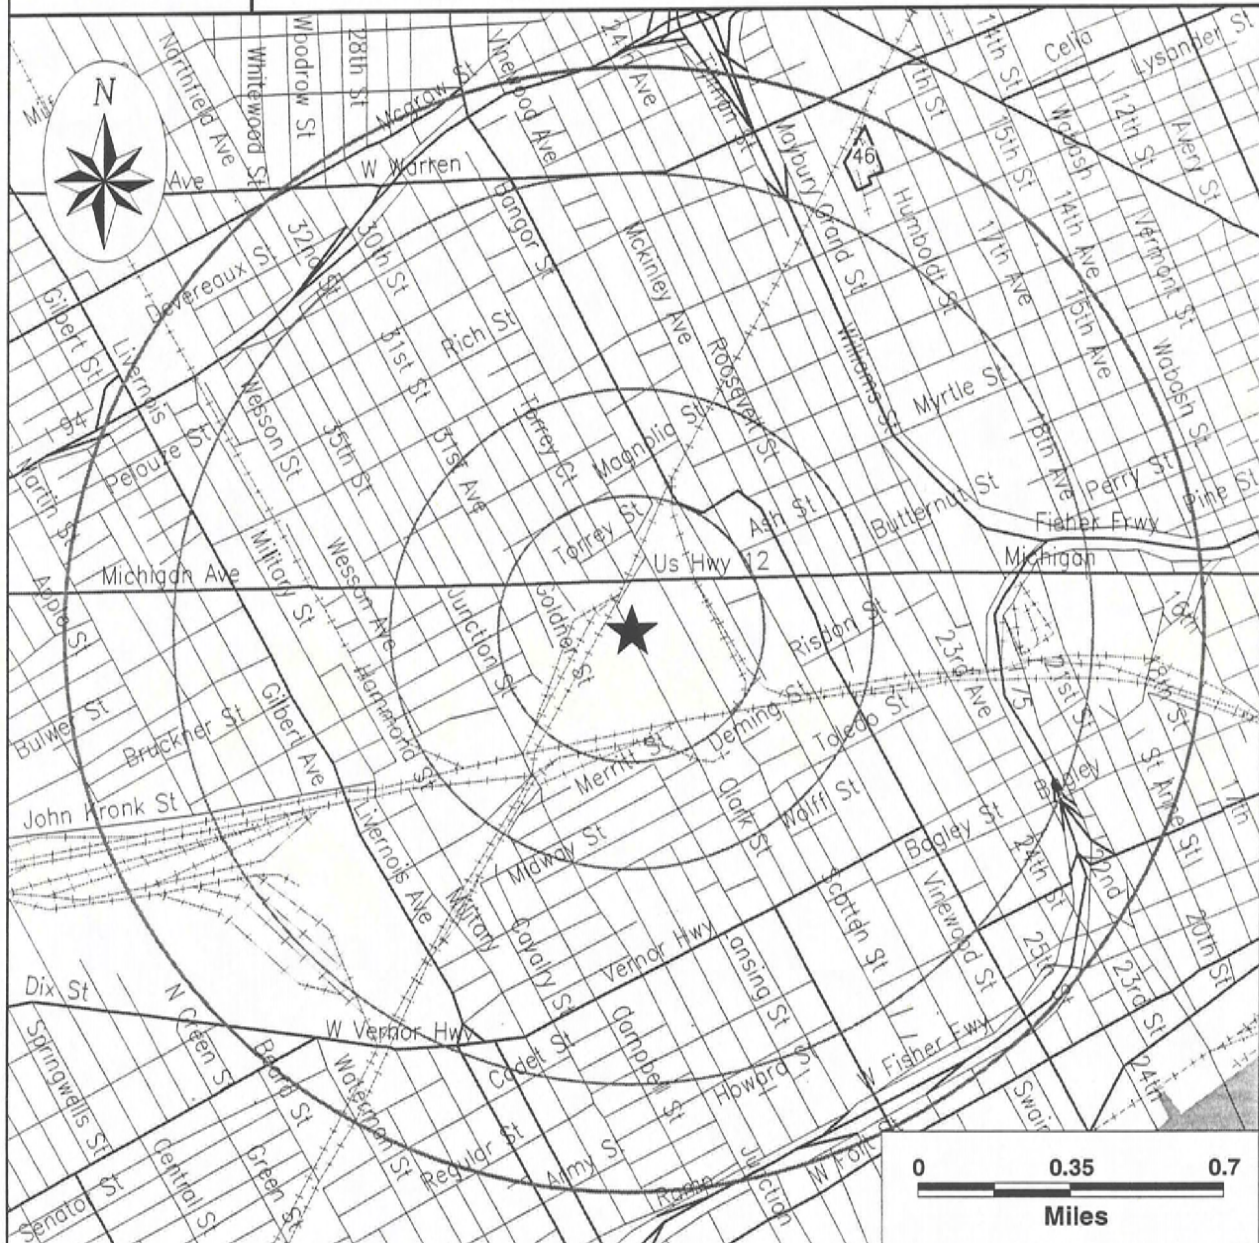

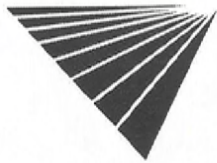

CRA SITE ASSESSMENT REPORT

Street Map

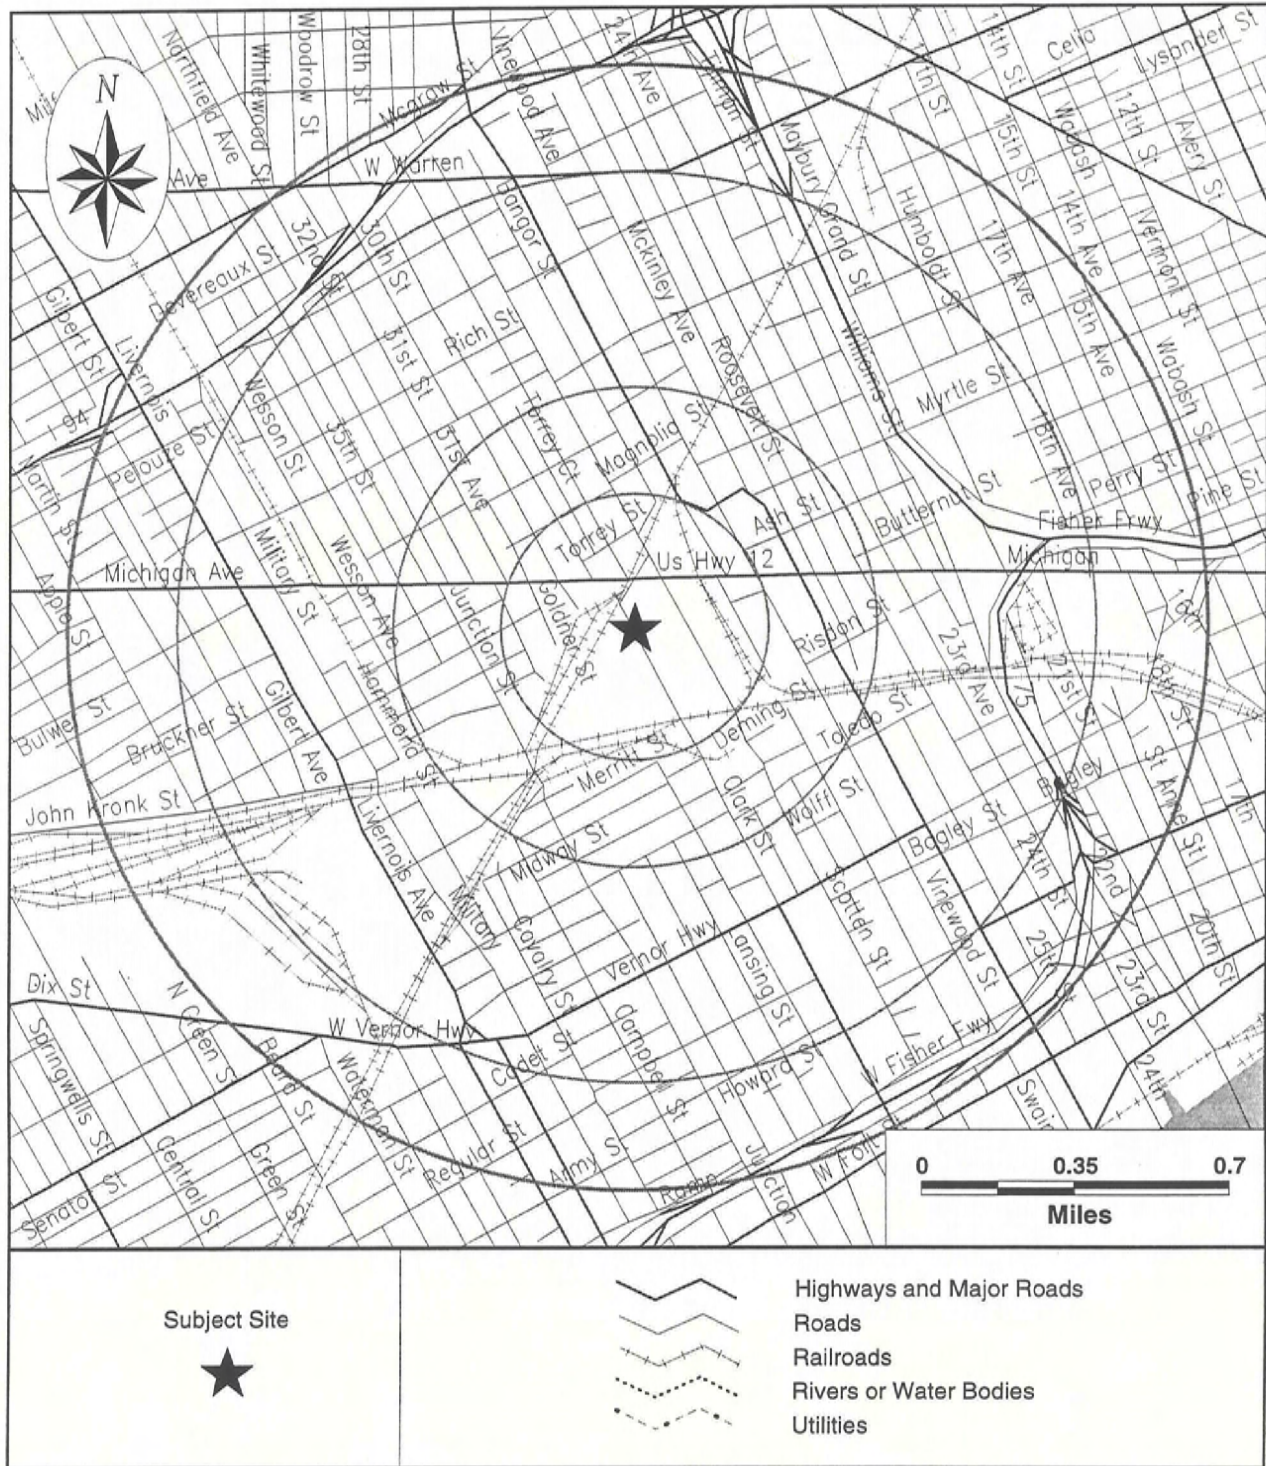

For More Information Call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403

Report ID: 249401901


Date of Report: May 24, 2000

Page #5

CRA SITE ASSESSMENT REPORT

SITE INVENTORY

MAP ID	PROPERTY AND THE ADJACENT AREA (within 1/4 mile)	VISTA ID DISTANCE DIRECTION	A										B	
			NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
1	GM CORP CLARK STREET PLANT 2860 CLARK ST DETROIT, MI 48210	1732913 0.00 MI NA							X					
1	GMC CADILLAC MOTOR CAR CLARK PLT 2860 CLARK ST DETROIT, MI 48210	173284 0.00 MI NA	X									X	X	X
2A	SHELDON CORNERS QUALITY CARS 4462 S MICHIGAN CANTON, MI 48188	3510562 0.08 MI NW							X				X	
2B	SHRADER RALPH DIV DRI-SLIDE 3450 LOVETT DETROIT, MI 48210	380544 0.10 MI N												X
3A	WOLVERINE PORCELAIN ENAMELING CO 3350 SCOTTEN AVE DETROIT, MI 48210	474003 0.10 MI NE											X	
3B	R M SHEARING PROCESSING 4086 MICHIGAN AVE DETROIT, MI 48210	3730282 0.12 MI NE							X				X	
4	SECODYNE INC. 3255 GOLDNER AVE. DETROIT, MI 48210	373365 0.14 MI W									X			
5	WESTER MFG CO 3428 SCOTTEN DETROIT, MI 48210	464310 0.15 MI N												X
6A	F H MINI MART INC 4615 MICHIGAN AVE DETROIT, MI 48210	2541567 0.16 MI W							X				X	
6B	PROFESSIONAL GARMENT SERVICE 4701 MICHIGAN AVE DETROIT, MI 48210	11506112 0.22 MI W											X	
7	UNITED MEAT DELI 3273 HUBBARD DETROIT, MI 48210	1740683 0.19 MI NE											X	
7	UNITED MEAT DELI 3273 HUBBARD DETROIT, MI 48210	6598804 0.20 MI NE							X					
8A	MUNOZ MACHINE PRODUCTS SITE 1 2555 CLARK ST DETROIT, MI 48209	7243019 0.22 MI SE												X

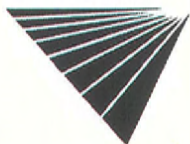

X = search criteria; • = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #6

MAP ID	SITES IN THE SURROUNDING AREA (within 1/4 - 1/2 mile)	VISTA ID DISTANCE DIRECTION	A										B	
			NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
8	BULK TRANSPORT OF ESSEXVI 2441 CLARK ST DETROIT, MI 48209	8368045 0.32 MI SE										X		
9	TOMPKINS PRODUCTS 1040 W GRAND BLVD DETROIT, MI 48208	426196 0.26 MI NE												X
9	AUTOMOTIVE REPLACEMENT PARTS 3540 VINEWOOD AVE DETROIT, MI 48208	1761231 0.30 MI NE											X	
9	ARPCO 3540 VINEWOOD DETROIT, MI 48208	7294620 0.30 MI NE							X					
10	DETROIT FIRE ENG 10 CITY OF 3396 VINEWOOD DETROIT, MI 48208	5164225 0.26 MI NE							X				X	X
11	DETROIT EDISON CO SCOTTEN STATION 4141 MAGNOLIA DETROIT, MI 48210	120207 0.29 MI N												X
12	G AND G COLLISION 3058 JUNCTION DETROIT, MI 48210	1727624 0.30 MI SW												X
13	AMOCO OIL STATION #7074 3458 JUNCTION DETROIT, MI 48210	1727681 0.33 MI W											X	
14	SAMS MOTORS 829 W GRAND BLVD DETROIT, MI 48216	7103525 0.33 MI E							X					
14	SAMS MOTORS 829 W GRAND BLVD DETROIT, MI 48216	1773003 0.33 MI E											X	
15	MI CONSOLIDATED GAS CO 5672 ST HEDWIG DETROIT, MI 48210	8367398 0.36 MI W										X		
16	SHRADER ANALYTICAL AND CONSULTG LABS INC 3814 VINEWOOD DETROIT, MI 48208	380541 0.38 MI N												X
17	NEWBERRY ELEM SCHOOL 4045 29TH ST DETROIT, MI 48210	1727508 0.41 MI NW												X



X = search criteria; • = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #7

MAP ID	SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile)	VISTA ID DISTANCE DIRECTION	A										B	
			NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
18	DEWITT PRODUCTS COMPANY 5860 PLUMER AVE DETROIT, MI 48209	120736 0.56 MI SW							X				•	•
19	CHURCHILL TRANSPORTATION INC 2455 24TH ST DETROIT, MI 48216	530082 0.60 MI E										X	•	•
19	JERRY CHURCHILL INC 2455 24TH STREET DETROIT, MI 48216	5163515 0.60 MI E							X					
20	MAGNI IND. INC. 2771 HAMMOND DETROIT, MI 48209	498311 0.60 MI SW									X			
21	LAFAYETTE STEEL PROCESSING 3600 N MILITARY DETROIT, MI 48210	1773852 0.66 MI W							X				•	•
22	BP OIL 4400 VERNOR HWY DETROIT, MI 48209	1761296 0.66 MI SE							X					
22	SHELL OIL CO 4415 W VERNOR DETROIT, MI 48209	2543249 0.67 MI SE							X					•
23	4605 BANGOR DETROIT, MI 48210	8367818 0.68 MI N										X		
24	TRIANGLE BOOKBINDING 4238-24TH STREET DETROIT, MI 48208	3864608 0.68 MI NE							X				•	
24	23RD POPLAR 23RD POPLAR DETROIT, MI 48208	7663203 0.71 MI NE					X							
24	PARCELS AT POPLAR 23RD DETROIT, MI 48208	11654507 0.71 MI NE				X								
25	THORN APPLE VALLEY 3925 TILLMAN DETROIT, MI 48208	2542997 0.71 MI NE							X			X	•	
26	FARMER JACK SUPERMARKET #3 3830 W. VERNOR DETROIT, MI 48216	1761295 0.74 MI SE							X				•	
26	MAHNOND ALLEY 3801 W. VERNOR DETROIT, MI 48216	3731403 0.75 MI SE							X				•	
27	PTL LIVERNOIS YARD 2725 LIVERNOIS ST DETROIT, MI 48209	1745278 0.75 MI SW							X				•	
27	CONDEA VISTA CO. 2725 LIVERNOIS AVE DETROIT, MI 48209	8369521 0.75 MI SW										X		



X = search criteria; • = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #8

MAP ID	SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile)	VISTA ID DISTANCE DIRECTION	A										B	
			NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
28	3838 BAGLEY ST DETROIT, MI 48216	8367722 0.80 MI SE										X		
29	2394 LIVERNOIS DETROIT, MI 48209	8369519 0.81 MI SW										X		
29	DEWITS 2394 LIVERNOIS DETROIT, MI 48209	8369520 0.81 MI SW										X		
30	UNION 76 6207 TOLEDO ST DETROIT, MI 48209	8370942 0.81 MI SW										X		
30	76 GAS STATION 6207 TOLEDO DETROIT, MI 48209	2136235 0.83 MI SW										X		
31	SHELL SERVICE STATION 6248 MICHIGAN/LIVERNOIS DETROIT, MI 48210	2541601 0.83 MI W							X				•	
31	DISCOUNT MUFFLER BRAKE CENTER 4292 LIVERNOIS DETROIT, MI 48210	3864637 0.89 MI W							X				•	
32	MICHIGAN HEALTH CENTER 2700 MARTIN LUTHER KING BLVD DETROIT, MI 48208	521719 0.87 MI NE							X				•	
33	UNITED COMMUNITY HOSPITAL 2401 20TH STREET DETROIT, MI 48216	6909275 0.90 MI E							X					
33	DETROIT CITY 2633 MICHIGAN DETROIT, MI 48216	4056204 0.95 MI E							X					•
34	NATIONAL ELECTRIC 4269 LAWTON ST DETROIT, MI 48208	8369533 0.94 MI NE										X		
34	ARROW-WELDT SALES ENG. CO. 2750 POPLAR DETROIT, MI 48208	1752398 0.98 MI NE							X				•	
35	SHELL SERVICE STATION 6171 W VERNOR/DRAGOON DETROIT, MI 48209	2543252 0.94 MI S							X				•	
36	FIRE DEPT ENGINE #27 1465 JUNCTION AVE DETROIT, MI 48209	7103331 0.96 MI S							X					
37	DETROIT DPW 3040 W. VERNOR DETROIT, MI 48216	1775311 0.97 MI E							X					



X = search criteria; • = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #9

MAP ID	SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile)	VISTA ID DISTANCE DIRECTION	A										B	
			NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
38	LAWTON PROPERTY 4445 LAWTON DETROIT, MI 48208	6641962 1.00 MI NE				X	X							
38	4457 HUMBOLDT ST DETROIT, MI 48208	8368927 1.08 MI NE										X		
39	DOMESTIC LINEN SUPPLY 3800 18TH STREET DETROIT, MI 48208	1727126 1.01 MI NE							X				•	
40	HEATLEY TOWING 2810 W VERNOR DETROIT, MI 48216	1761291 1.02 MI E							X				•	•
40	POLICE DEPT PRECINCT #3 2801 W VERNOR DETROIT, MI 48216	7103867 1.03 MI E							X					
41	HIATT OIL CO 4040 W WARREN DETROIT, MI 48210	4852910 1.04 MI N							X				•	
41	STINSON FUNERAL HOME 1540 W GRAND BLVD DETROIT, MI 48208	6598749 1.05 MI N							X				•	
42	ARROW CHEMICAL PRODUCTS INC. 2067 ST. ANNE DETROIT, MI	12542728 1.05 MI E							X					
43	STEEL SVCS AND WAREHOUSE 3401 MARTIN AVE DETROIT, MI 48210	2541959 1.05 MI W							X				•	•
44	AMOCO OIL 0052 3365 WARREN DETROIT, MI 48208	1775492 1.05 MI N							X					
44	LOTTIE HUGHLEY 3201 W WARREN/WILLIAMS DETROIT, MI 48208	1763143 1.11 MI N							X				•	
45	1559 MILITARY DRIVE DETROIT, MI 48209	8369754 1.06 MI S										X		
46	CARTER INDUSTRIES INC 4690 HUMBOLDT DETROIT, MI 48208	72242 1.08 MI					X		X				•	
47	GAS ARE US 4251 W WARREN DETROIT, MI 48210	2543432 1.08 MI NW							X				•	
48	VACANT BUILDING 6575 WEST VERNOR DETROIT, MI 48209	1761299 1.09 MI SW							X				•	
49	FOREST HUMBOLDT DUMPING FOREST HUMBOLDT DETROIT, MI 48201	3145821 1.13 MI NE					X							



X = search criteria; • = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #10

MAP ID	SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile)	VISTA ID DISTANCE DIRECTION	A										B	
			NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
50	ADAMS TRANS AID CORP 6707 DIX AVE DETROIT, MI 48209	1735677 1.15 MI SW							X				•	•
51	MICH CONSOLIDATED GAS CO. 1221 24TH ST. DETROIT, MI 48216	8367445 1.15 MI SE										X		
52	AMBASSADOR BRIDGE PARCEL 4002 1407 21ST STREET DETROIT, MI 48216	3509821 1.16 MI E				X			X					
52	WELCOME CENTER AMBASSADOR PROP 1428 21ST STREET DETROIT, MI 48216	6845037 1.16 MI E				X								
53	JEFFERY M/M 2971 W WARREN DETROIT, MI 48208	6599669 1.17 MI N							X					
54	AMTRAK PASSENGER STATION 2405 W. VERNOR HWY. DETROIT, MI 48216	5327279 1.17 MI E							X					
55	TOTAL PETROLEUM 5015 LIVERNOIS DETROIT, MI 48210	5348360 1.17 MI W							X					
55	PAULINE GAS OIL 5015 LIVERNOIS DETROIT, MI 48210	11506084 1.17 MI W							X				•	
55	GORSKI BULK TRANSPORT INC I-94, LIVERNOIS EXIT DETROIT, MI	2243838 1.20 MI W										X		
56	WARREN SERVICES INC 4710 W WARREN AVE DETROIT, MI 48210	6599670 1.21 MI NW							X				•	
57	ASCD SERVICE 6756 STRATTON DETROIT, MI 48209	28565 1.21 MI SW							X				•	
57	PRESTON TRUCKING CO 6801 STRATTON ST DETROIT, MI 48209	339071 1.24 MI SW							X				•	•
58	KERRY BROS 5255 TILLMAN DETROIT, MI 48208	12429675 1.22 MI N										X		
59	GARMENT CORP OF AMERICA 4255 MC GRAW DETROIT, MI 48210	1773726 1.22 MI NW							X				•	•
60	MI CONSOLIDATED GAS CO 2634 14TH STREET DETROIT, MI 48216	12700471 1.23 MI E										X		



X = search criteria; • = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #11

MAP ID	SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile)	VISTA ID DISTANCE DIRECTION	A										B	
			NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
61	R M SHARING PROCESSING 3633 PARKINSON DETROIT, MI 48210	7478630 1.24 MI W							X				•	
62	DETROIT FIRE ENG 12 CITY OF 2775 W WARREN DETROIT, MI 48208	5188526 1.24 MI NE							X				•	•



X = search criteria; • = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.


Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #12

UNMAPPED SITES	VISTA ID	A										B	
		NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
THORNAPPLE VALLY 3295 TILLMAN DETROIT, MI 48208	8370961										X		
ST. MARYS PEERLESS CEMENT DEARBORNE AVE ROUGE RIVER BEHIND PLANT DETROIT, MI 48209	8367659										X		
JUSTIN TIME BEAUBBIEN ST AND MILWALKEE BLVD DETROIT, MI 48210	8369763										X		
HOLLOWAYS GROILE NAPIER RD DETROIT, MI 48209	198263					X							
S AND L WAREHOUSE 6307 WEST 4TH STREET DETROIT, MI 48209	8367478										X		
AMBASSADOR BRIDGE INT'L BRIDGE CO DETROIT RIVER DETROIT, MI 48216	62408542												X
ATLAS GREASE COMPANY CAMPBELL AND DRIGGS ST DETROIT, MI 48209	8368295										X		
MIDOT BRIDGE I-75 UNDER W GRAND BLVD I-75 UNDER W GRAND BLVD DETROIT, MI 48216	5651648												X
TANNER INDUSTRIES DETROIT, MI 48209	8365684										X		
BEHIND 1822 LEVERETTE IN AN ALLEY DETROIT, MI 48216	8369524										X		
PROS SERVICES 7940 LIVERONIS AVE DETROIT, MI 48210	8369522										X		
DETROIT, MI 48209	8365679										X		
ALLIED SIGNAL INC DETROIT, MI 48209	8365682										X		
DETROIT EDISON DETROIT, MI 48210	8365687										X		
ALLIEDSIGNAL INC GREAT LAKES STEEL DETROIT RIVER MM UNKN DETROIT, MI 48209	8368834										X		
VICTOR STEEL DETROIT, MI 48209	8365685										X		
BASF CORP. DETROIT, MI 48210	8365686										X		
ABANDONED PROPERTY 23 AND POPLAR DETROIT, MI 48208	8035957												X

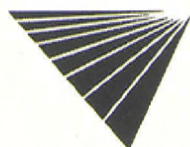

X = search criteria; * = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #13

UNMAPPED SITES	VISTA ID	A										B	
		NPL	CORRACTS(TSD)	SPL	SCL	CERCLIS/NFRAP	TSD	LUST	SWLF	TRIS	ERNS	UST	GNRTR
BASF CORP AT 5470 HECLA 5470 HECLA AVE SITE A DETROIT, MI 48208	8035875												X
3901 GRAND RIVER APT1202 DETROIT, MI 48208	8368774										X		
2535 WEST FORT DETROIT, MI 48216	8371368										X		
NRT OWNER MICHIGAN BELL YELLOW PAGES BLDG DETROIT, MI	12542989							X					
DETROIT METRO WAYNE CT AIRPORT BUILDING 514 DETROIT, MI	8619543							X					
RIGHT OF WAY MAC/DEQUINDRE DETROIT, MI	12543028							X					
LAKE ST. CLAIRE DRUM SOMEWHERE IN LAKE ST.CLAIRE DETROIT, MI	4852694					X							
DETROIT DRUM CLEAN-UP ADDRESS UNREPORTED DETROIT, MI 99999	120188					X							
RECYCLING CORPORATION OF AMERICA DETROIT, MI 48209	13148594				X								
MICHCON GAS CO 4018 HANCOCK DETROIT, MI 48210	8368941										X		
DETROIT METRO AIRPORT - EASTERN IRLINES GATE B-3 DETROIT, MI	12730779											X	
DETROIT EDISON 2013 ROSA PARK DETROIT, MI 48216	8370416										X		
HARAJLI GAS STATION MICHIGAN WYOMING DETROIT, MI	7294624							X					
VACANT PROPERTY SOUTH OF WARREN BETWEEN 4TH STREET LODGE SERV DETROIT, MI	6908932							X					



X = search criteria; • = tag-along (beyond search criteria).

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #14

CRA SITE ASSESSMENT REPORT

DETAILS

PROPERTY AND THE ADJACENT AREA (within 1/4 mile)

VISTA Address*:	GM CORP CLARK STREET PLANT 2860 CLARK ST DETROIT, MI 48210	VISTA ID#:	1732913
		Distance/Direction:	0.00 MI / NA
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		GM CORP CLARK STREET PLANT 2860 CLARK ST DETROIT, MI 0-002761	
Leak ID#:		0-002761	
Remediation Status:		CLOSED	
Description / Comment:		FACILITY COUNTY: WAYNE	
VISTA Address*:	GMC CADILLAC MOTOR CAR CLARK PLT 2860 CLARK ST DETROIT, MI 48210	VISTA ID#:	173284
		Distance/Direction:	0.00 MI / NA
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	58742
Agency Address:		GM-CADILLAC MOTORCAR CO. 2860 CLARK ST. DETROIT, MI	
Spill Date Time:		FEBRUARY 9, 1991 06:20:00 AM	
Case Number:		58742	
Spill Location:		2860 CLARK ST.	
Source Agency:		N	
Discharger Name:		JENKINS, EDDIE	
Discharger Org:		GM-CADILLAC MOTORCAR CO.	
Material Spilled:		CYANIDE WASTE WATER, 21000.00 (GAL)	
Waterway Affected:		DIRT AND GRAVEL	
Fields Not Reported:		Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release:
Facility Release:	Other Release:		
NO	NO	NO	NO
NO	NO		

Map ID

1

Map ID

1



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #15

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

ERNS - Emergency Response Notification System / SRC# 8					Agency ID:	39918
Agency Address:		GM-CADILLAC MOTORCAR CO. 2860 CLARK ST. DETROIT, MI SEPTEMBER 18, 1990 04:00:00 PM				
Spill Date Time:		39918				
Case Number:		2860 CLARK ST.				
Spill Location:		N				
Source Agency:		JENKINS, EDDIE				
Discharger Name:		GM-CADILLAC MOTORCAR CO.				
Discharger Org:		STODDARD SOLVENT, 5.00 (GAL)				
Material Spilled:		SOIL				
Waterway Affected:		Discharger Phone				
Fields Not Reported:						
Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:	
NO	NO	NO	NO	NO	NO	

ERNS - Emergency Response Notification System / SRC# 8					Agency ID:	123219
Agency Address:		GM-CADILLAC MOTORCAR CO. 2860 CLARK ST. DETROIT, MI 48232 JUNE 22, 1992 04:30:00 PM				
Spill Date Time:		123219				
Case Number:		2860 CLARK ST.				
Spill Location:		N				
Source Agency:		TENKINS, EDDIE				
Discharger Name:		GM-CADILLAC MOTORCAR CO.				
Discharger Org:		GASOLINE: AUTOMOTIVE (4.23G PB/G, 0.00 (UNK)				
Material Spilled:		SOIL				
Waterway Affected:		Discharger Phone				
Fields Not Reported:						
Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:	
NO	NO	NO	NO	NO	NO	

ERNS - Emergency Response Notification System / SRC# 8					Agency ID:	33939
Agency Address:		GM-CADILLAC MOTORCAR CO. 2860 CLARK ST. DETROIT, MI AUGUST 3, 1990 11:00:00 AM				
Spill Date Time:		33939				
Case Number:		2860 CLARK ST.				
Spill Location:		N				
Source Agency:		JENKINS, EDDIE				
Discharger Name:		GM-CADILLAC MOTORCAR CO.				
Discharger Org:		GASOLINE: AUTOMOTIVE (4.23G PB/G, 25.00 (GAL)				
Material Spilled:		CONTAINMENT TRENCH				
Waterway Affected:		Discharger Phone				
Fields Not Reported:						
Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:	
NO	NO	NO	NO	NO	NO	



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #16

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

CORRACTS / SRC# 14		EPA ID:	MID005356704
Agency Address:	SAME AS ABOVE		
Prioritization Status:	LOW		
RCRA Facility Assessment Completed:	YES		
Notice of Contamination:	NO		
Determination of need For a RFI (RCRA Facility Investigation):	NO		
RFI Imposed:	NO		
RFI Workplan Notice of Deficiency Issued:	NO		
RFI Workplan Approved:	NO		
RFI Report Received:	NO		
RFI Approved:	NO		
No Further Corrective Action at this Time:	NO		
Stabilization Meseaures Evaluation:	YES		
CMS (Corrective Measure Study) Imposition:	NO		
CMS Workplan Approved:	NO		
CMS Report Received:	NO		
CMS Approved:	NO		
Date for Remedy Selection (CM Imposed):	NO		
Corrective Measures Design Approved:	NO		
Corrective Measures Investigation Workplan Approved:	NO		
Certification of Remedy Completion:	NO		
Stabilization Measures Implementation:	NO		
Stabilization Measures Completed:	NO		
Corrective Action Process Termination:	NO		
RCRA-LqGen - RCRA-Large Generator / SRC# 16		EPA ID:	MID005356704
Agency Address:	SAME AS ABOVE		
Generator Class:	Generates at least 1000 kg./month of non-acutely hazardous waste (or 1 kg./month of acutely hazardous waste).		
STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-002761
Agency Address:	GM CORP CLARK STREET PLANT 2860 CLARK ST DETROIT, MI 48232		
Underground Tanks:	35		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	35		
Tank ID:	UNK1U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	BARE STEEL
Tank Size (Units):	6000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	UNK2U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	BARE STEEL
Tank Size (Units):	1200 (GALLONS)	Tank Material:	BARE STEEL



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #17

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

Tank ID:	UNK3U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	BARE STEEL
Tank Size (Units):	1200 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	UNK4U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	BARE STEEL
Tank Size (Units):	1200 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	UNK5U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	BARE STEEL
Tank Size (Units):	1200 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	1U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	40	Tank Piping:	BARE STEEL
Tank Size (Units):	15000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	2U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	22	Tank Piping:	BARE STEEL
Tank Size (Units):	550 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	3U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	25	Tank Piping:	BARE STEEL
Tank Size (Units):	6000 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	4U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	27	Tank Piping:	BARE STEEL
Tank Size (Units):	10000 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	5U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	19	Tank Piping:	BARE STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	6U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	26	Tank Piping:	BARE STEEL
Tank Size (Units):	5000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	7U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	22	Tank Piping:	BARE STEEL
Tank Size (Units):	550 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	8U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	19	Tank Piping:	BARE STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	UNKNOWN



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #18

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

Tank ID:	9U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	40	Tank Piping:	BARE STEEL
Tank Size (Units):	15000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	10U	Tank Status:	REMOVED
Tank Contents:	DIESEL	Leak Monitoring:	
Tank Age:	49	Tank Piping:	BARE STEEL
Tank Size (Units):	10000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	11U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	19	Tank Piping:	BARE STEEL
Tank Size (Units):	20000 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	12U	Tank Status:	REMOVED
Tank Contents:	DIESEL	Leak Monitoring:	
Tank Age:	33	Tank Piping:	BARE STEEL
Tank Size (Units):	1500 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	13U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	26	Tank Piping:	BARE STEEL
Tank Size (Units):	1500 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	14U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	26	Tank Piping:	BARE STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	15U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	26	Tank Piping:	BARE STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	16U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	47	Tank Piping:	BARE STEEL
Tank Size (Units):	15000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	17U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	35	Tank Piping:	BARE STEEL
Tank Size (Units):	10000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	19U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	35	Tank Piping:	BARE STEEL
Tank Size (Units):	12000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	20U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	35	Tank Piping:	BARE STEEL
Tank Size (Units):	13400 (GALLONS)	Tank Material:	BARE STEEL



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #19

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

Tank ID:	23U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	29	Tank Piping:	UNKNOWN
Tank Size (Units):	550 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	24U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	47	Tank Piping:	BARE STEEL
Tank Size (Units):	200 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	25U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	17	Tank Piping:	BARE STEEL
Tank Size (Units):	550 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	26U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	15	Tank Piping:	BARE STEEL
Tank Size (Units):	10000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	27U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	15	Tank Piping:	BARE STEEL
Tank Size (Units):	5000 (GALLONS)	Tank Material:	CATHODICALLY PROTECTED STEEL
Tank ID:	29U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	13	Tank Piping:	BARE STEEL
Tank Size (Units):	15000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	30U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	13	Tank Piping:	BARE STEEL
Tank Size (Units):	15000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	31U	Tank Status:	REMOVED
Tank Contents:	HAZARDOUS	Leak Monitoring:	
Tank Age:	27	Tank Piping:	BARE STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	COMPOSITE
Tank ID:	32U	Tank Status:	REMOVED
Tank Contents:	SOLVENTS	Leak Monitoring:	
Tank Age:	13	Tank Piping:	BARE STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	33U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	NOT AVAILABLE
Tank Age:	8	Tank Piping:	BARE STEEL
Tank Size (Units):	10000 (GALLONS)	Tank Material:	EPOXY STEEL
Tank ID:	34U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	NOT AVAILABLE
Tank Age:	8	Tank Piping:	BARE STEEL
Tank Size (Units):	10000 (GALLONS)	Tank Material:	EPOXY STEEL



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #20

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

RCRA-TSD CORRACTS / SRC# 556		EPA ID:	MID005356704
Agency Address:	SAME AS ABOVE		
Off-Site Waste Received:	NO		
Land Disposal:	NO		
Incinerator:	NO		
Storage/Treatment:	NO		

VISTA Address*:	SHELDON CORNERS QUALITY CARS 4462 S MICHIGAN CANTON, MI 48188	VISTA ID#:	3510562
		Distance/Direction:	0.08 MI / NW
		Plotted as:	Point

Map ID

2A

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	SHELDON CORNERS QUALITY CARS 4462 S MICHIGAN CANTON, MI 0-036240		
Leak ID#:	0-036240		
Remediation Status:	CLOSED		
Description / Comment:	FACILITY COUNTY: WAYNE		


STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-036240
Agency Address:	SAME AS ABOVE		
Underground Tanks:	3		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	3		
Tank ID:	1U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	NOT REPORTED (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	2U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	3000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	3U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	3000 (GALLONS)	Tank Material:	BARE STEEL

VISTA Address*:	SHRADER RALPH DIV DRI-SLIDE 3450 LOVETT DETROIT, MI 48210	VISTA ID#:	380544
		Distance/Direction:	0.10 MI / N
		Plotted as:	Point

Map ID

2B

RCRA-SmGen - RCRA-Small Generator / SRC# 15		EPA ID:	MID005349741
Agency Address:	SAME AS ABOVE		
Generator Class:	Generates 100 kg./month but less than 1000 kg./month of non-acutely hazardous waste		

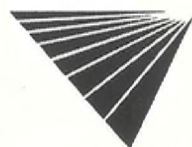

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #21

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

VISTA Address*:	WOLVERINE PORCELAIN ENAMELING CO 3350 SCOTTEN AVE DETROIT, MI 48210	VISTA ID#:	474003
		Distance/Direction:	0.10 MI / NE
		Plotted as:	Point
STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-039184
Agency Address:		WOLVERINE PORCELAIN ENAMELING CO 3350 E SCOTTEN AVE DETROIT, MI	
Underground Tanks:		1	
Aboveground Tanks:		NOT REPORTED	
Tanks Removed:		NOT REPORTED	
Tank ID:	1U	Tank Status:	TEMP OUT OF SERVICE
Tank Contents:	DIESEL	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	UNKNOWN
Tank Size (Units):	NOT REPORTED (GALLONS)	Tank Material:	UNKNOWN

Map ID

3A

VISTA Address*:	R M SHEARING PROCESSING 4086 MICHIGAN AVE DETROIT, MI 48210	VISTA ID#:	3730282
		Distance/Direction:	0.12 MI / NE
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		R M SHEARING PROCESSING 4086 MICHIGAN AVE DETROIT, MI	
Leak ID#:		0-036395	
Remediation Status:		CLOSED	
Description / Comment:		FACILITY COUNTY: WAYNE	
STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-036395
Agency Address:		SAME AS ABOVE	
Underground Tanks:		1	
Aboveground Tanks:		NOT REPORTED	
Tanks Removed:		1	
Tank ID:	1U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	BARE STEEL

Map ID

3B

VISTA Address*:	SECODYNE INC. 3255 GOLDNER AVE. DETROIT, MI 48210	VISTA ID#:	373365
		Distance/Direction:	0.14 MI / W
		Plotted as:	Point
TRIS - Toxic Release Inventory System / SRC# 2		EPA ID:	NA
Agency Address:		SECODYNE INC. 3255 GOLDNER AVE. DETROIT, MI 482100717	
Chemical Abstract Service Registry:		Quantity Released:	
ACRYLAMIDE		10.00 (POUNDS)	
Agency Code (124403)		NOT REPORTED (POUNDS)	
FORMALDEHYDE		NOT REPORTED (POUNDS)	

Map ID

4



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #22

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

VISTA Address*:	WESTER MFG CO 3428 SCOTTEN DETROIT, MI 48210	VISTA ID#:	464310
		Distance/Direction:	0.15 MI / N
		Plotted as:	Point
RCRA-SmGen - RCRA-Small Generator / SRC# 15		EPA ID:	MID982636219
Agency Address:		SAME AS ABOVE	
Generator Class:		Generates 100 kg./month but less than 1000 kg./month of non-acutely hazardous waste	

Map ID


5

VISTA Address*:	F H MINI MART INC 4615 MICHIGAN AVE DETROIT, MI 48210	VISTA ID#:	2541567
		Distance/Direction:	0.16 MI / W
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		F H MINI MART INC 4615 MICHIGAN AVE DETROIT, MI 0-011868	
Leak ID#:		0-011868	
Remediation Status:		OPEN	
Description / Comment:		FACILITY COUNTY: WAYNE	

Map ID

6A

STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-011868
Agency Address:		SAME AS ABOVE	
Underground Tanks:		4	
Aboveground Tanks:		NOT REPORTED	
Tanks Removed:		NOT REPORTED	
Tank ID:	1U	Tank Status:	CLOSED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	38	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	4000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	2U	Tank Status:	CURRENT
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	28	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	20000 (GALLONS)	Tank Material:	COMPOSITE
Tank ID:	3U	Tank Status:	CURRENT
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	28	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	20000 (GALLONS)	Tank Material:	COMPOSITE
Tank ID:	4U	Tank Status:	CLOSED
Tank Contents:	KEROSENE	Leak Monitoring:	
Tank Age:	38	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	4000 (GALLONS)	Tank Material:	BARE STEEL

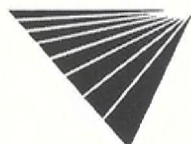

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #23

PROPERTY AND THE ADJACENT AREA (within 1/4 mile) CONT.

VISTA Address*:	PROFESSIONAL GARMENT SERVICE 4701 MICHIGAN AVE DETROIT, MI 48210	VISTA ID#:	11506112
		Distance/Direction:	0.22 MI / W
		Plotted as:	Point

Map ID

6B


STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-015609
Agency Address:	SAME AS ABOVE		
Underground Tanks:	4		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	2		
Tank ID:	1U	Tank Status:	REMOVED
Tank Contents:	SOLVENTS	Leak Monitoring:	NOT AVAILABLE
Tank Age:	10	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	2U	Tank Status:	REMOVED
Tank Contents:	SOLVENTS	Leak Monitoring:	NOT AVAILABLE
Tank Age:	11	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	1000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	3U	Tank Status:	TEMP OUT OF SERVICE
Tank Contents:	SOLVENTS	Leak Monitoring:	
Tank Age:	40	Tank Piping:	UNKNOWN
Tank Size (Units):	1000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	4U	Tank Status:	TEMP OUT OF SERVICE
Tank Contents:	SOLVENTS	Leak Monitoring:	
Tank Age:	40	Tank Piping:	UNKNOWN
Tank Size (Units):	1000 (GALLONS)	Tank Material:	BARE STEEL

VISTA Address*:	UNITED MEAT DELI 3273 HUBBARD DETROIT, MI 48210	VISTA ID#:	1740683
		Distance/Direction:	0.19 MI / NE
		Plotted as:	Point

Map ID

7

STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-003659
Agency Address:	SAME AS ABOVE		
Underground Tanks:	2		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	2		
Tank ID:	1U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	28	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	6000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	2U	Tank Status:	REMOVED
Tank Contents:	DIESEL	Leak Monitoring:	
Tank Age:	21	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	8000 (GALLONS)	Tank Material:	BARE STEEL

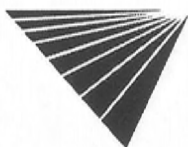

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #24

SITES IN THE SURROUNDING AREA (within 1/4 - 1/2 mile) CONT.

VISTA Address*:	ARPCO 3540 VINEWOOD DETROIT, MI 48208	VISTA ID#:	7294620
		Distance/Direction:	0.30 MI / NE
		Plotted as:	Point

Map ID

9

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	ARPCO 3540 VINEWOOD DETROIT, MI 0-006261		
Leak ID#:	CLOSED		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	DETROIT FIRE ENG 10 CITY OF 3396 VINEWOOD DETROIT, MI 48208	VISTA ID#:	5164225
		Distance/Direction:	0.26 MI / NE
		Plotted as:	Point

Map ID

10

RCRA-LgGen - RCRA-Large Generator / SRC# 16		EPA ID:	MI0000261065
Agency Address:	SAME AS ABOVE		
Generator Class:	Generates at least 1000 kg./month of non-acutely hazardous waste (or 1 kg./month of acutely hazardous waste).		

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	FIRE DEPT ENGINE #10 3396 VINEWOOD DETROIT, MI 0-019095		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			


STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-019095
Agency Address:	FIRE DEPT ENGINE #10 3396 VINEWOOD DETROIT, MI 48208		
Underground Tanks:	1		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	1		
Tank ID:	1U	Tank Status:	REMOVED
Tank Contents:	DIESEL	Leak Monitoring:	
Tank Age:	16	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	2000 (GALLONS)	Tank Material:	BARE STEEL

VISTA Address*:	DETROIT EDISON CO SCOTTEN STATION 4141 MAGNOLIA DETROIT, MI 48210	VISTA ID#:	120207
		Distance/Direction:	0.29 MI / N
		Plotted as:	Point

Map ID

11

RCRA-SmGen - RCRA-Small Generator / SRC# 15		EPA ID:	MID000721555
Agency Address:	SAME AS ABOVE		
Generator Class:	Generates less than 100 kg./month of non-acutely hazardous waste.		

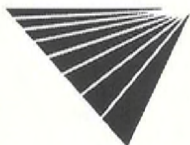

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #27

SITES IN THE SURROUNDING AREA (within 1/4 - 1/2 mile) CONT.

VISTA Address*:	G AND G COLLISION 3058 JUNCTION DETROIT, MI 48210	VISTA ID#:	1727624
		Distance/Direction:	0.30 MI / SW
		Plotted as:	Point
RCRA-SmGen - RCRA-Small Generator / SRC# 15		EPA ID:	MID985582642
Agency Address:		SAME AS ABOVE	
Generator Class:		Generates 100 kg./month but less than 1000 kg./month of non-acutely hazardous waste	

Map ID

12

VISTA Address*:	AMOCO OIL STATION #7074 3458 JUNCTION DETROIT, MI 48210	VISTA ID#:	1727681
		Distance/Direction:	0.33 MI / W
		Plotted as:	Point

Map ID

13

STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-021320
Agency Address:		AMOCO OIL STATION #7074 3458 JUNCTION DETROIT, MI 48209	
Underground Tanks:		3	
Aboveground Tanks:		NOT REPORTED	
Tanks Removed:		NOT REPORTED	
Tank ID:	1U	Tank Status:	CLOSED
Tank Contents:	OTHER	Leak Monitoring:	
Tank Age:	19	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	6000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	2U	Tank Status:	CLOSED
Tank Contents:	OTHER	Leak Monitoring:	
Tank Age:	19	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	6000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	3U	Tank Status:	CLOSED
Tank Contents:	OTHER	Leak Monitoring:	
Tank Age:	19	Tank Piping:	GALVANIZED STEEL
Tank Size (Units):	8000 (GALLONS)	Tank Material:	BARE STEEL

VISTA Address*:	SAMS MOTORS 829 W GRAND BLVD DETROIT, MI 48216	VISTA ID#:	7103525
		Distance/Direction:	0.33 MI / E
		Plotted as:	Point

Map ID

14

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		SAMS MOTORS 829 W GRAND BLVD DETROIT, MI 0-034454	
Leak ID#:		0-034454	
Remediation Status:		OPEN	
Description / Comment:		FACILITY COUNTY: WAYNE	



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #28

SITES IN THE SURROUNDING AREA (within 1/4 - 1/2 mile) CONT.

VISTA Address*:	SAMS MOTORS 829 W GRAND BLVD DETROIT, MI 48216	VISTA ID#:	1773003
		Distance/Direction:	0.33 MI / E
		Plotted as:	Point
STATE UST - State Underground Storage Tank / SRC# 322		Agency ID:	0-034454
Agency Address:	SAME AS ABOVE		
Underground Tanks:	7		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	6		
Tank ID:	1U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	UNKNOWN
Tank Size (Units):	4000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	2U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	UNKNOWN
Tank Size (Units):	4000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	3U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	UNKNOWN
Tank Size (Units):	4000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	4U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	24	Tank Piping:	UNKNOWN
Tank Size (Units):	8000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	5U	Tank Status:	REMOVED
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	24	Tank Piping:	UNKNOWN
Tank Size (Units):	6000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	6U	Tank Status:	REMOVED
Tank Contents:	DIESEL	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	UNKNOWN
Tank Size (Units):	6000 (GALLONS)	Tank Material:	BARE STEEL
Tank ID:	7U	Tank Status:	TEMP OUT OF SERVICE
Tank Contents:	USED OIL	Leak Monitoring:	
Tank Age:	NOT REPORTED	Tank Piping:	UNKNOWN
Tank Size (Units):	300 (GALLONS)	Tank Material:	UNKNOWN

Map ID

14



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #29

SITES IN THE SURROUNDING AREA (within 1/4 - 1/2 mile) CONT.

VISTA Address*:	MI CONSOLIDATED GAS CO 5672 ST HEDWIG DETROIT, MI 48210	VISTA ID#:	8367398
		Distance/Direction:	0.36 MI / W
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		EPA/Agency ID:	N/A
Agency Address:	MI CONSOLIDATED GAS CO 5672 ST HEDWIG DETROIT, MI JANUARY 15, 1987 NOT REPORTED		
Spill Date Time:	5672 ST HEDWIG		
Spill Location:	MI CONSOLIDATED GAS CO		
Discharger Org:	NATURAL GAS, 0.00 0		
Material Spilled:	Case Number, Source Agency, Discharger Name, Discharger Phone, Waterway Affected		
Fields Not Reported:			
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO

Map ID

15

VISTA Address*:	SHRADER ANALYTICAL AND CONSULTG LABS INC 3814 VINEWOOD DETROIT, MI 48208	VISTA ID#:	380541
		Distance/Direction:	0.38 MI / N
		Plotted as:	Point
RCRA-SmGen - RCRA-Small Generator / SRC# 15		EPA ID:	MID078393014
Agency Address:	SHRADER ANALYTICAL AND CONSULTG LABS IN 3814 VINEWOOD DETROIT, MI 48208		
Generator Class:	Generates 100 kg./month but less than 1000 kg./month of non-acutely hazardous waste		

Map ID

16

VISTA Address*:	NEWBERRY ELEM SCHOOL 4045 29TH ST DETROIT, MI 48210	VISTA ID#:	1727508
		Distance/Direction:	0.41 MI / NW
		Plotted as:	Point
RCRA-SmGen - RCRA-Small Generator / SRC# 15		EPA ID:	MID985601624
Agency Address:	SAME AS ABOVE		
Generator Class:	Generates 100 kg./month but less than 1000 kg./month of non-acutely hazardous waste		

Map ID

17

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile)

VISTA Address*:	DEWITT PRODUCTS COMPANY 5860 PLUMER AVE DETROIT, MI 48209	VISTA ID#:	120736
		Distance/Direction:	0.56 MI / SW
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	DEWITT PRODUCTS CO 5860 PLUMER DETROIT, MI 0-002145		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

Map ID

18



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #30

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

VISTA Address*:	CHURCHILL TRANSPORTATION INC 2455 24TH ST DETROIT, MI 48216	VISTA ID#:	530082
		Distance/Direction:	0.60 MI / E
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	317516
Agency Address:	CHURCHILL TRANSPORTATION 2455 24TH ST DETROIT, MI DECEMBER 5, 1995 UNKNOWN 317516		
Spill Date Time:			
Case Number:	317516		
Spill Location:	2455 24TH ST		
Discharger Org:	CHURCHILL TRANSPORTATION		
Material Spilled:	OIL, MISC: MOTOR, 0.00 (UNK)		
Waterway Affected:	GRAVEL		
Fields Not Reported:	Source Agency, Discharger Name, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release:
NO	NO	NO	NO
		Other Release:	NO

Map ID

19

VISTA Address*:	JERRY CHURCHILL INC 2455 24TH STREET DETROIT, MI 48216	VISTA ID#:	5163515
		Distance/Direction:	0.60 MI / E
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	JERRY CHURCHILL INC 2455 24TH STREET DETROIT, MI 0-006153		
Leak ID#:			
Remediation Status:	CLOSED		
Description / Comment:	FACILITY COUNTY: WAYNE		

Map ID

19

VISTA Address*:	MAGNI IND. INC. 2771 HAMMOND DETROIT, MI 48209	VISTA ID#:	498311
		Distance/Direction:	0.60 MI / SW
		Plotted as:	Point
TRIS - Toxic Release Inventory System / SRC# 2		EPA ID:	MID980821391
Agency Address:	SAME AS ABOVE		
Chemical Abstract Service Registry:	Quantity Released:		
ZINC (FUME OR DUST)	29580.00 (POUNDS)		
ALUMINUM (FUME OR DUST)	4500.00 (POUNDS)		
NICKEL	2185.00 (POUNDS)		
N-BUTYL ALCOHOL	5428.00 (POUNDS)		
METHYL ETHYL KETONE	4800.00 (POUNDS)		
XYLENE (MIXED ISOMERS)	5176.00 (POUNDS)		

Map ID

20

VISTA Address*:	LAFAYETTE STEEL PROCESSING 3600 N MILITARY DETROIT, MI 48210	VISTA ID#:	1773852
		Distance/Direction:	0.66 MI / W
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	LAFAYETTE STEEL PROCESSING CO. 3600 N. MILITARY DETROIT, MI 0-033943		
Leak ID#:			
Remediation Status:	OPEN		

Map ID

21



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #31

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

Description / Comment: *FACILITY COUNTY: WAYNE*

VISTA Address*:	BP OIL 4400 VERNOR HWY DETROIT, MI 48209	VISTA ID#:	1761296
		Distance/Direction:	0.66 MI / SE
		Plotted as:	Point

Map ID

22

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		<i>BP OIL 4400 VERNOR HWY DETROIT, MI 5-000823</i>	
Leak ID#:		<i>OPEN</i>	
Remediation Status:		<i>OPEN</i>	
Description / Comment:		<i>FACILITY COUNTY: WAYNE</i>	

VISTA Address*:	SHELL OIL CO 4415 W VERNOR DETROIT, MI 48209	VISTA ID#:	2543249
		Distance/Direction:	0.67 MI / SE
		Plotted as:	Point

Map ID

22

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		<i>SHELL SERVICE STATION 4415 W VERNOR/CLARK DETROIT, MI 0-010554</i>	
Leak ID#:		<i>OPEN</i>	
Remediation Status:		<i>OPEN</i>	
Description / Comment:		<i>FACILITY COUNTY: WAYNE</i>	

VISTA Address*:	4605 BANGOR DETROIT, MI 48210	VISTA ID#:	8367818
		Distance/Direction:	0.68 MI / N
		Plotted as:	Point

Map ID

23

ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	117573
Agency Address:		<i>4605 BANGOR DETROIT, MI</i>	
Spill Date Time:		<i>MAY 12, 1992 04:30:00 PM</i>	
Case Number:		<i>117573</i>	
Spill Location:		<i>4605 BANGOR</i>	
Source Agency:		<i>N</i>	
Discharger Name:		<i>UNKNOWN</i>	
Material Spilled:		<i>NATURAL GAS, 0.00 (NON)</i>	
Fields Not Reported:		<i>Discharger Org. Discharger Phone. Waterway Affected</i>	
Air Release:	Land Release:	Water Release:	Ground Release:
Facility Release:	Other Release:		
<i>YES</i>	<i>NO</i>	<i>NO</i>	<i>NO</i>

VISTA Address*:	TRIANGLE BOOKBINDING 4238-24TH STREET DETROIT, MI 48208	VISTA ID#:	3864608
		Distance/Direction:	0.68 MI / NE
		Plotted as:	Point

Map ID

24

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		<i>TRIANGLE BOOKBINDING 4238-24TH STREET DETROIT, MI 0-037199</i>	
Leak ID#:		<i>OPEN</i>	
Remediation Status:		<i>OPEN</i>	



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #32

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

Description / Comment: FACILITY COUNTY: WAYNE

VISTA Address*:	23RD POPLAR 23RD POPLAR DETROIT, MI 48208	VISTA ID#:	7663203
		Distance/Direction:	0.71 MI / NE
		Plotted as:	Point
CERCLIS / SRC# 17		EPA ID:	MI0002322477

Map ID

24

Agency Address: 23RD POPLAR
23RD POPLAR
DETROIT, MI 482082428

EPA Region: 5

Congressional District: 0

Federal Facility: Agency Code ()

Facility Ownership: NOT AVAILABLE

Site Incident Category: unknown

Federal Facility Docket: Agency Code ()

NPL Status: NOT ON NPL

Incident Type: Unknown

Proposed NPL Update #: 0

Final NPL Update #: 0

Financial Management System ID: B541

Latitude: 0

Longitude: 0

Lat/Long Source: Agency Code ()

Lat/Long Accuracy: Unknown

Dioxin Tier: Unknown

USGS Hydro Unit: 0

RCRA Indicator: Unknown

Unit Id: 0

Unit Name: SITEWIDE

Type:	REMOVAL ACTION	Lead Agency:	EPA FUND-FINANCED
Qualifier:	CLEAN UP	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	MAY 7, 1998
Plan Status:	PRIMARY	Actual Completion Date:	JUNE 10, 1998

Financial Type:	Date:	Financial Amount (\$):
ACTUAL OBLIGATION	JUNE 4, 1998	100000
COMMITMENT	MAY 5, 1998	50000
DEOBLIGATION	AUGUST 5, 1998	100000
DECOMMITMENT	JUNE 4, 1998	100000
Agency Code (O)	AUGUST 5, 1998	50000
ACTUAL OBLIGATION	MAY 12, 1998	50000
COMMITMENT	JUNE 2, 1998	100000
DEOBLIGATION	AUGUST 5, 1998	50000
DECOMMITMENT	MAY 8, 1998	50000
Agency Code (O)	AUGUST 5, 1998	300000
ACTUAL OBLIGATION	MAY 14, 1998	300000
COMMITMENT	MAY 8, 1998	50000
DEOBLIGATION	AUGUST 5, 1998	300000
DECOMMITMENT	MAY 12, 1998	50000
Agency Code (O)	AUGUST 5, 1998	100000
ACTUAL OBLIGATION	JUNE 9, 1998	150000



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #33

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

Financial Type:	Date:	Financial Amount (\$):
COMMITMENT	MAY 11, 1998	300000
DEOBLIGATION	AUGUST 5, 1998	13269
DECOMMITMENT	MAY 14, 1998	300000
Agency Code (O)	AUGUST 5, 1998	13269
COMMITMENT	JUNE 5, 1998	150000
DEOBLIGATION	NOVEMBER 12, 1998	55191
DECOMMITMENT	JUNE 9, 1998	150000
Agency Code (O)	NOVEMBER 12, 1998	55191
DEOBLIGATION	SEPTEMBER 30, 1998	69360

VISTA Address*:	PARCELS AT POPLAR 23RD DETROIT, MI 48208	VISTA ID#:	11654507
		Distance/Direction:	0.71 MI / NE
		Plotted as:	Point
		Agency ID:	821582

Map ID

24

SCL - State Equivalent CERCLIS List / SRC# 323

Agency Address:	SAME AS ABOVE
Status:	UNKNOWN
Facility Type:	NOT AVAILABLE
Lead Agency:	NOT AVAILABLE
State Status:	INTERIM RESPONSE IN PROGRESS
Pollutant 1:	LEAD CHROMIUM
Pollutant 2:	OTHER
Pollutant 3:	OTHER

VISTA Address*:	THORN APPLE VALLEY 3925 TILLMAN DETROIT, MI 48208	VISTA ID#:	2542997
		Distance/Direction:	0.71 MI / NE
		Plotted as:	Point
		Agency ID:	300135

Map ID

25

ERNS - Emergency Response Notification System / SRC# 8

Agency Address:	SAME AS ABOVE
Spill Date Time:	JULY 15, 1995 12:30:00 PM
Case Number:	300135
Spill Location:	3925 TILLMAN
Discharger Org:	THORN APPLE VALLEY
Material Spilled:	AMMONIA, ANHYDROUS, 0.00 (UNK)
Waterway Affected:	ATMOSPHERE
Fields Not Reported:	Source Agency, Discharger Name, Discharger Phone

Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:
YES	NO	NO	NO	NO	NO

STATE LUST - State Leaking Underground Storage Tank / SRC# 319

Agency Address:	THORN APPLE VALLEY INC. 3925 TILLMAN AVE DETROIT, MI 0-035247
Leak ID#:	
Remediation Status:	CLOSED
Description / Comment:	FACILITY COUNTY: WAYNE



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #34

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

VISTA Address*:	FARMER JACK SUPERMARKET #3 3830 W. VERNOR DETROIT, MI 48216	VISTA ID#:	1761295	Map ID 26	
		Distance/Direction:	0.74 MI / SE		
		Plotted as:	Point		
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A		
Agency Address:	FARMER JACK SUPERMARKET #3 3830 W. VERNOR DETROIT, MI 0-020673				
Leak ID#:	CLOSED				
Remediation Status:	FACILITY COUNTY: WAYNE				
Description / Comment:					
VISTA Address*:	MAHNOND ALLEY 3801 W. VERNOR DETROIT, MI 48216	VISTA ID#:	3731403	Map ID 26	
		Distance/Direction:	0.75 MI / SE		
		Plotted as:	Point		
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A		
Agency Address:	MAHNOND ALLEY 3801 W. VERNOR DETROIT, MI 0-036314				
Leak ID#:	CLOSED				
Remediation Status:	FACILITY COUNTY: WAYNE				
Description / Comment:					
VISTA Address*:	PTL LIVERNOIS YARD 2725 LIVERNOIS ST DETROIT, MI 48209	VISTA ID#:	1745278	Map ID 27	
		Distance/Direction:	0.75 MI / SW		
		Plotted as:	Point		
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A		
Agency Address:	PTL LIVERNOIS YARD 2725 LIVERNOIS ST DETROIT, MI 0-011938				
Leak ID#:	OPEN				
Remediation Status:	FACILITY COUNTY: WAYNE				
Description / Comment:					
VISTA Address*:	CONDEA VISTA CO. 2725 LIVERNOIS AVE DETROIT, MI 48209	VISTA ID#:	8369521	Map ID 27	
		Distance/Direction:	0.75 MI / SW		
		Plotted as:	Point		
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	350854		
Agency Address:	CONDEA VISTA CO. 2725 LIVERNOIS AVE DETROIT, MI JULY 8, 1996 UNKNOWN				
Spill Date Time:	350854				
Case Number:	2725 LIVERNOIS AVE				
Spill Location:	CONDEA VISTA CO.				
Discharger Org:	HAZARDOUS WASTE SOLID NOS / D007, 1.00 (QRT)				
Material Spilled:	BALLAST AND SOIL				
Waterway Affected:	Source Agency, Discharger Name, Discharger Phone				
Fields Not Reported:					
Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:
NO	NO	NO	NO	NO	NO



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #35

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

VISTA Address*:	3838 BAGLEY ST DETROIT, MI 48216	VISTA ID#:	8367722
		Distance/Direction:	0.80 MI / SE
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	273153
Agency Address:		3838 BAGLEY ST DETROIT, MI 48313	
Spill Date Time:		DECEMBER 10, 1994 05:30:00 PM	
Case Number:		273153	
Spill Location:		3838 BAGLEY ST	
Source Agency:		N	
Discharger Name:		UNKNOWN.	
Material Spilled:		UNKNOWN OIL 0.00 (UNK)	
Waterway Affected:		ATMOSPHERE	
Fields Not Reported:		Discharger Org, Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO

Map ID

28

VISTA Address*:	2394 LIVERNOIS DETROIT, MI 48209	VISTA ID#:	8369519
		Distance/Direction:	0.81 MI / SW
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	256998
Agency Address:		2394 LIVERNOIS DETROIT, MI	
Spill Date Time:		AUGUST 23, 1994 10:19:00 PM	
Case Number:		256998	
Spill Location:		2394 LIVERNOIS	
Source Agency:		N	
Discharger Name:		UNKNOWN.	
Material Spilled:		UNKNOWN MATERIAL 0.00 (UNK)	
Waterway Affected:		ATMOSPHERE	
Fields Not Reported:		Discharger Org, Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO

Map ID

29



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #36

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

VISTA Address*:	DEWITS 2394 LIVERNOIS DETROIT, MI 48209	VISTA ID#:	8369520
		Distance/Direction:	0.81 MI / SW
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	243232
Agency Address:		DEWITS 2394 LIVERNOIS DETROIT, MI JUNE 9, 1994 10:15:00 PM 243232 2394 LIVERNOIS N UNKNOWN, DEWITS UNKNOWN MATERIAL, 0.00 (UNK) ATMOSPHERE Discharger Phone	
Spill Date Time:			
Case Number:			
Spill Location:			
Source Agency:			
Discharger Name:			
Discharger Org:			
Material Spilled:			
Waterway Affected:			
Fields Not Reported:			
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO

Map ID

29

VISTA Address*:	UNION 76 6207 TOLEDO ST DETROIT, MI 48209	VISTA ID#:	8370942
		Distance/Direction:	0.81 MI / SW
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		EPA/Agency ID:	N/A
Agency Address:		UNION 76 6207 TOLEDO ST DETROIT, MI SEPTEMBER 15, 1989 NOT REPORTED 6207 TOLEDO ST UNION 76 GASOLINE, 0.00 (UNK) SUBSOIL, BASEMENT AT CALLER'S HOUSE Case Number, Source Agency, Discharger Name, Discharger Phone	
Spill Date Time:			
Spill Location:			
Discharger Org:			
Material Spilled:			
Waterway Affected:			
Fields Not Reported:			
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO

Map ID

30

ERNS - Emergency Response Notification System / SRC# 8		EPA/Agency ID:	N/A
Agency Address:		UNION 76 6207 TOLEDO ST DETROIT, MI SEPTEMBER 15, 1989 NOT REPORTED 6207 TOLEDO ST UNION 76 GASOLINE, 0.00 (UNK) SUBSOIL, BASEMENT AT CALLER'S HOUSE Case Number, Source Agency, Discharger Name, Discharger Phone	
Spill Date Time:			
Spill Location:			
Discharger Org:			
Material Spilled:			
Waterway Affected:			
Fields Not Reported:			
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #37

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

VISTA Address*:	76 GAS STATION 6207 TOLEDO DETROIT, MI 48209	VISTA ID#:	2136235
		Distance/Direction:	0.83 MI / SW
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	39874
Agency Address:	76 GAS STATION 6207 TOLEDO DETROIT, MI		
Spill Date Time:	SEPTEMBER 17, 1990 06:00:00 PM		
Case Number:	39874		
Spill Location:	6207 TOLEDO		
Source Agency:	N		
Discharger Name:	UNKNOWN		
Discharger Org:	76 GAS STATION		
Material Spilled:	GASOLINE: AUTOMOTIVE (4.23G PB/G, 0.00 (UNK)		
Waterway Affected:	SOIL		
Fields Not Reported:	Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO

Map ID

30

VISTA Address*:	SHELL SERVICE STATION 6248 MICHIGAN/LIVernoIS DETROIT, MI 48210	VISTA ID#:	2541601
		Distance/Direction:	0.83 MI / W
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	SHELL SERVICE STATION 6248 MICHIGAN/LIVernoIS DETROIT, MI		
Leak ID#:	0-010544		
Remediation Status:	OPEN		
Description / Comment:	FACILITY COUNTY: WAYNE		

Map ID

31

VISTA Address*:	DISCOUNT MUFFLER BRAKE CENTER 4292 LIVernoIS DETROIT, MI 48210	VISTA ID#:	3864637
		Distance/Direction:	0.89 MI / W
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	DISCOUNT MUFFLER BRAKE CENTER 4292 LIVernoIS DETROIT, MI		
Leak ID#:	0-036934		
Remediation Status:	OPEN		
Description / Comment:	FACILITY COUNTY: WAYNE		

Map ID

31

VISTA Address*:	MICHIGAN HEALTH CENTER 2700 MARTIN LUTHER KING BLVD DETROIT, MI 48208	VISTA ID#:	521719
		Distance/Direction:	0.87 MI / NE
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	MICHIGAN HEALTH CENTER 2700 MARTIN LUTHER KING BLVD DETROIT, MI		
Leak ID#:	0-014423		

Map ID

32



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #38

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

Remediation Status: OPEN
Description / Comment: FACILITY COUNTY: WAYNE

VISTA Address*:	UNITED COMMUNITY HOSPITAL 2401 20TH STREET DETROIT, MI 48216	VISTA ID#:	6909275
		Distance/Direction:	0.90 MI / E
		Plotted as:	Point

Map ID

33

STATE LUST - State Leaking Underground Storage Tank / SRC# 319 EPA/Agency ID: N/A

Agency Address: UNITED COMMUNITY HOSPITAL
2401 20TH STREET
DETROIT, MI
0-012529

Leak ID#:

Remediation Status: OPEN

Description / Comment: FACILITY COUNTY: WAYNE

VISTA Address*:	DETROIT CITY 2633 MICHIGAN DETROIT, MI 48216	VISTA ID#:	4056204
		Distance/Direction:	0.95 MI / E
		Plotted as:	Point

Map ID

33

STATE LUST - State Leaking Underground Storage Tank / SRC# 319 EPA/Agency ID: N/A

Agency Address: DPW STREET MAINTENANCE
2633 MICHIGAN
DETROIT, MI
0-019074

Leak ID#:

Remediation Status: CLOSED

Description / Comment: FACILITY COUNTY: WAYNE

VISTA Address*:	NATIONAL ELECTRIC 4269 LAWTON ST DETROIT, MI 48208	VISTA ID#:	8369533
		Distance/Direction:	0.94 MI / NE
		Plotted as:	Point

Map ID

34

ERNS - Emergency Response Notification System / SRC# 8 EPA/Agency ID: N/A

Agency Address: NATIONAL ELECTRIC
4269 LAWTON ST
DETROIT, MI

Spill Date Time: SEPTEMBER 3, 1987 03:00:00 PM

Spill Location: 4269 LAWTON ST

Discharger Org: NATIONAL ELECTRIC

Material Spilled: PCB, 3.00 (GAL)

Waterway Affected: THE TRUCK CONTAINMENT SYSTEM

Fields Not Reported: Case Number, Source Agency, Discharger Name, Discharger Phone

Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:
NO	NO	NO	NO	NO	NO

VISTA Address*:	ARROW-WELDT SALES ENG. CO. 2750 POPLAR DETROIT, MI 48208	VISTA ID#:	1752398
		Distance/Direction:	0.98 MI / NE
		Plotted as:	Point

Map ID

34

STATE LUST - State Leaking Underground Storage Tank / SRC# 319 EPA/Agency ID: N/A

Agency Address: ARROW-WELDT SALES ENG. CO.
2750 POPLAR
DETROIT, MI
0-002598

Leak ID#:



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #39

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

Remediation Status:	CLOSED
Description / Comment:	FACILITY COUNTY: WAYNE

VISTA Address*:	SHELL SERVICE STATION 6171 W VERNOR/DRAGOON DETROIT, MI 48209	VISTA ID#:	2543252
		Distance/Direction:	0.94 MI / S
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	SHELL SERVICE STATION 6171 W VERNOR/DRAGOON DETROIT, MI 0-010559		
Leak ID#:	0-010559		
Remediation Status:	CLOSED		
Description / Comment:	FACILITY COUNTY: WAYNE		

Map ID

35

VISTA Address*:	FIRE DEPT ENGINE #27 1465 JUNCTION AVE DETROIT, MI 48209	VISTA ID#:	7103331
		Distance/Direction:	0.96 MI / S
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	FIRE DEPT ENGINE #27 1465 JUNCTION AVE DETROIT, MI 0-019103		
Leak ID#:	0-019103		
Remediation Status:	CLOSED		
Description / Comment:	FACILITY COUNTY: WAYNE		

Map ID

36

VISTA Address*:	DETROIT DPW 3040 W. VERNOR DETROIT, MI 48216	VISTA ID#:	1775311
		Distance/Direction:	0.97 MI / E
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	DETROIT DPW 3040 W. VERNOR DETROIT, MI 5-000237		
Leak ID#:	5-000237		
Remediation Status:	OPEN		
Description / Comment:	FACILITY COUNTY: WAYNE		

Map ID

37

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile)

VISTA Address*:	LAWTON PROPERTY 4445 LAWTON DETROIT, MI 48208	VISTA ID#:	6641962
		Distance/Direction:	1.00 MI / NE
		Plotted as:	Point
NFRAP / SRC# 18		EPA ID:	MID065573495
Agency Address:	LAWTON PROPERTY 4445 LAWTON DETROIT, MI 48184		
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	NOT REPORTED	UNKNOWN
Alias Name:	HOSKINS MANUFACTURING CO.		

Map ID

38



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #40

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

Remediation Status: *OPEN*
 Description / Comment: *FACILITY COUNTY: WAYNE*

VISTA Address*:	UNITED COMMUNITY HOSPITAL 2401 20TH STREET DETROIT, MI 48216	VISTA ID#:	6909275
		Distance/Direction:	0.90 MI / E
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	<i>UNITED COMMUNITY HOSPITAL 2401 20TH STREET DETROIT, MI 0-012529</i>		
Leak ID#:			
Remediation Status:	<i>OPEN</i>		
Description / Comment:	<i>FACILITY COUNTY: WAYNE</i>		

Map ID

33

VISTA Address*:	DETROIT CITY 2633 MICHIGAN DETROIT, MI 48216	VISTA ID#:	4056204
		Distance/Direction:	0.95 MI / E
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	<i>DPW STREET MAINTENANCE 2633 MICHIGAN DETROIT, MI 0-019074</i>		
Leak ID#:			
Remediation Status:	<i>CLOSED</i>		
Description / Comment:	<i>FACILITY COUNTY: WAYNE</i>		

Map ID

33

VISTA Address*:	NATIONAL ELECTRIC 4269 LAWTON ST DETROIT, MI 48208	VISTA ID#:	8369533
		Distance/Direction:	0.94 MI / NE
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		EPA/Agency ID:	N/A
Agency Address:	<i>NATIONAL ELECTRIC 4269 LAWTON ST DETROIT, MI SEPTEMBER 3, 1987 03:00:00 PM 4269 LAWTON ST NATIONAL ELECTRIC PCB, 3.00 (GAL) THE TRUCK CONTAINMENT SYSTEM Case Number, Source Agency, Discharger Name, Discharger Phone</i>		
Spill Date Time:			
Spill Location:			
Discharger Org:			
Material Spilled:			
Waterway Affected:			
Fields Not Reported:			
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
<i>NO</i>	<i>NO</i>	<i>NO</i>	<i>NO</i>

Map ID

34

VISTA Address*:	ARROW-WELDT SALES ENG. CO. 2750 POPLAR DETROIT, MI 48208	VISTA ID#:	1752398
		Distance/Direction:	0.98 MI / NE
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	<i>ARROW-WELDT SALES ENG. CO. 2750 POPLAR DETROIT, MI 0-002598</i>		
Leak ID#:			

Map ID

34



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #39

SITES IN THE SURROUNDING AREA (within 1/2 - 1 mile) CONT.

Remediation Status: *CLOSED*
Description / Comment: *FACILITY COUNTY: WAYNE*

VISTA Address*:	SHELL SERVICE STATION 6171 W VERNOR/DRAGOON DETROIT, MI 48209	VISTA ID#:	2543252
		Distance/Direction:	0.94 MI / S
		Plotted as:	Point

Map ID

35

STATE LUST - State Leaking Underground Storage Tank / SRC# 319
EPA/Agency ID: N/A
Agency Address: *SHELL SERVICE STATION*
6171 W VERNOR/DRAGOON
DETROIT, MI
0-010559
Leak ID#: *CLOSED*
Remediation Status: *CLOSED*
Description / Comment: *FACILITY COUNTY: WAYNE*

VISTA Address*:	FIRE DEPT ENGINE #27 1465 JUNCTION AVE DETROIT, MI 48209	VISTA ID#:	7103331
		Distance/Direction:	0.96 MI / S
		Plotted as:	Point

Map ID

36

STATE LUST - State Leaking Underground Storage Tank / SRC# 319
EPA/Agency ID: N/A
Agency Address: *FIRE DEPT ENGINE #27*
1465 JUNCTION AVE
DETROIT, MI
0-019103
Leak ID#: *CLOSED*
Remediation Status: *CLOSED*
Description / Comment: *FACILITY COUNTY: WAYNE*

VISTA Address*:	DETROIT DPW 3040 W. VERNOR DETROIT, MI 48216	VISTA ID#:	1775311
		Distance/Direction:	0.97 MI / E
		Plotted as:	Point

Map ID

37

STATE LUST - State Leaking Underground Storage Tank / SRC# 319
EPA/Agency ID: N/A
Agency Address: *DETROIT DPW*
3040 W. VERNOR
DETROIT, MI
5-000237
Leak ID#: *OPEN*
Remediation Status: *OPEN*
Description / Comment: *FACILITY COUNTY: WAYNE*

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile)

VISTA Address*:	LAWTON PROPERTY 4445 LAWTON DETROIT, MI 48208	VISTA ID#:	6641962
		Distance/Direction:	1.00 MI / NE
		Plotted as:	Point

Map ID

38

NFRAP / SRC# 18
EPA ID: MID065573495
Agency Address: *LAWTON PROPERTY*
4445 LAWTON
DETROIT, MI 48184
Name: *NOT REPORTED* Lead Agency: *FEDERAL ENFORCEMENT* Actual Start Date: *UNKNOWN* Actual Completion Date: *UNKNOWN*
NOT REPORTED *FEDERAL ENFORCEMENT* *NOT REPORTED* *UNKNOWN*
Alias Name: *HOSKINS MANUFACTURING CO.*



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901


Date of Report: May 24, 2000

Version 2.6.1

Page #40

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

Alias Street:	NOT REPORTED		
Alias City:	NOT REPORTED	Alias Latitude:	0
Alias Zip:	NOT REPORTED	Alias Longitude:	0
Alias State:	MI		
Alias Description:	NOT REPORTED		
Alias Name:	LAUWTON PROPERTY		
Alias Street:	4445 LAUWTON		
Alias City:	DETROIT	Alias Latitude:	0
Alias Zip:	48184	Alias Longitude:	0
Alias State:	MI		
Alias Description:	NOT REPORTED		
EPA Region:	5		
Congressional District:	0		
Federal Facility:	Agency Code ()		
Facility Ownership:	UNKNOWN		
Site Incident Category:	unknown		
Federal Facility Docket:	SITE IS NOT INCLUDED ON THE DOCKET		
NPL Status:	NOT ON NPL		
Incident Type:	Unknown		
Proposed NPL Update #:	0		
Final NPL Update #:	0		
Financial Management System ID:	NOT REPORTED		
Latitude:	0		
Longitude:	0		
Lat/Long Source:	Agency Code ()		
Lat/Long Accuracy:	Unknown		
Dioxin Tier:	Unknown		
USGS Hydro Unit:	0		
RCRA Indicator:	Unknown		
Unit Id:	0		
Unit Name:	ENTIRE SITE		
Type:	DISCOVERY	Lead Agency:	STATE, FUND FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	APRIL 3, 1996
Type:	PRELIMINARY ASSESSMENT	Lead Agency:	STATE, FUND FINANCED
Qualifier:	NO FURTHER REMEDIAL ACTION	Category:	Unknown
Name:	PLANNED	Actual Start Date:	NOT REPORTED
Plan Status:	NOT REPORTED	Actual Completion Date:	AUGUST 2, 1997
Type:	REMOVAL ACTION	Lead Agency:	EPA FUND-FINANCED
Qualifier:	CLEAN UP	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	MAY 2, 1996
Plan Status:	PRIMARY	Actual Completion Date:	NOVEMBER 2, 1996

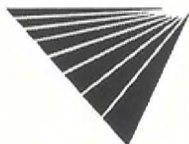

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #41

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

SCL - State Equivalent CERCLIS List / SRC# 323		Agency ID:	821560
Agency Address:	LAWTON PROPERTY 4445 LAUWTON DETROIT, MI 48208 UNKNOWN		
Status:	NOT AVAILABLE		
Facility Type:	NOT AVAILABLE		
Lead Agency:	INTERIM RESPONSE IN PROGRESS		
State Status:	LEAD		
Pollutant 1:	PNA OTHER		
Pollutant 2:	CHLORINATED SOLVENTS		
Pollutant 3:			

VISTA Address*:	4457 HUMBOLDT ST DETROIT, MI 48208	VISTA ID#:	8368927
		Distance/Direction:	1.08 MI / NE
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	283251

Map ID

38

Agency Address:	4457 HUMBOLDT ST DETROIT, MI MARCH 14, 1995 09:00:00 PM				
Spill Date Time:	283251				
Case Number:	4457 HUMBOLDT ST				
Spill Location:	N				
Source Agency:	UNKNOWN MATERIAL 0.00 (UNK)				
Material Spilled:	ATMOSPHERE				
Waterway Affected:	Discharger Name, Discharger Org, Discharger Phone				
Fields Not Reported:					
Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:
YES	NO	NO	NO	NO	NO

VISTA Address*:	DOMESTIC LINEN SUPPLY 3800 18TH STREET DETROIT, MI 48208	VISTA ID#:	1727126
		Distance/Direction:	1.01 MI / NE
		Plotted as:	Point

Map ID

39

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	DOMESTIC LINEN SUPPLY 3800 18TH STREET DETROIT, MI 0-011476		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	HEATLEY TOWING 2810 W VERNOR DETROIT, MI 48216	VISTA ID#:	1761291
		Distance/Direction:	1.02 MI / E
		Plotted as:	Point

Map ID

40

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	HEATLEY TOWING 2810 W VERNOR DETROIT, MI 0-005448		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #42

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

VISTA Address*:	POLICE DEPT PRECINCT #3 2801 W VERNOR DETROIT, MI 48216	VISTA ID#:	7103867
		Distance/Direction:	1.03 MI / E
		Plotted as:	Point

Map ID

40

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	POLICE DEPT PRECINCT #3 2801 W VERNOR DETROIT, MI 0-019131		
Leak ID#:	CLOSED		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	HIATT OIL CO 4040 W WARREN DETROIT, MI 48210	VISTA ID#:	4852910
		Distance/Direction:	1.04 MI / N
		Plotted as:	Point

Map ID

41

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	HIATT OIL CO 4040 W WARREN DETROIT, MI 0-010211		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	STINSON FUNERAL HOME 1540 W GRAND BLVD DETROIT, MI 48208	VISTA ID#:	6598749
		Distance/Direction:	1.05 MI / N
		Plotted as:	Point

Map ID

41

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	STINSON FUNERAL HOME 1540 W GRAND BLVD DETROIT, MI 0-039195		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	ARROW CHEMICAL PRODUCTS INC. 2067 ST. ANNE DETROIT, MI	VISTA ID#:	12542728
		Distance/Direction:	1.05 MI / E
		Plotted as:	Point

Map ID

42

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	SAME AS ABOVE		
Leak ID#:	0-014101		
Remediation Status:	OPEN		
Description / Comment:	FACILITY COUNTY: WAYNE		

VISTA Address*:	STEEL SVCS AND WAREHOUSE 3401 MARTIN AVE DETROIT, MI 48210	VISTA ID#:	2541959
		Distance/Direction:	1.05 MI / W
		Plotted as:	Point

Map ID

43

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	STEEL SERVICE WAREHOUSING 3401 MARTIN DETROIT, MI 0-035498		
Leak ID#:			



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #43

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

Remediation Status:	CLOSED
Description / Comment:	FACILITY COUNTY: WAYNE

VISTA Address*:	AMOCO OIL 0052 3365 WARREN DETROIT, MI 48208	VISTA ID#:	1775492
		Distance/Direction:	1.05 MI / N
		Plotted as:	Point

Map ID

44

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	AMOCO OIL 0052 3365 WARREN DETROIT, MI 5-000027		
Leak ID#:	5-000027		
Remediation Status:	CLOSED		
Description / Comment:	FACILITY COUNTY: WAYNE		

VISTA Address*:	LOTTIE HUGHLEY 3201 W WARREN/WILLIAMS DETROIT, MI 48208	VISTA ID#:	1763143
		Distance/Direction:	1.11 MI / N
		Plotted as:	Point

Map ID

44

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	LOTTIE HUGHLEY 3201 W WARREN/WILLIAMS DETROIT, MI 0-010560		
Leak ID#:	0-010560		
Remediation Status:	CLOSED		
Description / Comment:	FACILITY COUNTY: WAYNE		


VISTA Address*:	1559 MILITARY DRIVE DETROIT, MI 48209	VISTA ID#:	8369754
		Distance/Direction:	1.06 MI / S
		Plotted as:	Point

Map ID

45

ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	100075
Agency Address:	1559 MILITARY DRIVE DETROIT, MI		
Spill Date Time:	DECEMBER 17, 1991 08:38:00 PM		
Case Number:	100075		
Spill Location:	1559 MILITARY DRIVE		
Source Agency:	N		
Discharger Name:	UNKNOWN		
Material Spilled:	OIL, FUEL: NO. 2, 0.00 (UNK)		
Waterway Affected:	OIL SPRAYED INTO STREET		
Fields Not Reported:	Discharger Org, Discharger Phone		

Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:
NO	NO	NO	NO	NO	NO

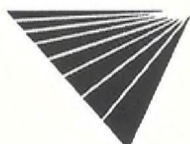

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #44

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

VISTA Address*:	CARTER INDUSTRIES INC 4690 HUMBOLDT DETROIT, MI 48208	VISTA ID#:	72242
		Distance	1.08 MI
		Plotted as:	Polygon
CERCLIS / SRC# 17		EPA ID:	MID980274179
Agency Address:	CARTER INDUSTRIES, INC. 4690 HUMBOLDT DETROIT, MI 48208		
Site Description:	THE CARTER INDUSTRIES FACILITY IS LOCATED AT 4690 HUMBOLDT STREET IN DETROIT, MICHIGAN. THE SITE ENCOMPASSES THIS AND ADJACENT PROPERTIES. IT IS SITUATED APPROXIMATELY 1/2 MILE SOUTHEAST OF THE INTERSECTION OF INTERSTATE HIGHWAYS 96 AND		
EPA Region:	5		
Congressional District:	15		
Federal Facility:	Agency Code (8)		
Facility Ownership:	OTHER		
Site Incident Category:	unknown		
Federal Facility Docket:	SITE IS NOT INCLUDED ON THE DOCKET		
NPL Status:	DELETED		
Incident Type:	Unknown		
Proposed NPL Update #:	0		
Final NPL Update #:	0		
Financial Management System ID:	055F		
Latitude:	0		
Longitude:	0		
Lat/Long Source:	Agency Code ()		
Lat/Long Accuracy:	Unknown		
Dioxin Tier:	Unknown		
USGS Hydro Unit:	4090004		
RCRA Indicator:	Unknown		
Alias Name:	CARTER IND INC		
Alias Street:	NOT REPORTED		
Alias City:	NOT REPORTED	Alias Latitude:	0
Alias Zip:	NOT REPORTED	Alias Longitude:	0
Alias State:	MI		
Alias Description:	NOT REPORTED		
Unit Id:	0		
Unit Name:	SITEWIDE		
Alias Name:	CARTER SALVAGE CORP		
Alias Street:	NOT REPORTED		
Alias City:	NOT REPORTED	Alias Latitude:	0
Alias Zip:	NOT REPORTED	Alias Longitude:	0
Alias State:	MI		
Alias Description:	NOT REPORTED		
Unit Id:	1		
Unit Name:	SOURCE CONTROL-SOIL BUILDINGS		
Alias Name:	CARTER INDUSTRIES, INC		
Alias Street:	NOT REPORTED		

Map ID

46



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #45

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

Alias City:	WAYNE	Alias Latitude:	0
Alias Zip:	NOT REPORTED	Alias Longitude:	0
Alias State:	MI		
Alias Description:	NOT REPORTED		
Alias Name:	CARTER INDUSTRIALS, INC		
Alias Street:	NOT REPORTED		
Alias City:	NOT REPORTED	Alias Latitude:	0
Alias Zip:	NOT REPORTED	Alias Longitude:	0
Alias State:	NOT REPORTED		
Alias Description:	NOT REPORTED		
Type:	DISCOVERY	Lead Agency:	STATE, FUND FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	JUNE 6, 1986
Type:	HAZARD RANKING SYSTEM SCORE	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	JUNE 24, 1988
Type:	FINAL LISTING ON NPL	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	MARCH 31, 1989
Type:	PROPOSED FOR NPL	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	JUNE 24, 1988
Type:	PRELIMINARY ASSESSMENT	Lead Agency:	STATE, FUND FINANCED
Qualifier:	HIGHER PRIORITY	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	JUNE 18, 1986
Type:	REMOVAL INVESTIGATION AT NPL SITES	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	JUNE 29, 1990
Plan Status:	PRIMARY	Actual Completion Date:	SEPTEMBER 21, 1990
Type:	REMOVAL INVESTIGATION AT NPL SITES	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	APRIL 5, 1992
Plan Status:	PRIMARY	Actual Completion Date:	APRIL 10, 1992



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #46

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

Type:	REMOVAL ACTION	Lead Agency:	EPA FUND-FINANCED
Qualifier:	STABILIZATION	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	JUNE 6, 1986
Plan Status:	PRIMARY	Actual Completion Date:	OCTOBER 11, 1988
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
Type:	REMOVAL ACTION	Lead Agency:	EPA FUND-FINANCED
Qualifier:	STABILIZATION	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	OCTOBER 11, 1988
Plan Status:	PRIMARY	Actual Completion Date:	MAY 31, 1989
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
Type:	SCREENING SITE INSPECTION	Lead Agency:	EPA FUND-FINANCED
Qualifier:	HIGHER PRIORITY	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	JUNE 24, 1988
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
Type:	Agency Code (BE)	Lead Agency:	RESPONSIBLE PARTY
Qualifier:	HIGHER PRIORITY	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	FEBRUARY 12, 1993
Plan Status:	PRIMARY	Actual Completion Date:	JUNE 9, 1995
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	NOT REPORTED	UNKNOWN
Type:	Agency Code (BF)	Lead Agency:	RESPONSIBLE PARTY
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	JUNE 9, 1995
Plan Status:	PRIMARY	Actual Completion Date:	JUNE 26, 1997
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
Type:	COMBINED RI/FS	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	MAY 31, 1989
Plan Status:	PRIMARY	Actual Completion Date:	SEPTEMBER 18, 1991
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
Type:	NPL DELETION	Lead Agency:	EPA IN-HOUSE
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	DECEMBER 30, 1996
Plan Status:	PRIMARY	Actual Completion Date:	MARCH 25, 1997
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #47

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

Type:	OTHER EVENT	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	JUNE 27, 1986
Plan Status:	Unknown	Actual Completion Date:	MARCH 31, 1987
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
Type:	RECORD OF DECISION	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	PROJECT SUSPENDED	Actual Completion Date:	SEPTEMBER 18, 1991
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
Type:	TREATABILITY STUDIES	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	SEPTEMBER 11, 1990
Plan Status:	Unknown	Actual Completion Date:	DECEMBER 18, 1991
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	NOT REPORTED	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	NOT REPORTED	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN
NOT REPORTED	FEDERAL ENFORCEMENT	NOT REPORTED	UNKNOWN
Financial Type:	Date:	Financial Amount (\$):	
ACTUAL OBLIGATION	DECEMBER 17, 1987	10000	
DECOMMITMENT	SEPTEMBER 12, 1986	250000	
COMMITMENT	DECEMBER 30, 1987	10000	
DECOMMITMENT	SEPTEMBER 30, 1986	150000	
ACTUAL OBLIGATION	JUNE 6, 1986	50000	
DECOMMITMENT	SEPTEMBER 17, 1986	100000	
ACTUAL OBLIGATION	JUNE 17, 1986	50000	
DECOMMITMENT	SEPTEMBER 24, 1986	250000	
ACTUAL OBLIGATION	JUNE 23, 1986	200000	
DECOMMITMENT	JUNE 6, 1986	50000	
ACTUAL OBLIGATION	JULY 10, 1986	250000	
DECOMMITMENT	JUNE 17, 1986	50000	
ACTUAL OBLIGATION	JULY 22, 1986	230000	
DECOMMITMENT	JUNE 23, 1986	200000	
ACTUAL OBLIGATION	AUGUST 19, 1986	139000	
DECOMMITMENT	JULY 10, 1986	250000	
ACTUAL OBLIGATION	AUGUST 28, 1986	2700	
DECOMMITMENT	JULY 22, 1986	230000	
ACTUAL OBLIGATION	SEPTEMBER 12, 1986	250000	
DECOMMITMENT	AUGUST 19, 1986	139000	
ACTUAL OBLIGATION	SEPTEMBER 30, 1986	150000	
DECOMMITMENT	AUGUST 28, 1986	2700	
ACTUAL OBLIGATION	SEPTEMBER 17, 1986	100000	
DECOMMITMENT	DECEMBER 17, 1987	10000	



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #48

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

Financial Type:	Date:	Financial Amount (\$):
ACTUAL OBLIGATION	SEPTEMBER 24, 1986	250000
ACTUAL OBLIGATION	DECEMBER 17, 1987	10000
DECOMMITMENT	DECEMBER 17, 1987	10000
COMMITMENT	SEPTEMBER 8, 1992	250000
DECOMMITMENT	SEPTEMBER 8, 1992	250000
ACTUAL OBLIGATION	SEPTEMBER 29, 1992	250000
COMMITMENT	MARCH 27, 1995	250000
DECOMMITMENT	MARCH 27, 1995	250000
ACTUAL OBLIGATION	APRIL 28, 1995	250000
ACTUAL OBLIGATION	JUNE 27, 1986	12690
Agency Code (B)	SEPTEMBER 14, 1990	250000
COMMITMENT	SEPTEMBER 14, 1990	250000
DECOMMITMENT	OCTOBER 10, 1990	250000
ACTUAL OBLIGATION	OCTOBER 10, 1990	250000

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		CARTER INDUSTRIALS SITE 4690 HUMBOLDT AVE DETROIT, MI 0-037657	
Leak ID#:			
Remediation Status:		OPEN	
Description / Comment:		FACILITY COUNTY: WAYNE	

VISTA Address*:	GAS ARE US 4251 W WARREN DETROIT, MI 48210	VISTA ID#:	2543432	Map ID 47
		Distance/Direction:	1.08 MI / NW	
		Plotted as:	Point	


STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		GAS ARE US 4251 W WARREN DETROIT, MI 0-020825	
Leak ID#:			
Remediation Status:		OPEN	
Description / Comment:		FACILITY COUNTY: WAYNE	

VISTA Address*:	VACANT BUILDING 6575 WEST VERNOR DETROIT, MI 48209	VISTA ID#:	1761299	Map ID 48
		Distance/Direction:	1.09 MI / SW	
		Plotted as:	Point	

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		VACANT BUILDING 6575 WEST VERNOR DETROIT, MI 0-033733	
Leak ID#:			
Remediation Status:		CLOSED	
Description / Comment:		FACILITY COUNTY: WAYNE	

VISTA Address*:	FOREST HUMBOLDT DUMPING FOREST HUMBOLDT DETROIT, MI 48201	VISTA ID#:	3145821	Map ID 49
		Distance/Direction:	1.13 MI / NE	
		Plotted as:	Point	

CERCLIS / SRC# 17		EPA ID:	MID985580471
Agency Address:		SAME AS ABOVE	
Site Description:		RESPONSE TO AN ANONYMOUS PHONE CALL REGARDING DRUMS OF HAZARDOUS MATERIAL THAT WERE LEFT IN A VACANT LOT.	

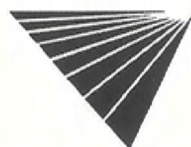

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #49

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

EPA Region:	5		
Congressional District:	0		
Federal Facility:	Agency Code ()		
Facility Ownership:	UNKNOWN		
Site Incident Category:	unknown		
Federal Facility Docket:	SITE IS NOT INCLUDED ON THE DOCKET		
NPL Status:	NOT ON NPL		
Incident Type:	Unknown		
Proposed NPL Update #:	0		
Final NPL Update #:	0		
Financial Management System ID:	05JC		
Latitude:	0		
Longitude:	0		
Lat/Long Source:	Agency Code ()		
Lat/Long Accuracy:	Unknown		
Dioxin Tier:	Unknown		
USGS Hydro Unit:	0		
RCRA Indicator:	Unknown		
Unit Id:	0		
Unit Name:	SITEWIDE		
Alias Name:	FOREST HUMBOLDT DUMPING		
Alias Street:	NOT REPORTED		
Alias City:	NOT REPORTED	Alias Latitude:	0
Alias Zip:	NOT REPORTED	Alias Longitude:	0
Alias State:	MI		
Alias Description:	NOT REPORTED		
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	NOT REPORTED	UNKNOWN
Type:	DISCOVERY	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	JUNE 5, 1990
Type:	PRELIMINARY ASSESSMENT	Lead Agency:	EPA FUND-FINANCED
Qualifier:	NO FURTHER REMEDIAL ACTION PLANNED	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	OCTOBER 24, 1991
Type:	REMOVAL ACTION	Lead Agency:	EPA FUND-FINANCED
Qualifier:	CLEAN UP	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	MAY 18, 1990
Plan Status:	PRIMARY	Actual Completion Date:	JUNE 1, 1990
Financial Type:	Date:	Financial Amount (\$):	
COMMITMENT	MAY 29, 1990	50000	
DECOMMITMENT	MAY 29, 1990	50000	



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #50

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

Financial Type:	Date:	Financial Amount (\$):
ACTUAL OBLIGATION	JUNE 8, 1990	50000

VISTA Address*:	ADAMS TRANS AID CORP 6707 DIX AVE DETROIT, MI 48209	VISTA ID#:	1735677
		Distance/Direction:	1.15 MI / SW
		Plotted as:	Point

Map ID

50

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	ADAMS LEASING INC 6707 DIX AVE. DETROIT, MI 0-000996		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	MICH CONSOLIDATED GAS CO. 1221 24TH ST. DETROIT, MI 48216	VISTA ID#:	8367445
		Distance/Direction:	1.15 MI / SE
		Plotted as:	Point

Map ID

51


ERNS - Emergency Response Notification System / SRC# 8		EPA/Agency ID:	N/A
Agency Address:	MICH CONSOLIDATED GAS CO. 1221 24TH ST. DETROIT, MI NOVEMBER 25, 1987 07:46:00 PM 1221 24TH ST. MICH CONSOLIDATED GAS CO. NATURAL GAS, 0.00 (UNK) ATMOSPHERE Case Number, Source Agency, Discharger Name, Discharger Phone		
Spill Date Time:			
Spill Location:			
Discharger Org:			
Material Spilled:			
Waterway Affected:			
Fields Not Reported:			
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO

VISTA Address*:	AMBASSADOR BRIDGE PARCEL 4002 1407 21ST STREET DETROIT, MI 48216	VISTA ID#:	3509821
		Distance/Direction:	1.16 MI / E
		Plotted as:	Point

Map ID

52

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	AMBASSADOR BRIDGE PARCEL 4002 1407 21ST STREET DETROIT, MI 0-039055		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

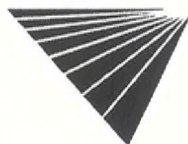

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #51

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

SCL - State Equivalent CERCLIS List / SRC# 323		Agency ID:	820224
Agency Address:	AMBASSADOR BRIDGE CUSTOMS FAC HOWARD AND 21ST STREET DETROIT, MI 48209		
Status:	UNKNOWN		
Facility Type:	NOT AVAILABLE		
Lead Agency:	NOT AVAILABLE		
State Status:	FINAL CLEANUP		
Pollutant 1:	PNA-POLYNUCLEAR AROMATICS		
Pollutant 2:	BTX/BEX/BEXT/BTE		
Pollutant 3:	LEAD		

VISTA Address*:	WELCOME CENTER AMBASSADOR PROP 1428 21ST STREET DETROIT, MI 48216	VISTA ID#:	6845037
		Distance/Direction:	1.16 MI / E
		Plotted as:	Point

Map ID

52

SCL - State Equivalent CERCLIS List / SRC# 323		Agency ID:	820145
Agency Address:	WELCOME CENTER AMBASSADOR PROP 1428 21ST STREET DETROIT, MI		
Status:	UNKNOWN		
Facility Type:	NOT AVAILABLE		
Lead Agency:	NOT AVAILABLE		
State Status:	INTERIM RESPONSE IN PROGRESS		
Pollutant 1:	BTX/BEX/BEXT/BTE		
Pollutant 2:	OTHER		
Pollutant 3:	OTHER		

VISTA Address*:	JEFFERY M/M 2971 W WARREN DETROIT, MI 48208	VISTA ID#:	6599669
		Distance/Direction:	1.17 MI / N
		Plotted as:	Point

Map ID

53


STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	JEFFERY M/M 2971 W WARREN DETROIT, MI 0-004732		
Leak ID#:	0-004732		
Remediation Status:	OPEN		
Description / Comment:	FACILITY COUNTY: WAYNE		

VISTA Address*:	AMTRAK PASSENGER STATION 2405 W. VERNOR HWY. DETROIT, MI 48216	VISTA ID#:	5327279
		Distance/Direction:	1.17 MI / E
		Plotted as:	Point

Map ID

54

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	AMTRAK PASSENGER STATION 2405 W. VERNOR HWY. DETROIT, MI 0-017734		
Leak ID#:	0-017734		
Remediation Status:	OPEN		
Description / Comment:	FACILITY COUNTY: WAYNE		

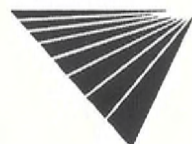

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #52

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

VISTA Address*:	TOTAL PETROLEUM 5015 LIVERNOIS DETROIT, MI 48210	VISTA ID#:	5348360
		Distance/Direction:	1.17 MI / W
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	TOTAL PETROLEUM 5015 LIVERNOIS DETROIT, MI 5-001169		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	PAULINE GAS OIL 5015 LIVERNOIS DETROIT, MI 48210	VISTA ID#:	11506084
		Distance/Direction:	1.17 MI / W
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	PAULINE GAS OIL 5015 LIVERNOIS DETROIT, MI 0-016369		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	GORSKI BULK TRANSPORT INC I-94, LIVERNOIS EXIT DETROIT, MI	VISTA ID#:	2243838
		Distance/Direction:	1.20 MI / W
		Plotted as:	Point
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	99217
Agency Address:	SAME AS ABOVE		
Spill Date Time:	NOVEMBER 15, 1991 01:00:00 PM		
Case Number:	99217		
Spill Location:	I-94, LIVERNOIS EXIT		
Source Agency:	N		
Discharger Name:	GORSKI, BERNARD		
Discharger Org:	GORSKI BULK TRANSPORT INC		
Fields Not Reported:	Discharger Phone, Material Spilled, Waterway Affected		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO

VISTA Address*:	WARREN SERVICES INC 4710 W WARREN AVE DETROIT, MI 48210	VISTA ID#:	6599670
		Distance/Direction:	1.21 MI / NW
		Plotted as:	Point
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	WARREN SERVICES INC 4710 W WARREN AVE DETROIT, MI 0-013291		
Leak ID#:	CLOSED		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

Map ID

55

Map ID

55

Map ID

55

Map ID

56



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #53

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

VISTA Address*:	ASCD SERVICE 6756 STRATTON DETROIT, MI 48209	VISTA ID#:	28565
		Distance/Direction:	1.21 MI / SW
		Plotted as:	Point

Map ID

57

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	ASCD SERVICE 6756 STRATTON DETROIT, MI 0-038735		
Leak ID#:	CLOSED		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	PRESTON TRUCKING CO 6801 STRATTON ST DETROIT, MI 48209	VISTA ID#:	339071
		Distance/Direction:	1.24 MI / SW
		Plotted as:	Point

Map ID

57

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	PRESTON TRUCKING CO INC 6801 STRATTON ST DETROIT, MI 0-004968		
Leak ID#:	OPEN		
Remediation Status:	FACILITY COUNTY: WAYNE		
Description / Comment:			

VISTA Address*:	KERRY BROS 5255 TILLMAN DETROIT, MI 48208	VISTA ID#:	12429675
		Distance/Direction:	1.22 MI / N
		Plotted as:	Point

Map ID

58

ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	448097
Agency Address:	KERRY BROS 5255 TILLMAN DETROIT, MI JULY 29, 1998 UNKNOWN 448097		
Spill Date Time:	5255 TILLMAN		
Case Number:	KERRY BROS		
Spill Location:	KERRY BROS		
Discharger Name:	OIL, MISC: MOTOR, 0.00 (UNK)		
Discharger Org:	SOIL		
Material Spilled:	Source Agency, Discharger Phone		
Waterway Affected:			
Fields Not Reported:			
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO

VISTA Address*:	GARMENT CORP OF AMERICA 4255 MC GRAW DETROIT, MI 48210	VISTA ID#:	1773726
		Distance/Direction:	1.22 MI / NW
		Plotted as:	Point

Map ID

59

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	GARMENT CORP OF AMERICA 4255 MCGRAW DETROIT, MI 0-034561		
Leak ID#:	OPEN		
Remediation Status:			



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #54

SITES IN THE SURROUNDING AREA (within 1 - 1.25 mile) CONT.

Description / Comment: *FACILITY COUNTY: WAYNE*

VISTA Address*:	MI CONSOLIDATED GAS CO 2634 14TH STREET DETROIT, MI 48216	VISTA ID#:	12700471
		Distance/Direction:	1.23 MI / E
		Plotted as:	Point

Map ID

60

ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	476974
Agency Address:	<i>MI CONSOLIDATED GAS CO 2634 14TH STREET DETROIT, MI</i>		
Spill Date Time:	<i>MARCH 15, 1999 03:30:00 PM</i>		
Case Number:	<i>476974</i>		
Spill Location:	<i>2634 14TH STREET</i>		
Discharger Name:	<i>MI CONSOLIDATED GAS CO</i>		
Discharger Org:	<i>MI CONSOLIDATED GAS CO</i>		
Material Spilled:	<i>NATURAL GAS, 0.00 (UNK)</i>		
Waterway Affected:	<i>ATMOSPHERE</i>		
Fields Not Reported:	<i>Source Agency, Discharger Phone</i>		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
<i>YES</i>	<i>NO</i>	<i>NO</i>	<i>NO</i>

VISTA Address*:	R M SHARING PROCESSING 3633 PARKINSON DETROIT, MI 48210	VISTA ID#:	7478630
		Distance/Direction:	1.24 MI / W
		Plotted as:	Point

Map ID

61

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	<i>R M SHARING PROCESSING 3633 PARKINSON DETROIT, MI</i>		
Leak ID#:	<i>0-017817</i>		
Remediation Status:	<i>OPEN</i>		
Description / Comment:	<i>FACILITY COUNTY: WAYNE</i>		

VISTA Address*:	DETROIT FIRE ENG 12 CITY OF 2775 W WARREN DETROIT, MI 48208	VISTA ID#:	5188526
		Distance/Direction:	1.24 MI / NE
		Plotted as:	Point

Map ID

62

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	<i>FIRE DEPT ENGINE #12 2775 W WARREN DETROIT, MI</i>		
Leak ID#:	<i>0-019097</i>		
Remediation Status:	<i>CLOSED</i>		
Description / Comment:	<i>FACILITY COUNTY: WAYNE</i>		



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: **249401901**

Date of Report: **May 24, 2000**

Version 2.6.1

Page #55


UNMAPPED SITES

VISTA Address*:	THORNAPPLE VALLY 3295 TILLMAN DETROIT, MI 48208	VISTA ID#:	8370961
-----------------	---	------------	---------

ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	323879
Agency Address:	SAME AS ABOVE		
Spill Date Time:	FEBRUARY 3, 1996 01:00:00 AM		
Case Number:	323879		
Spill Location:	3295 TILLMAN		
Discharger Org:	THORNAPPLE VALLY		
Material Spilled:	AMMONIA, ANHYDROUS, 1000.00 (LBS)		
Waterway Affected:	ATMOSPHERE		
Fields Not Reported:	Source Agency, Discharger Name, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO

VISTA Address*:	ST. MARYS PEERLESS CEMENT DEARBORNE AVE ROUGE RIVER BEHIND PLANT DETROIT, MI 48209	VISTA ID#:	8367659
-----------------	--	------------	---------

ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	237371
Agency Address:	SAME AS ABOVE		
Spill Date Time:	APRIL 30, 1994 11:30:00 AM		
Case Number:	237371		
Spill Location:	DEARBORNE AVE ROUGE RIVER BEHIND PLANT		
Source Agency:	N		
Discharger Name:	UNKNOWN,		
Discharger Org:	ST. MARYS PEERLESS CEMENT		
Material Spilled:	CEMENT DUST, 0.00 (UNK)		
Waterway Affected:	ATMOSPHERE		
Fields Not Reported:	Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO

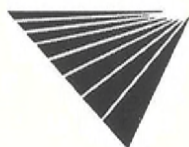

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Version 2.6.1

Date of Report: May 24, 2000

Page #56

UNMAPPED SITES CONT.

VISTA Address*:	JUSTIN TIME BEAUBBIEN ST AND MILWALKEE BLVD DETROIT, MI 48210	VISTA ID#:	8369763
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	237223
Agency Address:		SAME AS ABOVE	
Spill Date Time:		APRIL 29, 1992 10:00:00 AM	
Case Number:		237223	
Spill Location:		BEAUBBIEN ST AND MILWALKEE BLVD	
Source Agency:		N	
Discharger Name:		RIM, JULIUS	
Discharger Org:		JUSTIN TIME	
Waterway Affected:		CONCRETE	
Fields Not Reported:		Discharger Phone, Material Spilled	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO
VISTA Address*:	HOLLOWAYS GROILE NAPIER RD DETROIT, MI 48209	VISTA ID#:	198263
NFRAP / SRC# 18		EPA ID:	MID000605048
Agency Address:		SAME AS ABOVE	
Alias Name:		HOLLOWAY LDFL EAST AREA	
Alias Street:		10930 SIX MILE RD	
Alias City:	SALEM	Alias Latitude:	0
Alias Zip:	48175	Alias Longitude:	0
Alias State:	MI		
Alias Description:		NOT REPORTED	
Alias Name:		HOLLOWAYS	
Alias Street:		NOT REPORTED	
Alias City:	WAYNE	Alias Latitude:	0
Alias Zip:	NOT REPORTED	Alias Longitude:	0
Alias State:	MI		
Alias Description:		NOT REPORTED	



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #57

UNMAPPED SITES CONT.

EPA Region:	5		
Congressional District:	0		
Federal Facility:	Agency Code ()		
Facility Ownership:	OTHER		
Site Incident Category:	unknown		
Federal Facility Docket:	SITE IS NOT INCLUDED ON THE DOCKET		
NPL Status:	NOT ON NPL		
Incident Type:	Unknown		
Proposed NPL Update #:	0		
Final NPL Update #:	0		
Financial Management System ID:	NOT REPORTED		
Latitude:	0		
Longitude:	0		
Lat/Long Source:	Agency Code ()		
Lat/Long Accuracy:	Unknown		
Dioxin Tier:	Unknown		
USGS Hydro Unit:	4090004		
RCRA Indicator:	Unknown		
Unit Id:	0		
Unit Name:	ENTIRE SITE		
Type:	DISCOVERY	Lead Agency:	EPA FUND-FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	UNKNOWN
Type:	PRELIMINARY ASSESSMENT	Lead Agency:	STATE, FUND FINANCED
Qualifier:	NO FURTHER REMEDIAL ACTION PLANNED	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	DECEMBER 1, 1987



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #58

UNMAPPED SITES CONT.

VISTA Address*:	S AND L WAREHOUSE 6307 WEST 4TH STREET DETROIT, MI 48209	VISTA ID#:	8367478
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	254649
Agency Address:		SAME AS ABOVE	
Spill Date Time:		JULY 15, 1993 UNKNOWN	
Case Number:		254649	
Spill Location:		6307 WEST 4TH STREET	
Source Agency:		N	
Discharger Name:		UNKNOWN	
Discharger Org:		S AND L WAREHOUSE	
Material Spilled:		POLYCHLORINATED BIPHENYLS, 0.00 (UNK)	
Waterway Affected:		SOIL	
Fields Not Reported:		Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO
VISTA Address*:	AMBASSADOR BRIDGE INT'L BRIDGE CO DETROIT RIVER DETROIT, MI 48216	VISTA ID#:	62408542
RCRA-LgGen - RCRA-Large Generator / SRC# 16		EPA ID:	MIR000038968
Agency Address:		SAME AS ABOVE	
Generator Class:		Generates at least 1000 kg./month of non-acutely hazardous waste (or 1 kg./month of acutely hazardous waste).	
VISTA Address*:	ATLAS GREASE COMPANY CAMPBELL AND DRIGGS ST DETROIT, MI 48209	VISTA ID#:	8368295
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	130505
Agency Address:		SAME AS ABOVE	
Spill Date Time:		JULY 1, 1992 UNKNOWN	
Case Number:		130505	
Spill Location:		CAMPBELL AND DRIGGS ST	
Source Agency:		N	
Discharger Name:		N/A	
Discharger Org:		ATLAS GREASE COMPANY	
Material Spilled:		UNKNOWN OIL, 0.00 (UNK)	
Waterway Affected:		VACANT LOT	
Fields Not Reported:		Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #59

UNMAAPPED SITES CONT.

VISTA Address*:	MIDOT BRIDGE I-75 UNDER W GRAND BLVD I-75 UNDER W GRAND BLVD DETROIT, MI 48216	VISTA ID#:	5651648
RCRA-LgGen - RCRA-Large Generator / SRC# 16		EPA ID:	MI0000601906
Agency Address:		SAME AS ABOVE	
Generator Class:		Generates at least 1000 kg./month of non-acutely hazardous waste (or 1 kg./month of acutely hazardous waste).	

VISTA Address*:	TANNER INDUSTRIES DETROIT, MI 48209	VISTA ID#:	8365684
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	380112
Agency Address:		SAME AS ABOVE	
Spill Date Time:		MARCH 13, 1997 UNKNOWN	
Case Number:		380112	
Discharger Name:		TANNER INDUSTRIES	
Discharger Org:		TANNER INDUSTRIES	
Material Spilled:		AMMONIA, ANHYDROUS, 500.00 (LBS)	
Waterway Affected:		ATMOSPHERE	
Fields Not Reported:		Spill Location, Source Agency, Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO

VISTA Address*:	BEHIND 1822 LEVERETTE IN AN ALLEY DETROIT, MI 48216	VISTA ID#:	8369524
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	140536
Agency Address:		SAME AS ABOVE	
Spill Date Time:		OCTOBER 13, 1992 07:00:00 PM	
Case Number:		140536	
Spill Location:		BEHIND 1822 LEVERETTE IN AN ALLEY	
Source Agency:		N	
Discharger Name:		UNKNOWN.	
Material Spilled:		UNKNOWN MATERIAL (POSSIBLY ANTIF, 0.00 (UNK)	
Waterway Affected:		CONCRETE	
Fields Not Reported:		Discharger Org, Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #60

UNMAPPED SITES CONT.

VISTA Address*:	PROS SERVICES 7940 LIVERONIS AVE DETROIT, MI 48210	VISTA ID#:	8369522
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	357731
Agency Address:	SAME AS ABOVE		
Spill Date Time:	AUGUST 21, 1996 10:50:00 AM		
Case Number:	357731		
Spill Location:	7940 LIVERONIS AVE		
Discharger Org:	PROS SERVICES		
Material Spilled:	OIL MISC: TRANSFORMER//PCB: 6PP, 500.00 (GAL)		
Waterway Affected:	STORM DRAIN > UNK		
Fields Not Reported:	Source Agency, Discharger Name, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO
VISTA Address*:	DETROIT, MI 48209	VISTA ID#:	8365679
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	366253
Agency Address:	SAME AS ABOVE		
Spill Date Time:	OCTOBER 31, 1996 02:00:00 PM		
Case Number:	366253		
Waterway Affected:	DETROIT RIVER		
Fields Not Reported:	Spill Location, Source Agency, Discharger Name, Discharger Org, Discharger Phone, Material Spilled		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	410973
Agency Address:	SAME AS ABOVE		
Spill Date Time:	NOVEMBER 7, 1997 07:30:00 AM		
Case Number:	410973		
Material Spilled:	UNKNOWN OIL 0.00 (UNK)		
Waterway Affected:	SOIL		
Fields Not Reported:	Spill Location, Source Agency, Discharger Name, Discharger Org, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	193596
Agency Address:	SAME AS ABOVE		
Spill Date Time:	AUGUST 20, 1993 09:00:00 AM		
Case Number:	193596		
Source Agency:	N		
Material Spilled:	UNKNOWN OIL 0.00 (UNK)		
Waterway Affected:	DETROIT RIVER		
Fields Not Reported:	Spill Location, Discharger Name, Discharger Org, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901


Date of Report: May 24, 2000

Version 2.6.1

Page #61

UNMAPPED SITES CONT.

VISTA Address*:	ALLIED SIGNAL INC DETROIT, MI 48209	VISTA ID#:	8365682
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	393040
Agency Address:	SAME AS ABOVE		
Spill Date Time:	JUNE 27, 1997 10:40:00 AM		
Case Number:	393040		
Discharger Name:	ALLIED SIGNAL INC		
Discharger Org:	ALLIED SIGNAL INC		
Material Spilled:	OIL, MISC: COAL TAR, 1.00 (GAL)		
Waterway Affected:	DETROIT RIVER		
Fields Not Reported:	Spill Location, Source Agency, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	423304
Agency Address:	SAME AS ABOVE		
Spill Date Time:	FEBRUARY 5, 1998 10:30:00 AM		
Case Number:	423304		
Discharger Name:	ALLIED SIGNAL INC		
Discharger Org:	ALLIED SIGNAL INC		
Material Spilled:	ANTHRACENE OIL (COAL TAR FRACTIO, 0.00 (UNK)		
Waterway Affected:	CONCRETE		
Fields Not Reported:	Spill Location, Source Agency, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO
VISTA Address*:	DETROIT EDISON DETROIT, MI 48210	VISTA ID#:	8365687
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	396594
Agency Address:	SAME AS ABOVE		
Spill Date Time:	JULY 25, 1997 09:00:00 AM		
Case Number:	396594		
Discharger Name:	DETROIT EDISON		
Discharger Org:	DETROIT EDISON		
Material Spilled:	OIL, MISC: TRANSFORMER, 25.00 (GAL)		
Waterway Affected:	ASPHALT/CATCH BASIN ON FACILITY		
Fields Not Reported:	Spill Location, Source Agency, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO

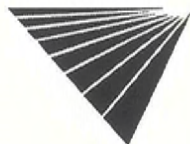

* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #62

UNMAPPED SITES CONT.

ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	407218
Agency Address:		SAME AS ABOVE	
Spill Date Time:		OCTOBER 13, 1997 11:15:00 AM	
Case Number:		407218	
Discharger Name:		DETROIT EDISON	
Discharger Org:		DETROIT EDISON	
Material Spilled:		OIL, MISC: TRANSFORMER, 20.00 (GAL)	
Waterway Affected:		CITY SEWER SYSTEM	
Fields Not Reported:		Spill Location, Source Agency, Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO

VISTA Address*:	ALLIEDSIGNAL INC GREAT LAKES STEEL DETROIT RIVER MM UNKN DETROIT, MI 48209	VISTA ID#:	8368834
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	300306
Agency Address:		SAME AS ABOVE	
Spill Date Time:		JULY 18, 1995 12:55:00 PM	
Case Number:		300306	
Spill Location:		GREAT LAKES STEEL DETROIT RIVER MM UNKNOWN	
Discharger Org:		ALLIEDSIGNAL INC	
Material Spilled:		CRUDE COKE OVEN TAR, 200.00 (GAL)	
Waterway Affected:		DETROIT RIVER	
Fields Not Reported:		Source Agency, Discharger Name, Discharger Phone	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO

VISTA Address*:	VICTOR STEEL DETROIT, MI 48209	VISTA ID#:	8365685
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	136371
Agency Address:		SAME AS ABOVE	
Spill Date Time:		SEPTEMBER 12, 1992 10:30:00 AM	
Case Number:		136371	
Source Agency:		N	
Discharger Name:		UNKNOWN	
Discharger Org:		VICTOR STEEL	
Material Spilled:		UNKNOWN MATERIAL, 0.00 (UNK)	
Fields Not Reported:		Spill Location, Discharger Phone, Waterway Affected	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #63

UNMAPED SITES CONT.

VISTA Address*:	BASF CORP. DETROIT, MI 48210	VISTA ID#:	8365686
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	387414
Agency Address:	SAME AS ABOVE		
Spill Date Time:	MAY 14, 1997 10:00:00 AM		
Case Number:	387414		
Discharger Name:	BASF CORP.		
Discharger Org:	BASF CORP.		
Material Spilled:	ASBESTOS, 3600.00 (LBS)		
Waterway Affected:	SOIL		
Fields Not Reported:	Spill Location, Source Agency, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO
VISTA Address*:	ABANDONED PROPERTY 23 AND POPLAR DETROIT, MI 48208	VISTA ID#:	8035957
RCRA-LgGen - RCRA-Large Generator / SRC# 16		EPA ID:	MIR000030627
Agency Address:	SAME AS ABOVE		
Generator Class:	Generates at least 1000 kg./month of non-acutely hazardous waste (or 1 kg./month of acutely hazardous waste).		
VISTA Address*:	BASF CORP AT 5470 HECLA 5470 HECLA AVE SITE A DETROIT, MI 48208	VISTA ID#:	8035875
RCRA-SmGen - RCRA-Small Generator / SRC# 15		EPA ID:	MIR000031054
Agency Address:	SAME AS ABOVE		
Generator Class:	Generates 100 kg./month but less than 1000 kg./month of non-acutely hazardous waste		
VISTA Address*:	3901 GRAND RIVER APT1202 DETROIT, MI 48208	VISTA ID#:	8368774
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	221501
Agency Address:	SAME AS ABOVE		
Spill Date Time:	FEBRUARY 13, 1994 11:00:00 AM		
Case Number:	221501		
Spill Location:	3901 GRAND RIVER APT1202		
Source Agency:	N		
Discharger Name:	UNKNOWN.		
Material Spilled:	UNKNOWN MATERIAL, 0.00 (UNK)		
Waterway Affected:	ATMOSPHERE		
Fields Not Reported:	Discharger Org, Discharger Phone		
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #64

UNMAPED SITES CONT.

VISTA Address*:	2535 WEST FORT DETROIT, MI 48216	VISTA ID#:	8371368
ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	MI9210
Agency Address:		2535 WEST FORT DETROIT, MI	
Spill Date Time:		MARCH 30, 1992 12:00:00 PM	
Case Number:		MI9210	
Spill Location:		2535 WEST FORT	
Source Agency:		E	
Material Spilled:		55 GAL (WASTE OIL SLUDGE), 18.00 (UNK)	
Fields Not Reported:		Discharger Name, Discharger Org, Discharger Phone, Waterway Affected	
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
YES	NO	NO	NO NO NO
VISTA Address*:	NRT OWNER MICHIGAN BELL YELLOW PAGES BLDG DETROIT, MI	VISTA ID#:	12542989
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		SAME AS ABOVE	
Leak ID#:		5-000022	
Remediation Status:		OPEN	
Description / Comment:		FACILITY COUNTY: WAYNE	
VISTA Address*:	DETROIT METRO WAYNE CT AIRPORT BUILDING 514 DETROIT, MI	VISTA ID#:	8619543
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		SAME AS ABOVE	
Leak ID#:		0-039751	
Remediation Status:		CLOSED	
Description / Comment:		FACILITY COUNTY: WAYNE	
VISTA Address*:	RIGHT OF WAY MAC/DEQUINDRE DETROIT, MI	VISTA ID#:	12543028
STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:		SAME AS ABOVE	
Leak ID#:		5-002295	
Remediation Status:		CLOSED	
Description / Comment:		FACILITY COUNTY: WAYNE	



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #65

UNMAPPED SITES CONT.

VISTA Address*:	LAKE ST. CLAIRE DRUM SOMEWHERE IN LAKE ST.CLAIRE DETROIT, MI	VISTA ID#:	4852694
NFRAP / SRC# 18		EPA ID:	MID985651058
Agency Address:		SAME AS ABOVE	
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:
NOT REPORTED	FEDERAL ENFORCEMENT	NOT REPORTED	UNKNOWN
Financial Type:	Date:	Financial Amount (\$):	
ACTUAL OBLIGATION	NOT REPORTED	3000	
EPA Region:	5		
Congressional District:	0		
Federal Facility:	Agency Code ()		
Facility Ownership:	UNKNOWN		
Site Incident Category:	unknown		
Federal Facility Docket:	SITE IS NOT INCLUDED ON THE DOCKET		
NPL Status:	NOT ON NPL		
Incident Type:	Unknown		
Proposed NPL Update #:	0		
Final NPL Update #:	0		
Financial Management System ID:	05V2		
Latitude:	0		
Longitude:	0		
Lat/Long Source:	Agency Code ()		
Lat/Long Accuracy:	Unknown		
Dioxin Tier:	Unknown		
USGS Hydro Unit:	0		
RCRA Indicator:	Unknown		
Unit Id:	0		
Unit Name:	ENTIRE SITE		
Type:	DISCOVERY	Lead Agency:	STATE, FUND FINANCED
Qualifier:	UNKNOWN	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	UNKNOWN
Type:	PRELIMINARY ASSESSMENT	Lead Agency:	STATE, FUND FINANCED
Qualifier:	NO FURTHER REMEDIAL ACTION PLANNED	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED
Plan Status:	Unknown	Actual Completion Date:	MARCH 2, 1994
Type:	REMOVAL ACTION	Lead Agency:	COAST GUARD
Qualifier:	CLEAN UP	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	UNKNOWN
Plan Status:	Unknown	Actual Completion Date:	UNKNOWN



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #66

UNMAPPED SITES CONT.

VISTA Address*:	DETROIT DRUM CLEAN-UP ADDRESS UNREPORTED DETROIT, MI 99999		VISTA ID#:	120188
Financial Type:		Date:	Financial Amount (\$):	
DECOMMITMENT		AUGUST 18, 1981	22000	
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:	
NOT REPORTED	FEDERAL ENFORCEMENT	NOT REPORTED	UNKNOWN	
Financial Type:		Date:	Financial Amount (\$):	
ACTUAL OBLIGATION		AUGUST 18, 1981	22000	
Name:	Lead Agency:	Actual Start Date:	Actual Completion Date:	
NOT REPORTED	FEDERAL ENFORCEMENT	UNKNOWN	UNKNOWN	
Financial Type:		Date:	Financial Amount (\$):	
DECOMMITMENT		JANUARY 10, 1983	1970	
ACTUAL OBLIGATION		JANUARY 10, 1983	1970	
EPA Region:	5			
Congressional District:	0			
Federal Facility:	Agency Code ()			
Facility Ownership:	OTHER			
Site Incident Category:	unknown			
Federal Facility Docket:	SITE IS NOT INCLUDED ON THE DOCKET			
NPL Status:	NOT ON NPL			
Incident Type:	Unknown			
Proposed NPL Update #:	0			
Final NPL Update #:	0			
Financial Management System ID:	0507			
Latitude:	0			
Longitude:	0			
Lat/Long Source:	Agency Code ()			
Lat/Long Accuracy:	Unknown			
Dioxin Tier:	Unknown			
USGS Hydro Unit:	0			
RCRA Indicator:	Unknown			
Unit Id:	0			
Unit Name:	ENTIRE SITE			
Type:	DISCOVERY	Lead Agency:	EPA FUND-FINANCED	
Qualifier:	UNKNOWN	Category:	Unknown	
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED	
Plan Status:	Unknown	Actual Completion Date:	UNKNOWN	
Type:	PRELIMINARY ASSESSMENT	Lead Agency:	STATE, FUND FINANCED	
Qualifier:	NO FURTHER REMEDIAL ACTION PLANNED	Category:	Unknown	
Name:	NOT REPORTED	Actual Start Date:	NOT REPORTED	
Plan Status:	Unknown	Actual Completion Date:	DECEMBER 2, 1987	



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #67

UNMAPPED SITES CONT.	
1000	1000
1001	1001
1002	1002
1003	1003
1004	1004
1005	1005
1006	1006
1007	1007
1008	1008
1009	1009
1010	1010
1011	1011
1012	1012
1013	1013
1014	1014
1015	1015
1016	1016
1017	1017
1018	1018
1019	1019
1020	1020
1021	1021
1022	1022
1023	1023
1024	1024
1025	1025
1026	1026
1027	1027
1028	1028
1029	1029
1030	1030
1031	1031
1032	1032
1033	1033
1034	1034
1035	1035
1036	1036
1037	1037
1038	1038
1039	1039
1040	1040
1041	1041
1042	1042
1043	1043
1044	1044
1045	1045
1046	1046
1047	1047
1048	1048
1049	1049
1050	1050
1051	1051
1052	1052
1053	1053
1054	1054
1055	1055
1056	1056
1057	1057
1058	1058
1059	1059
1060	1060
1061	1061
1062	1062
1063	1063
1064	1064
1065	1065
1066	1066
1067	1067
1068	1068
1069	1069
1070	1070
1071	1071
1072	1072
1073	1073
1074	1074
1075	1075
1076	1076
1077	1077
1078	1078
1079	1079
1080	1080
1081	1081
1082	1082
1083	1083
1084	1084
1085	1085
1086	1086
1087	1087
1088	1088
1089	1089
1090	1090
1091	1091
1092	1092
1093	1093
1094	1094
1095	1095
1096	1096
1097	1097
1098	1098
1099	1099
1100	1100
1101	1101
1102	1102
1103	1103
1104	1104
1105	1105
1106	1106
1107	1107
1108	1108
1109	1109
1110	1110
1111	1111
1112	1112
1113	1113
1114	1114
1115	1115
1116	1116
1117	1117
1118	1118
1119	1119
1120	1120
1121	1121
1122	1122
1123	1123
1124	1124
1125	1125
1126	1126
1127	1127
1128	1128
1129	1129
1130	1130
1131	1131
1132	1132
1133	1133
1134	1134
1135	1135
1136	1136
1137	1137
1138	1138
1139	1139
1140	1140
1141	1141
1142	1142
1143	1143
1144	1144
1145	1145
1146	1146
1147	1147
1148	1148
1149	1149
115	

Type:	REMOVAL ACTION	Lead Agency:	EPA FUND-FINANCED
Qualifier:	CLEAN UP	Category:	Unknown
Name:	NOT REPORTED	Actual Start Date:	UNKNOWN
Plan Status:	ALTERNATE	Actual Completion Date:	UNKNOWN

VISTA Address*:	RECYCLING CORPORATION OF AMERICA DETROIT, MI 48209	VISTA ID#:	13148594
-----------------	---	------------	----------

SCL - State Equivalent CERCLIS List / SRC# 323	Agency ID:	821586
--	------------	--------

Agency Address:	RECYCLING CORPORATION OF AMERICA DETROIT, MI
Status:	UNKNOWN
Facility Type:	NOT AVAILABLE
Lead Agency:	NOT AVAILABLE
State Status:	INTERIM RESPONSE IN PROGRESS
Pollutant 1:	SOLID WASTES
Pollutant 2:	INDUSTRIAL WASTE
Pollutant 3:	OTHER

VISTA Address*:	MICHCON GAS CO 4018 HANCOCK DETROIT, MI 48210	VISTA ID#:	8368941
--------------------	---	------------	---------

ERNS - Emergency Response Notification System / SRC# 8	Agency ID:	218235
--	------------	--------

Agency Address:	MICHCON GAS CO 4018 HANCOCK DETROIT, MI
Spill Date Time:	JANUARY 23, 1994 02:20:00 AM
Case Number:	218235
Spill Location:	4018 HANCOCK
Source Agency:	N
Discharger Name:	SLIWINSKI, THADDEUS
Discharger Org:	MICHCON GAS CO
Material Spilled:	NATURAL GAS, 0.00 (UNK)
Waterway Affected:	ATMOSPHERE
Fields Not Reported:	Discharger Phone

Air Release:	Land Release:	Water Release:	Ground Release:	Facility Release:	Other Release:
<i>YES</i>	<i>NO</i>	<i>NO</i>	<i>NO</i>	<i>NO</i>	<i>NO</i>

VISTA Address*:	DETROIT METRO AIRPORT - EASTERN IRLINES GATE B-3 DETROIT, MI	VISTA ID#:	12730779
-----------------	--	------------	----------

STATE UST - State Underground Storage Tank / SRC# 322	Agency ID:	0-002276
---	------------	----------

Agency Address:	SAME AS ABOVE
Underground Tanks:	2
Aboveground Tanks:	NOT REPORTED
Tanks Removed:	NOT REPORTED



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: **May 24, 2000**

Version 2.6.1

Page #68

UNMAPPED SITES CONT.

Tank ID:	2U	Tank Status:	CURRENT
Tank Contents:	GASOLINE (UNSPECIFIED)	Leak Monitoring:	
Tank Age:	13	Tank Piping:	UNKNOWN
Tank Size (Units):	10000 (GALLONS)	Tank Material:	FIBERGLASS
Tank ID:	3U	Tank Status:	TEMP OUT OF SERVICE
Tank Contents:	WASTE WATER	Leak Monitoring:	
Tank Age:	33	Tank Piping:	UNKNOWN
Tank Size (Units):	5000 (GALLONS)	Tank Material:	BARE STEEL

VISTA Address*:	DETROIT EDISON 2013 ROSA PARK DETROIT, MI 48216	VISTA ID#:	8370416
-----------------	---	------------	---------

ERNS - Emergency Response Notification System / SRC# 8		Agency ID:	338785
Agency Address:	DETROIT EDISON 2013 ROSA PARK DETROIT, MI APRIL 29, 1996 UNKNOWN 338785		
Spill Date Time:			
Case Number:	2013 ROSA PARK		
Spill Location:	DETROIT EDISON		
Discharger Org:	OIL MISC: TRANSFORMER, 2.00 (GAL)		
Material Spilled:	ASPHALT > STORM DRAIN		
Waterway Affected:	Source Agency, Discharger Name, Discharger Phone		
Fields Not Reported:			
Air Release:	Land Release:	Water Release:	Ground Release: Facility Release: Other Release:
NO	NO	NO	NO NO NO

VISTA Address*:	HARAJLI GAS STATION MICHIGAN WYOMING DETROIT, MI	VISTA ID#:	7294624
-----------------	--	------------	---------

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	SAME AS ABOVE		
Leak ID#:	5-002143		
Remediation Status:	OPEN		
Description / Comment:	FACILITY COUNTY: WAYNE		

VISTA Address*:	VACANT PROPERTY SOUTH OF WARREN BETWEEN 4TH STREET LODGE SERV DETROIT, MI	VISTA ID#:	6908932
-----------------	---	------------	---------

STATE LUST - State Leaking Underground Storage Tank / SRC# 319		EPA/Agency ID:	N/A
Agency Address:	SAME AS ABOVE		
Leak ID#:	D-038590		
Remediation Status:	CLOSED		
Description / Comment:	FACILITY COUNTY: WAYNE		



* VISTA address includes enhanced city and ZIP.

For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: 249401901

Date of Report: May 24, 2000

Version 2.6.1

Page #69

CRA SITE ASSESSMENT REPORT

DESCRIPTION OF DATABASES SEARCHED

A) DATABASES SEARCHED TO 1.25 MILE

NPL
SRC#: 19 VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for NPL was January, 2000.

The National Priorities List (NPL) is the EPA's database of uncontrolled or abandoned hazardous waste sites identified for priority remedial actions under the Superfund program. A site must meet or surpass a predetermined hazard ranking system score, be chosen as a state's top priority site, or meet three specific criteria set jointly by the US Dept of Health and Human Services and the US EPA in order to become an NPL site.

SPL
SRC#: 324 VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for Proposed Sites of Contamination ACT-307 was September, 1999.


This database is provided by the Department of Natural Resources, Environmental Response Division. The agency may be contacted at: 517-373-4800.

CERCLIS
SRC#: 17 VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for CERCLIS was October, 1999.

The CERCLIS List contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL. The information on each site includes a history of all pre-remedial, remedial, removal and community relations activities or events at the site, financial funding information for the events, and unrestricted enforcement activities.

NFRAP
SRC#: 18 VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for CERCLIS-NFRAP was October, 1999.

NFRAP sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly, or the contamination was not serious enough to require Federal Superfund action or NPL consideration.

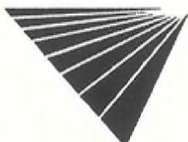

SCL
SRC#: 323

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for Sites of Contamination ACT-307 was September, 1999.

This database is provided by the Department of Natural Resources, Environmental Response Division. The agency may be contacted at: 517-373-4800.

The Michigan Environmental Response Act (Act 307), provides for the identification, risk assessment, and evaluation of sites of environmental contamination in the State. Under the Act, proposed lists of contamination sites are submitted to the Legislature in November of each year. Historically, one list identified all known sites requiring further evaluation and interim response activity known as the "Evaluation and Interim Response List (Priority List One)" and the second list identified sites where response actions were ready to be undertaken, known as "Priority List Two". A new risk assessment, the Site Assessment Model (SAM) was adopted in July, 1990, and was used to score all proposed sites. The Act 307 list dated November, 1992 also included the Leaking Underground Storage Tank sites reported by the DNR. These sites are listed on the LUST portion of this report. %MNFLHWP.MEL% Vista utilizes information from the Master Entity Database for the following lists: the Permanent List of Priorities (PLP), Hazardous Waste Generator/Investigation and Cleanup List (HWIC), De-listed Sites from the Permanent List of Priorities (DPLP), Closed Landfill Sites Undergoing Cleanup (LCP), List of sites where there is a potential for ground water contamination (Other), and Sites where soil or groundwater contamination or potential contamination is present (MN-NFA).

CORRACTS
SRC#: 14

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for HWDMS/RCRIS was December, 1999.

The EPA maintains this database of RCRA facilities which are undergoing "corrective action". A "corrective action order" is issued pursuant to RCRA Section 3008 (h) when there has been a release of hazardous waste or constituents into the environment from a RCRA facility. Corrective actions may be required beyond the facility's boundary and can be required regardless of when the release occurred, even if it predates RCRA.

ERNS
SRC#: 8

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for was August, 1999.

The Emergency Response Notification System (ERNS) is a national database containing records from October 1986 to the release date above and is used to collect information for reported releases of oil and hazardous substances. The database contains information from spill reports made to federal authorities including the EPA, the US Coast Guard, the National Response Center and the Department of Transportation. The ERNS hotline number is (202) 260-2342.

RCRA-TSD
SRC#: 12

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for HWDMS/RCRIS was December, 1999.

The EPA's Resource Conservation and Recovery Act (RCRA) Program identifies and tracks hazardous waste from the point of generation to the point of disposal. The RCRA Facilities database is a compilation by the EPA of facilities which report generation, storage, transportation, treatment or disposal of hazardous waste. RCRA TSDs are facilities which treat, store and/or dispose of hazardous waste.



**RCRA-Tsd
Coracts
SRC#: 556**

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for HWDMS/RCRIS was December, 1999.

The EPA's Resource Conservation and Recovery Act (RCRA) Program identifies and tracks hazardous waste from the point of generation to the point of disposal. The RCRA Facilities database is a compilation by the EPA of facilities which report generation, storage, transportation, treatment or disposal of hazardous waste.

**SWLF
SRC#: 23**

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for USGS Solid Waste Landfill Sites was December, 1991.

This database is provided by the United States Geological Survey. The agency may be contacted at: 703-648-5613.

**SWLF
SRC#: 317**

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for Inactive Solid Waste Facilities List was January, 1996.

This database is provided by the Department of Natural Resources, Solid Waste Program Section. The agency may be contacted at: 517-335-4035.

**SWLF
SRC#: 320**

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for Transfer Stations List was January, 2000.

This database is provided by the Department of Natural Resources, Waste Management Division. The agency may be contacted at: 517-335-4035.

**LUST
SRC#: 319**

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for Open and Closed LUST Sites Lists was March, 1999.

This database is provided by the Department of Environmental Quality, UST Division. The agency may be contacted at: 517-373-8168.

**TRIS
SRC#: 2**

VISTA conducts a database search to identify all sites within 1.25 mile of your property.
The agency release date for TRIS was January, 1998.

Section 313 of the Emergency Planning and Community Right-to-Know Act (also known as SARA Title III) of 1986 requires the EPA to establish an inventory of Toxic Chemicals emissions from certain facilities(Toxic Release Inventory System). Facilities subject to this reporting are required to complete a Toxic Chemical Release Form(Form R) for specified chemicals.

B) DATABASES SEARCHED TO 0.5 MILE

**RCRA-LgGen
SRC#: 16**

VISTA conducts a database search to identify all sites within 1/2 mile of your property.
The agency release date for HWDMS/RCRIS was December, 1999.

The EPA's Resource Conservation and Recovery Act (RCRA) Program identifies and tracks hazardous waste from the point of generation to the point of disposal. The RCRA Facilities database is a compilation by the EPA of facilities which report generation, storage, transportation, treatment or disposal of hazardous waste. RCRA Large Generators are facilities which generate at least 1000 kg./month of non-acutely hazardous waste (or 1 kg./month of acutely hazardous waste).



For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.

Report ID: **249401901**

Date of Report: **May 24, 2000**

Version 2.6.1

Page #72

RCRA-SmGen
SRC#: 15

VISTA conducts a database search to identify all sites within 1/2 mile of your property.
The agency release date for HWDMS/RCRIS was December, 1999.

The EPA's Resource Conservation and Recovery Act (RCRA) Program identifies and tracks hazardous waste from the point of generation to the point of disposal. The RCRA Facilities database is a compilation by the EPA of facilities which report generation, storage, transportation, treatment or disposal of hazardous waste. RCRA Small and Very Small generators are facilities which generate less than 1000 kg./month of non-acutely hazardous waste.

UST's
SRC#: 322

VISTA conducts a database search to identify all sites within 1/2 mile of your property.
The agency release date for Registered Underground Storage Tanks was December, 1999.

This database is provided by the Department of Environmental Quality, UST Division. The agency may be contacted at: 517-335-3075; Caution-Many states do not require registration of heating oil tanks, especially those used for residential purposes.

End of Report




For more information call VISTA Information Solutions, Inc. at 1 - 800 - 767 - 0403.
Report ID: **249401901**
Version 2.6.1

Date of Report: **May 24, 2000**
Page #73

APPENDIX B


SANBORN MAPS

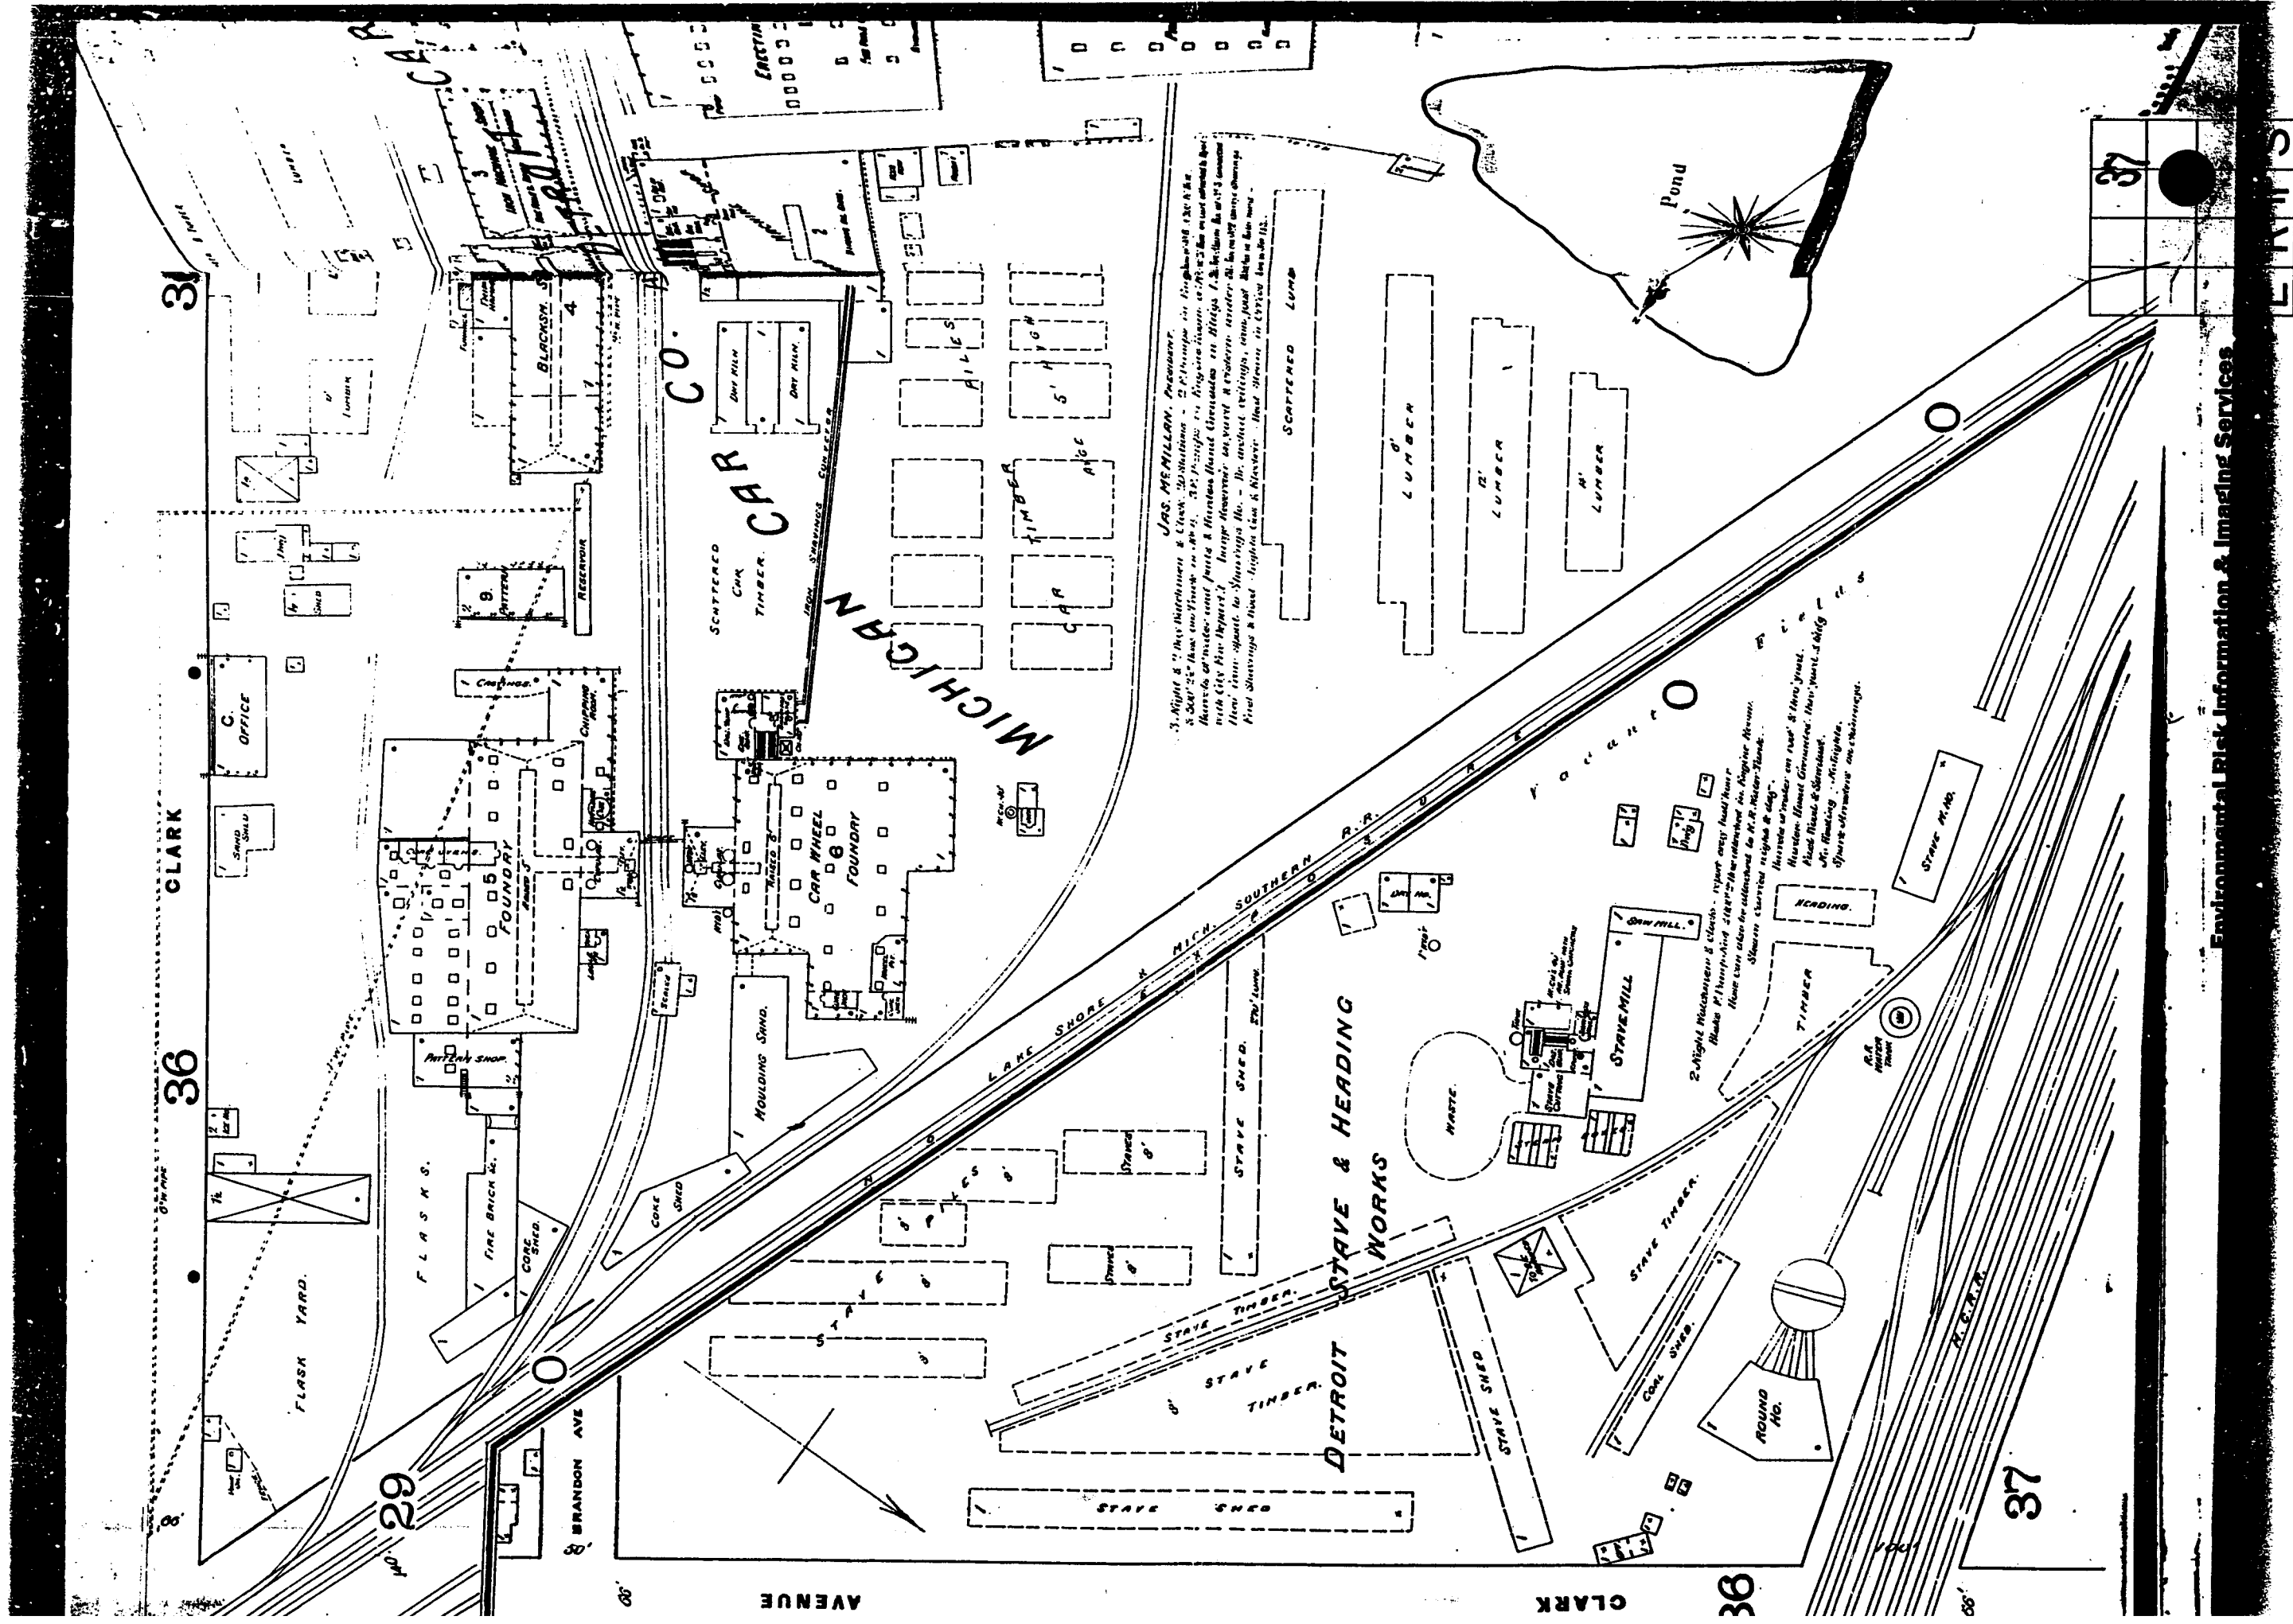


THE REPRODUCTION OF THE SANBORN FIRE INSURANCE MAPS HAS BEEN MADE BY PERMISSION OF SANBORN MAPING & GEOGRAPHIC INFORMATION SERVICE, THE COPYRIGHT HOLDER, IN ACCORDANCE WITH THE TERMS AND CONDITIONS OF AN AGREEMENT BETWEEN ENVIRONMENTAL RISK INFORMATION & IMAGING SERVICES AND SANBORN MAPING & GEOGRAPHIC INFORMATION SERVICE DATED AUGUST 1, 1991. THE MANUFACTURERS MUTUAL MAPS ARE THE PROPERTY OF THE EDISON INSTITUTE, DEARBORN, MICHIGAN, AND MAY NOT BE FURTHER REPRODUCED WITHOUT PERMISSION.

SANBORN

1884

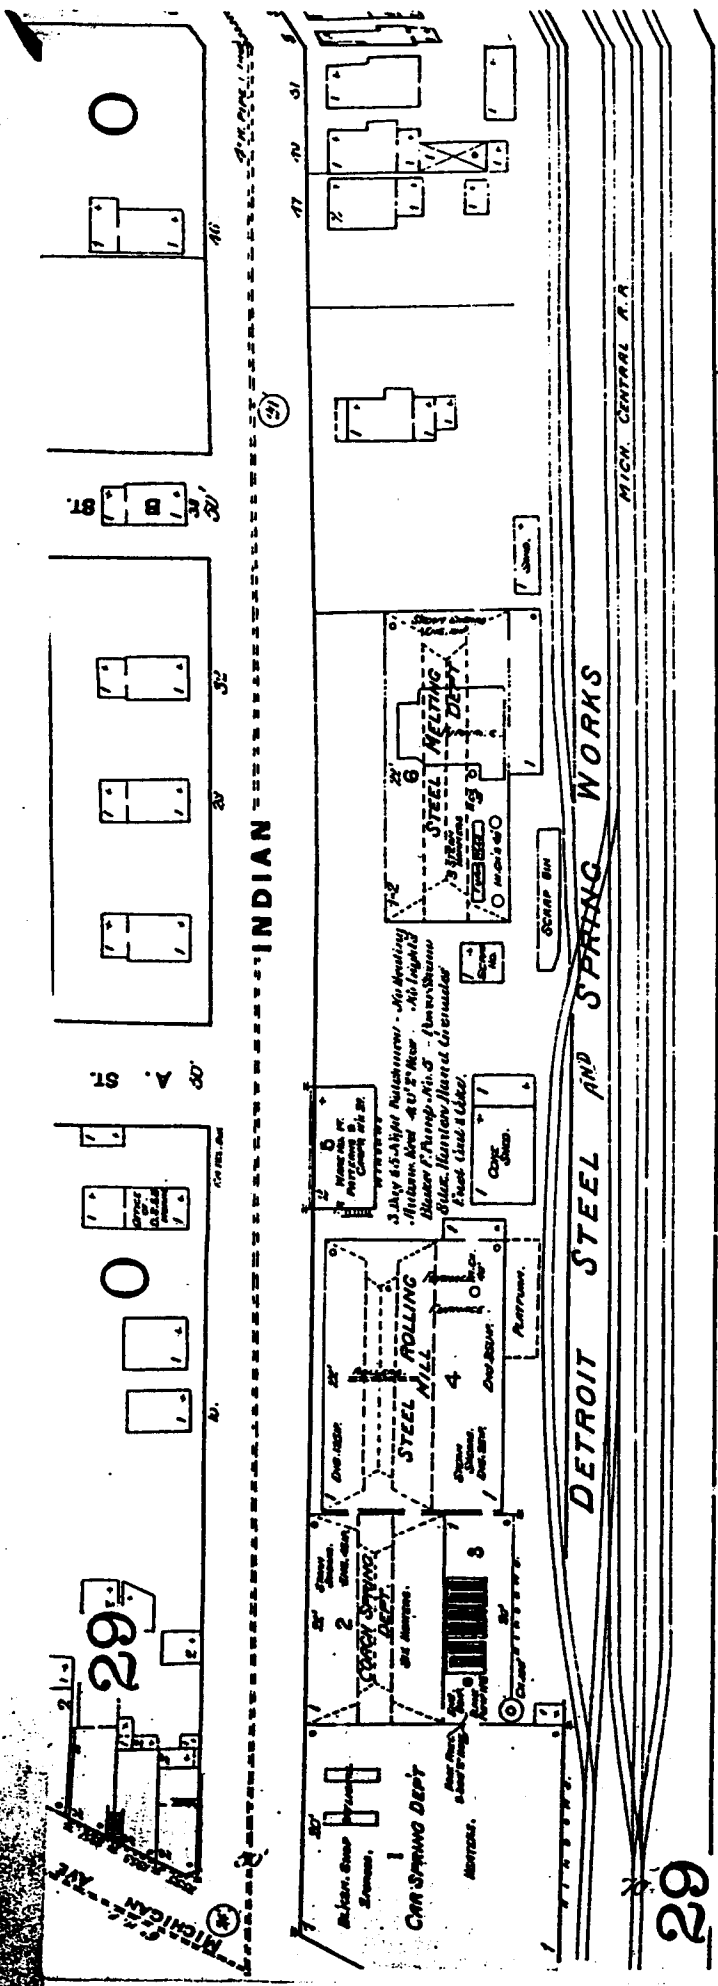


29

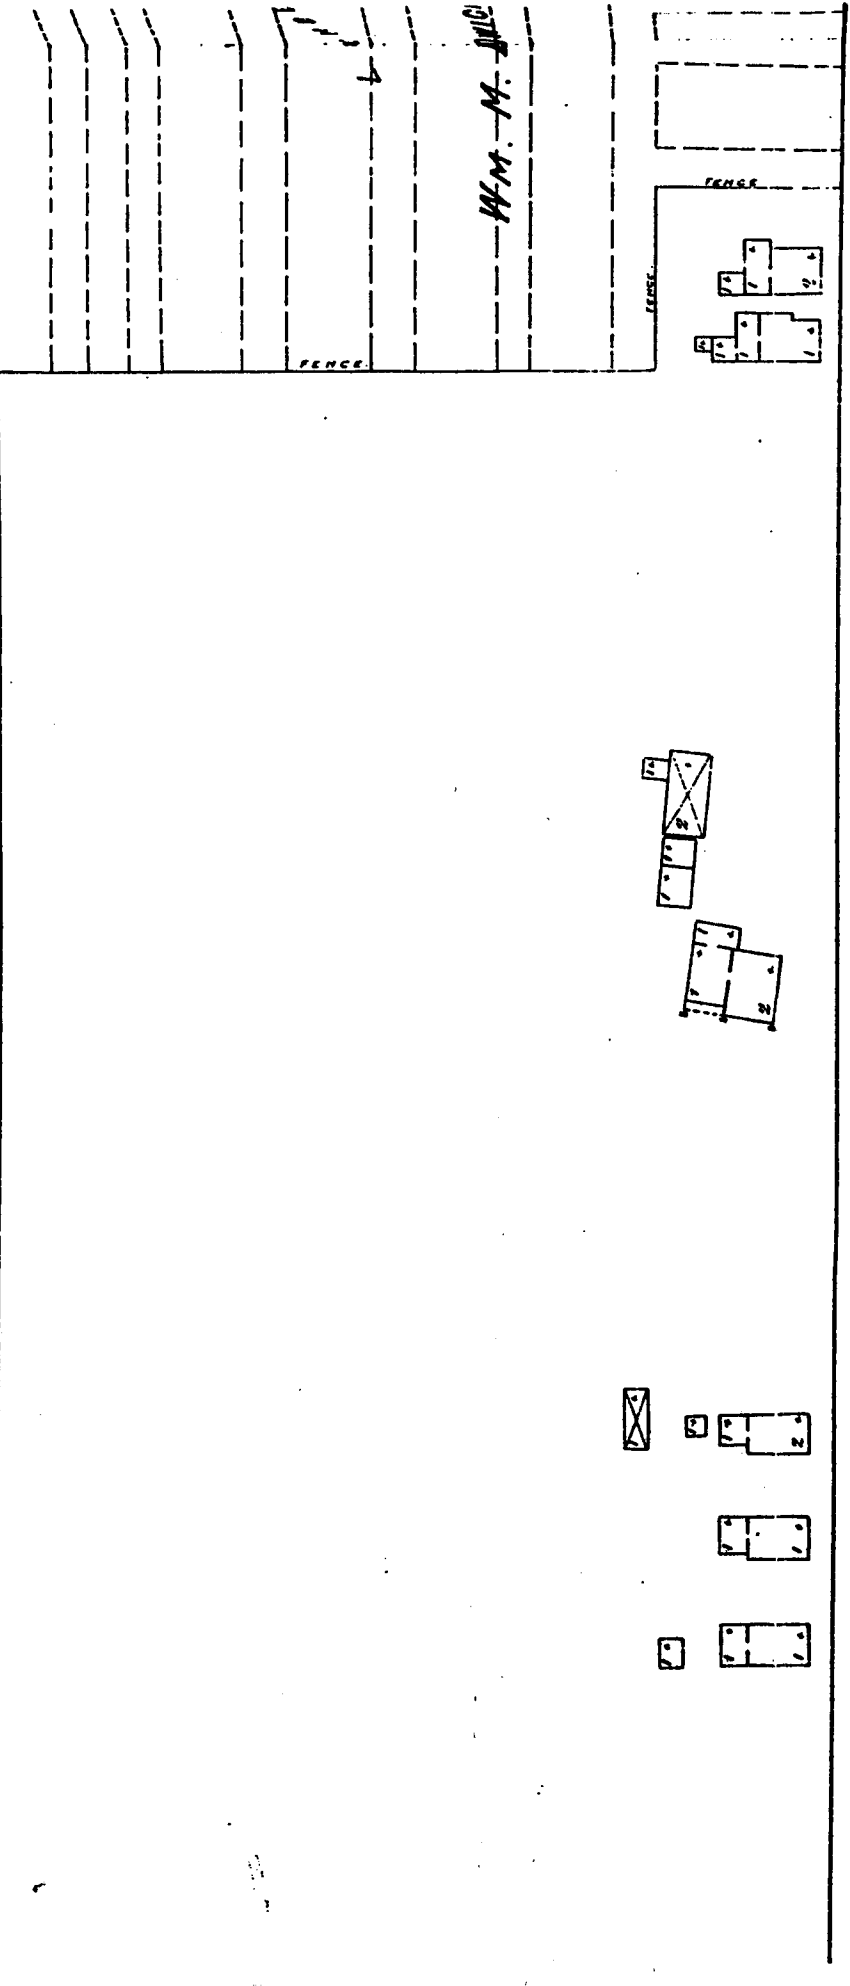

29

SCOTTEN

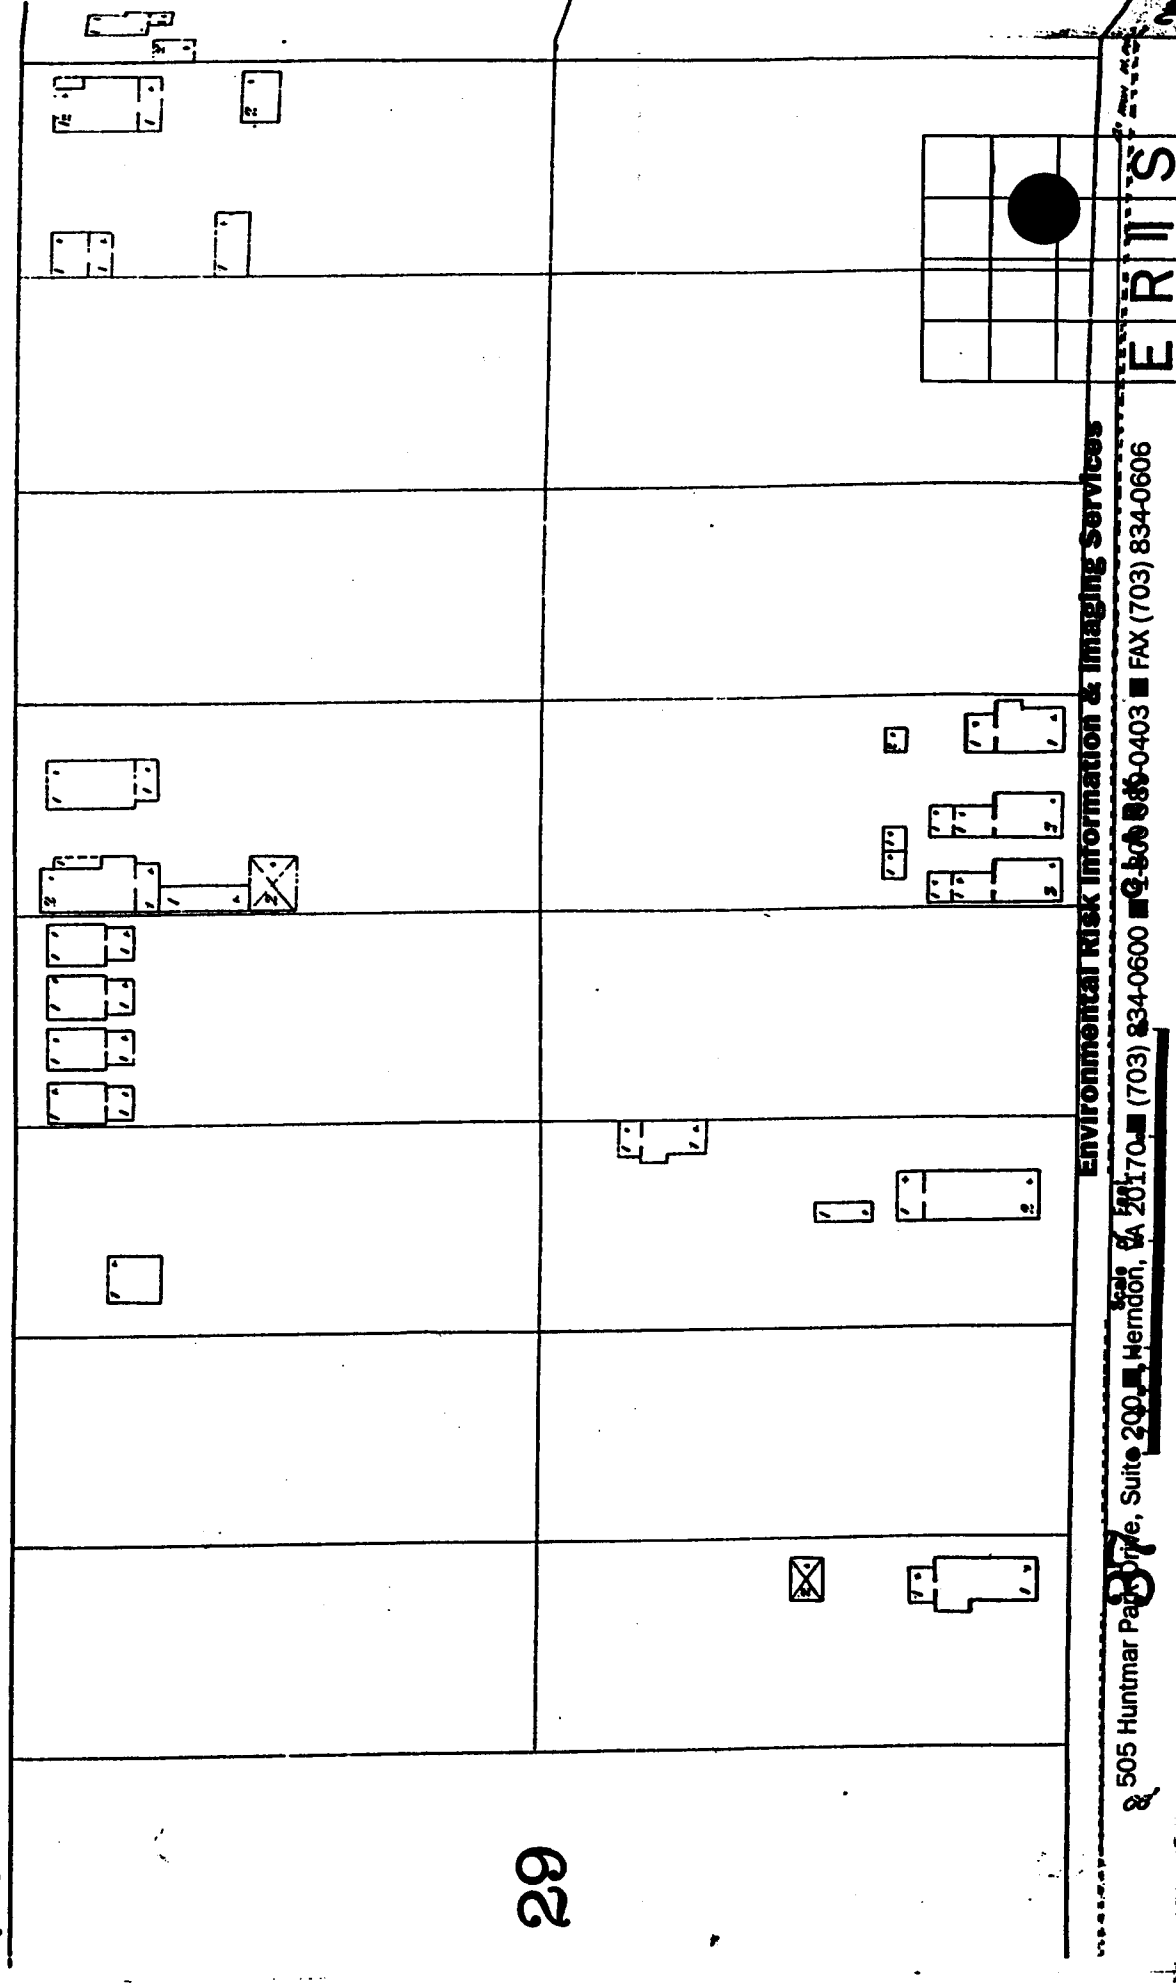


29

505 Huntmar Park, Suite 200, Hemdon, VA 23070 (703) 834-0600 (703) 834-0600 888-0403 FAX (703) 834-0606

ERIS

HOLDER, IN ACCORDANCE WITH THE TERMS AND CONDITIONS OF AN AGREEMENT BETWEEN ENVIRONMENTAL RISK INFORMATION & IMAGING SERVICES AND SANBORN MAPING & GEOGRAPHIC INFORMATION SERVICES DATED AUGUST 1, 1991, THE MANUFACTURERS' MUTUAL MAPS ARE THE PROPERTY OF THE EDISON INSTITUTE, DEARBORN, MICHIGAN, AND MAY NOT BE FURTHER REPRODUCED WITHOUT PERMISSION.

1881

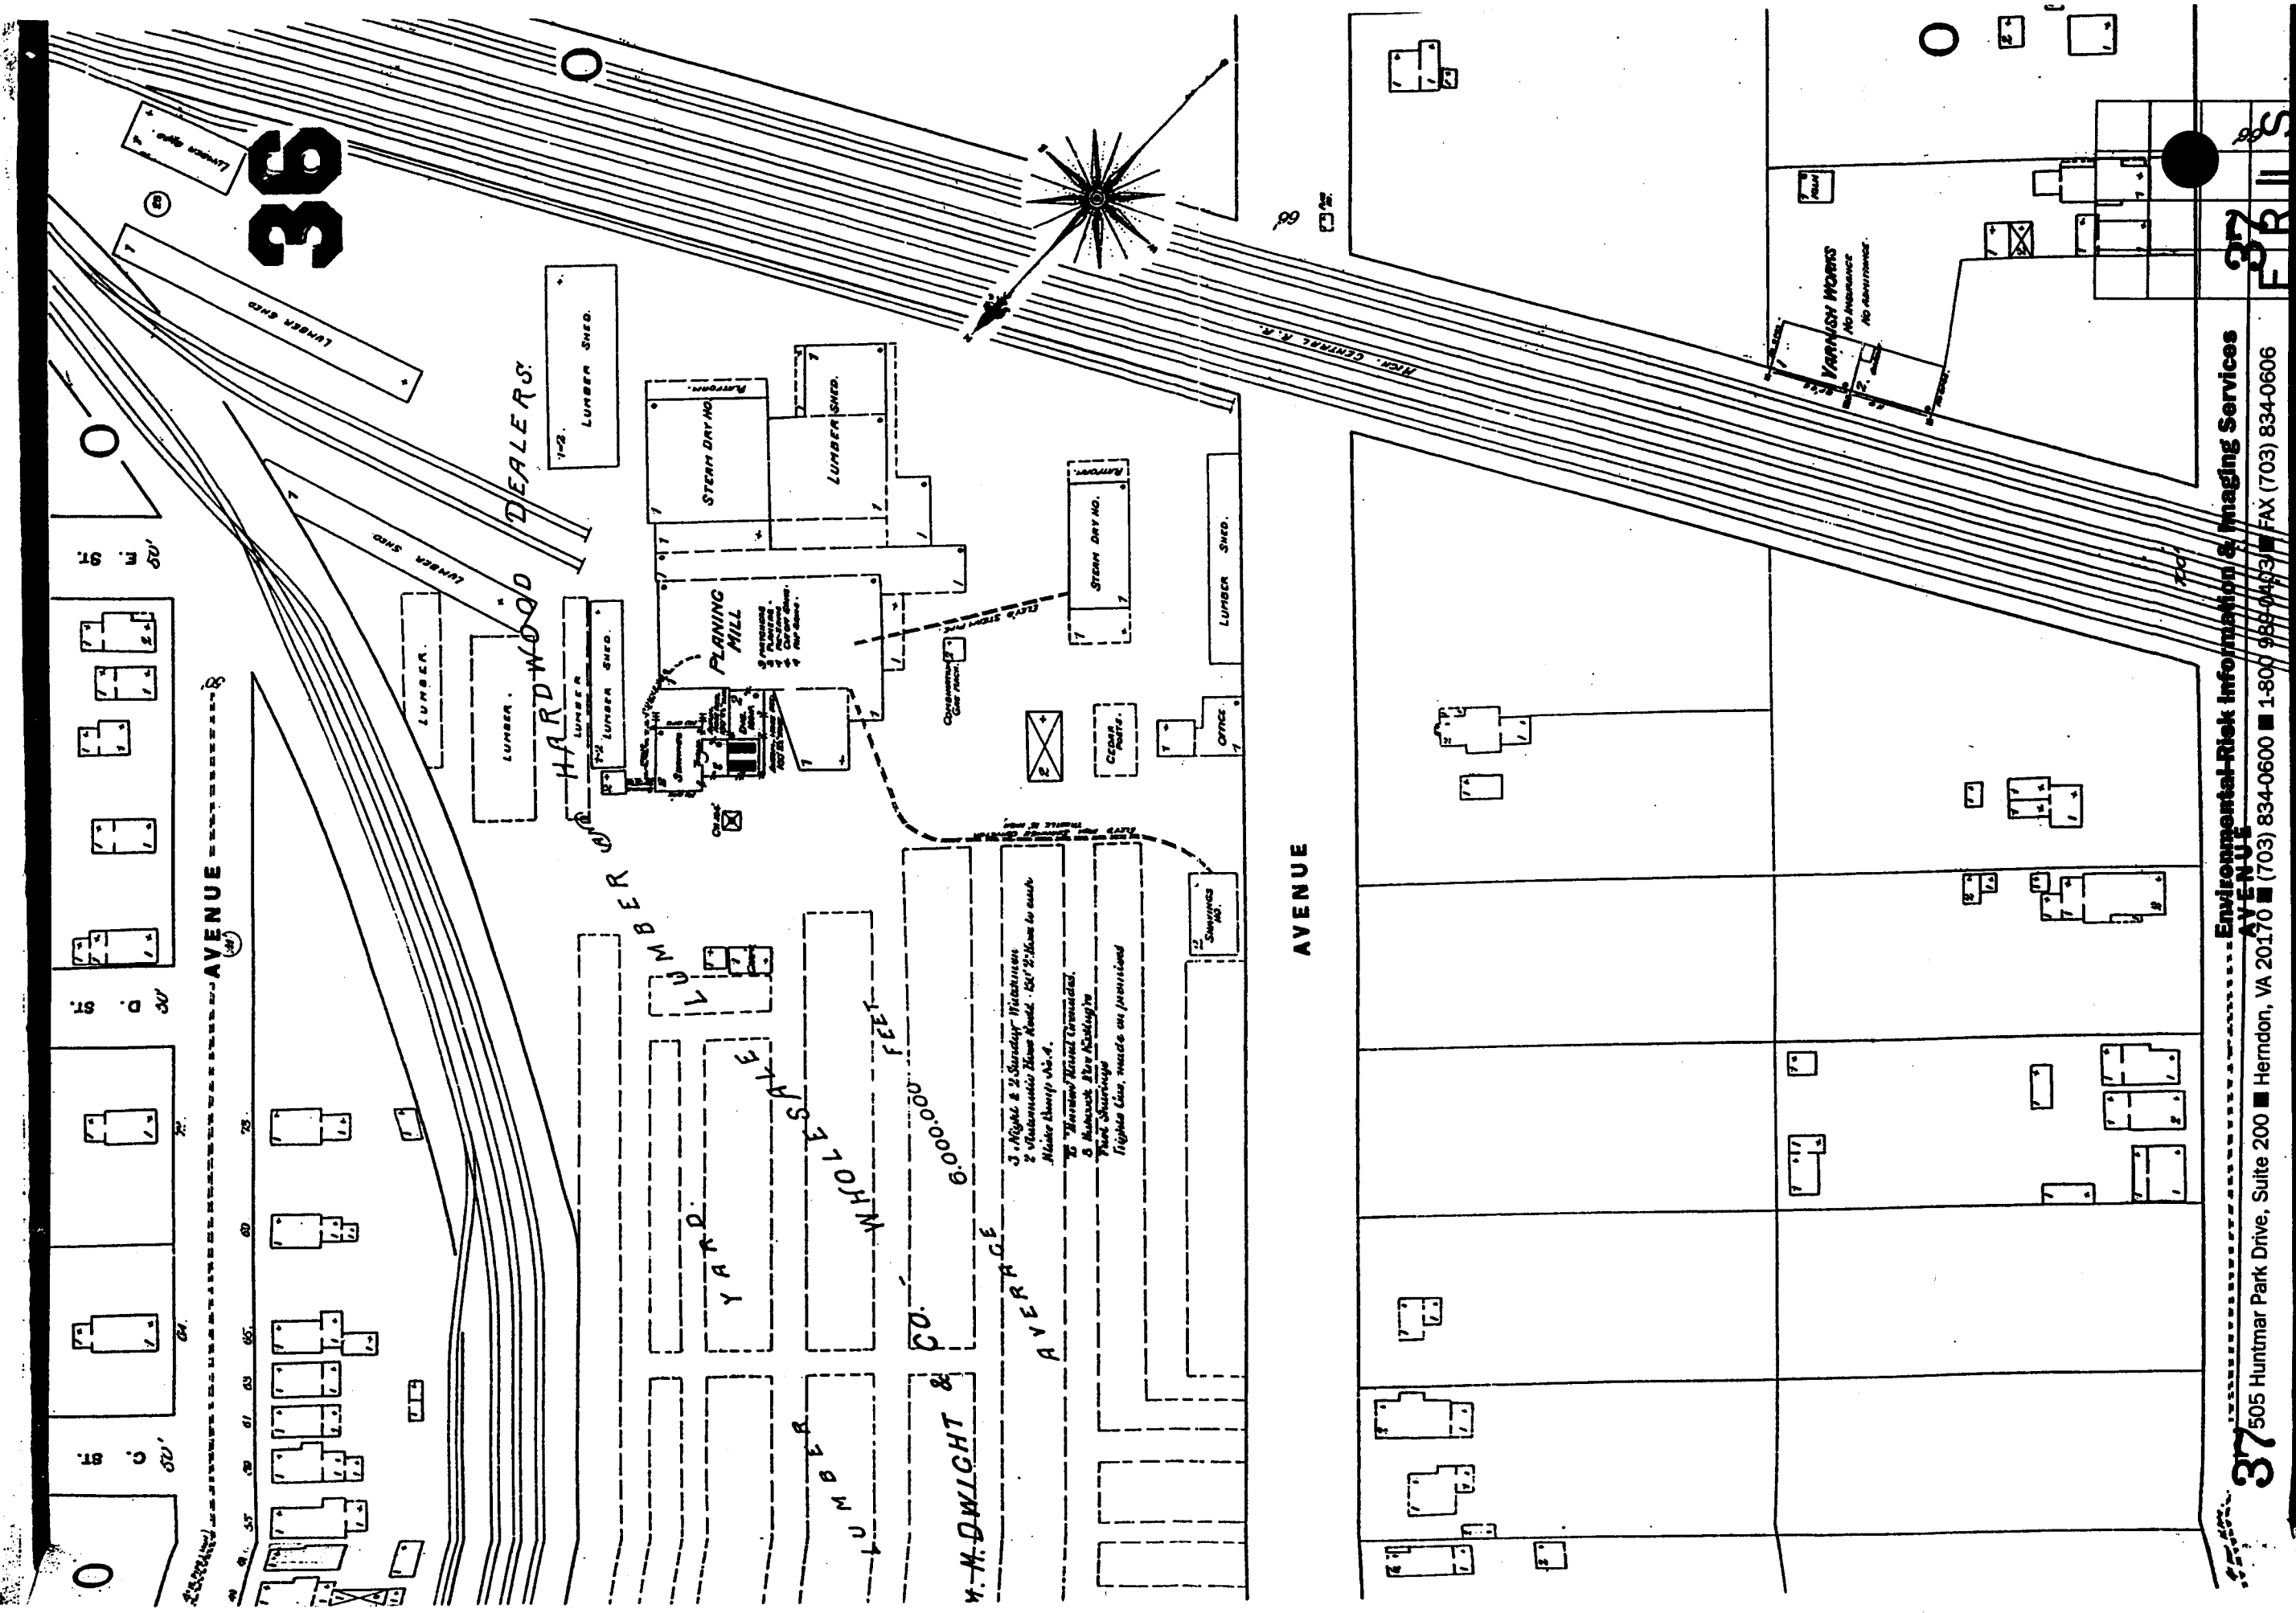


37 Environmental Risk Information & Imaging Services
37505 Huntmar Park Drive, Suite 200 ■ Herndon, VA 20170 ■ (703) 834-0600 ■ 1-800-988-0433 ■ FAX (703) 834-0606

THE REPRODUCTION OF THE SANBORN FIRE INSURANCE MAPS HAS BEEN MADE BY PERMISSION OF SANBORN MAPING & GEOGRAPHIC INFORMATION SERVICE, THE COPYRIGHT HOLDER, IN ACCORDANCE WITH THE TERMS AND CONDITIONS OF AN AGREEMENT BETWEEN ENVIRONMENTAL RISK INFORMATION & IMAGING SERVICES AND SANBORN MAPING & GEOGRAPHIC INFORMATION SERVICE DATED AUGUST 1, 1991. THE MANUFACTURERS MUTUAL MAPS ARE THE PROPERTY OF THE EDISON INSTITUTE, DEARBORN, MICHIGAN, AND MAY NOT BE REPRODUCED WITHOUT PERMISSION.

SANBORN


1884

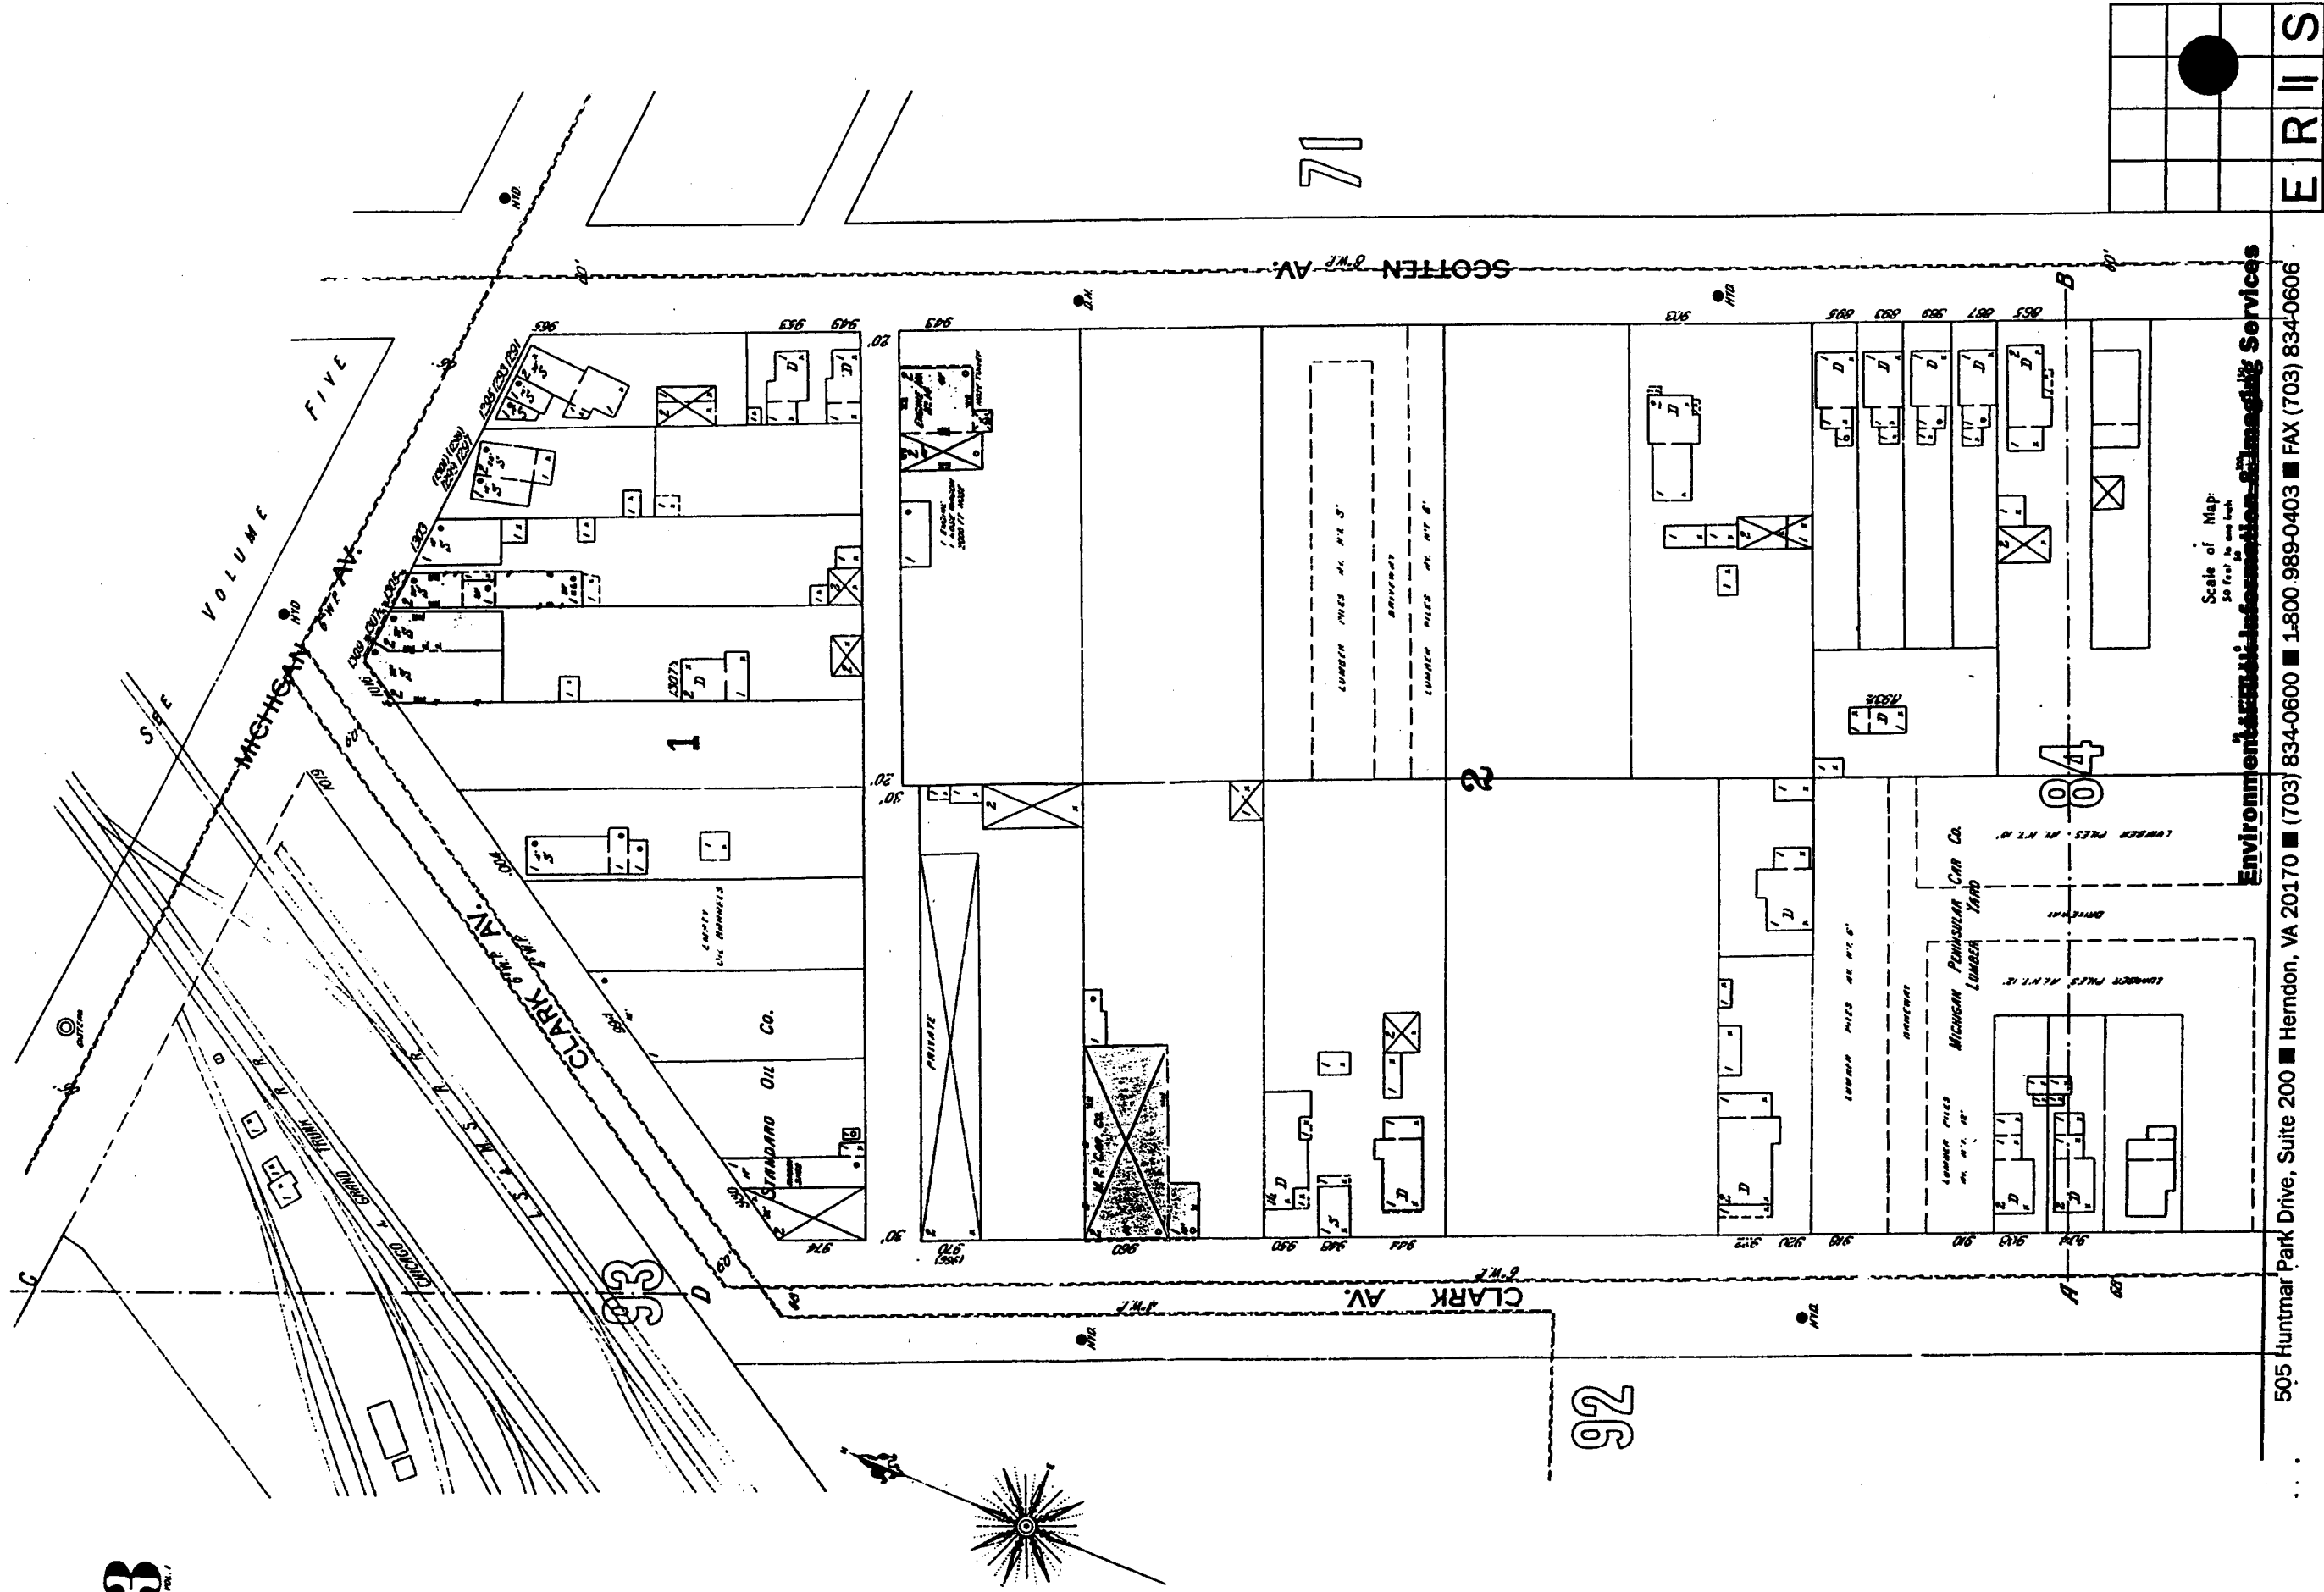

505 Huntmar Park Drive, Suite 200 ■ Herndon, VA 20170 ■ (703) 834-0600 ■ 1-800 989-0403 ■ FAX (703) 834-0606

Environmental Information Imaging Services

Scale of Map:
50 Feet to one inch

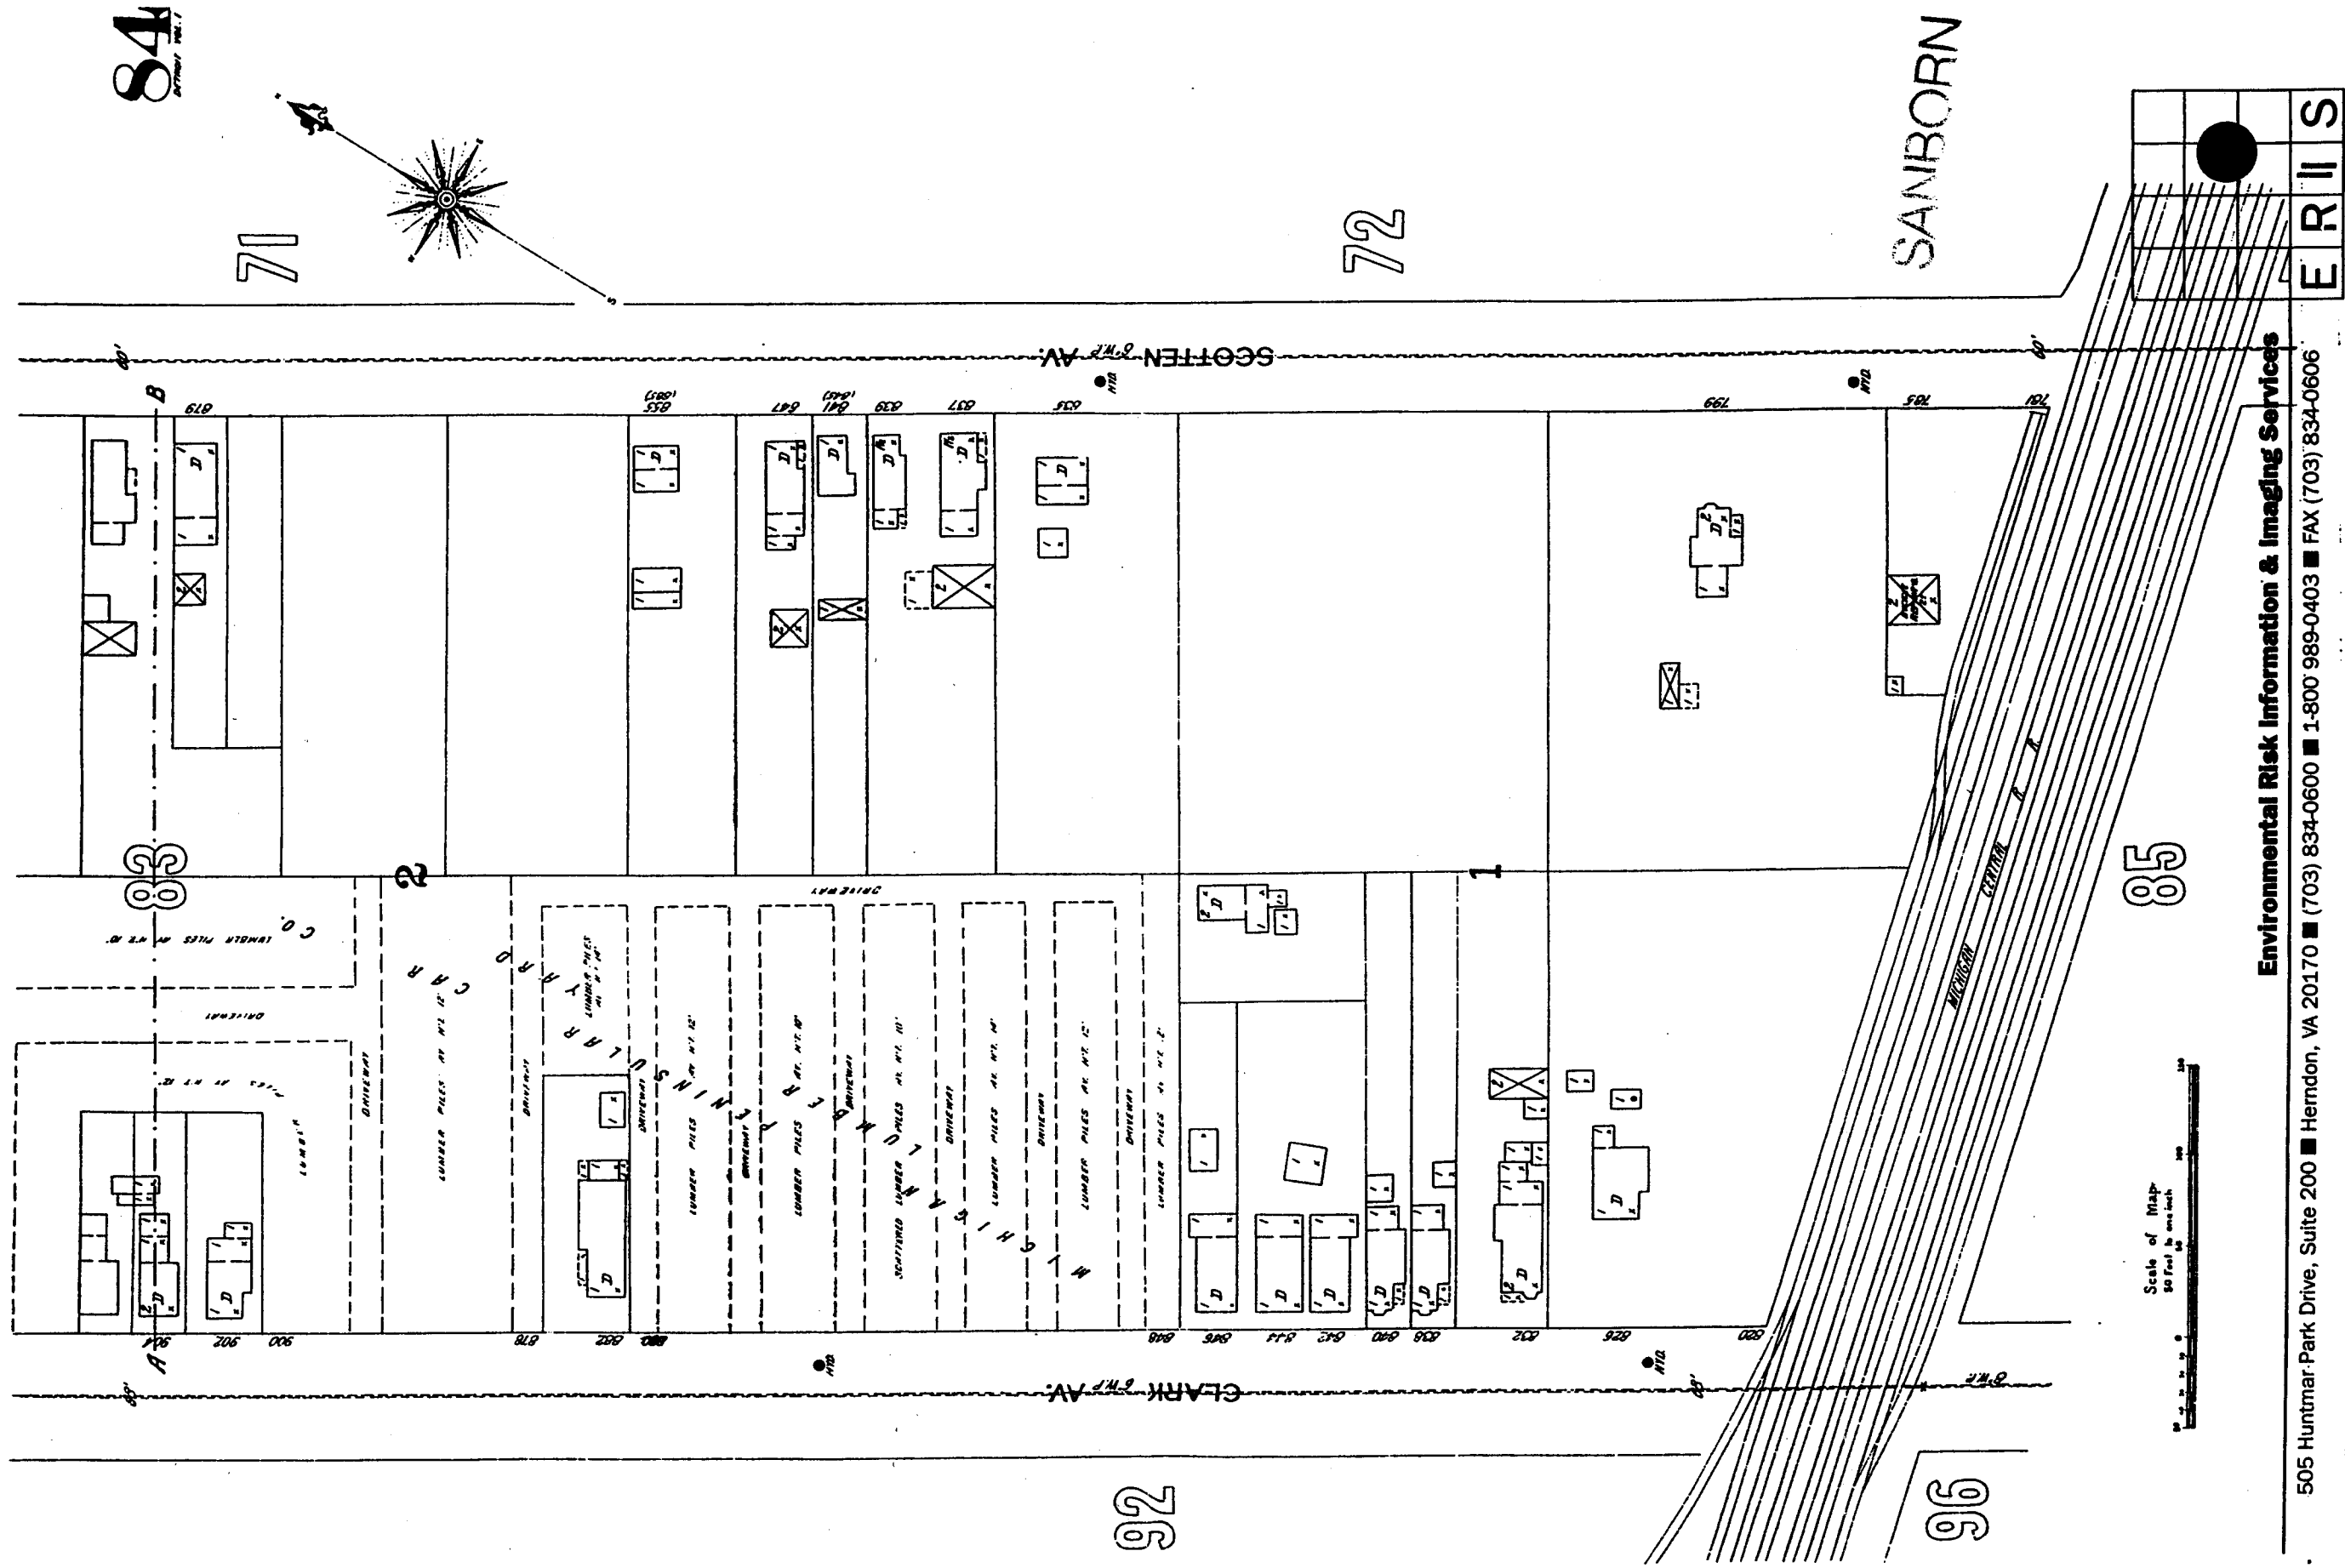


Environmental Risk Information & Imaging Services

505 Huntmar Park Drive, Suite 200 ■ Herndon, VA 20170 ■ (703) 834-0600 ■ 1-800-989-0403 ■ FAX (703) 834-0606

THIS INFORMATION IS FOR YOUR INFORMATION ONLY. IT IS NOT TO BE USED FOR ANY OTHER PURPOSE.

181

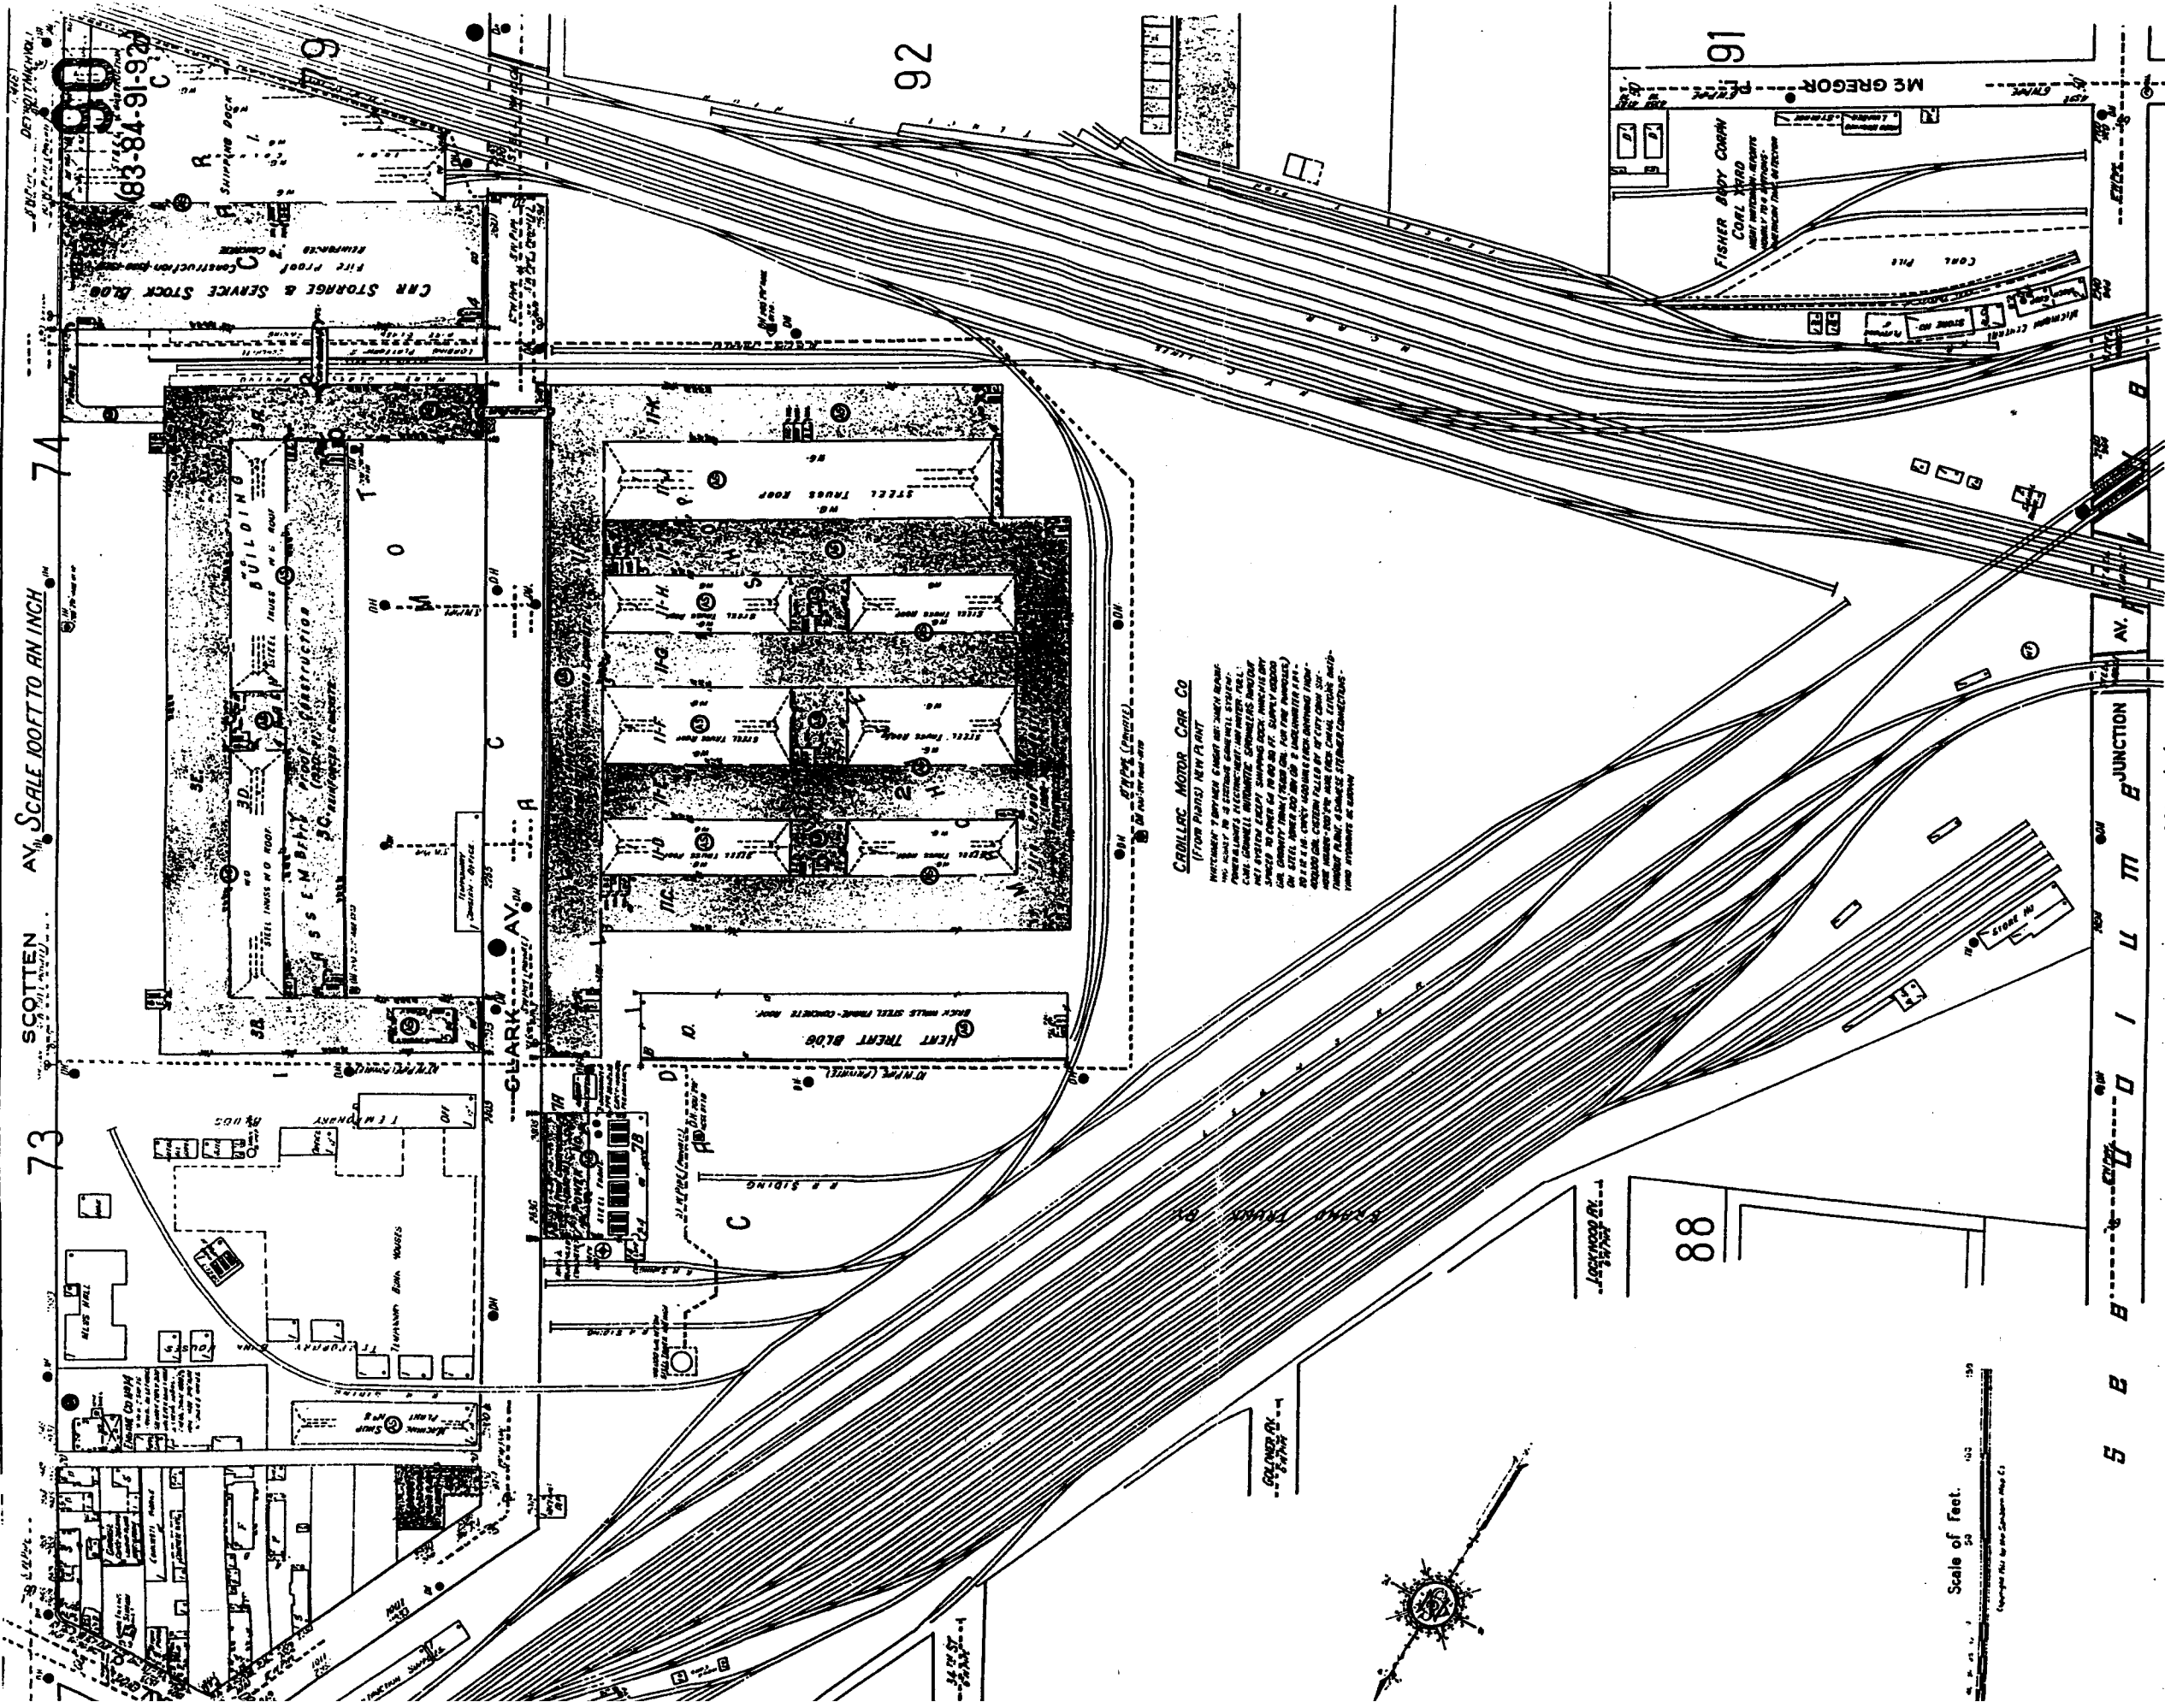

Environmental Risk Information & Imaging Services

505 Huntmar Park Drive, Suite 200 ■ Herndon, VA 20170 ■ (703) 834-0600 ■ 1-800 989-0403 ■ FAX (703) 834-0606

ERIS

THE REPRODUCTION OF THE SANBORN FIRE INSURANCE MAPS HAS BEEN MADE BY PERMISSION OF SANBORN MAPPING & GEOGRAPHIC INFORMATION SERVICE, THE COPYRIGHT HOLDER, IN ACCORDANCE WITH THE TERMS AND CONDITIONS OF AN AGREEMENT BETWEEN ENVIRONMENTAL RISK INFORMATION & IMAGING SERVICES AND SANBORN MAPPING & GEOGRAPHIC INFORMATION SERVICE DATED AUGUST 1, 1991. THE MANUFACTURERS' MUTUAL MAPS ARE THE PROPERTY OF THE EDISON INSTITUTE, DEARBORN, MICHIGAN, AND MAY NOT BE FURTHER REPRODUCED WITHOUT PERMISSION.

SANBORN

1921

APPENDIX C

AERIAL PHOTOGRAPHS



Abrams Aerial Survey of 1937

1949



1952



1956



1961






1972



1981



1981

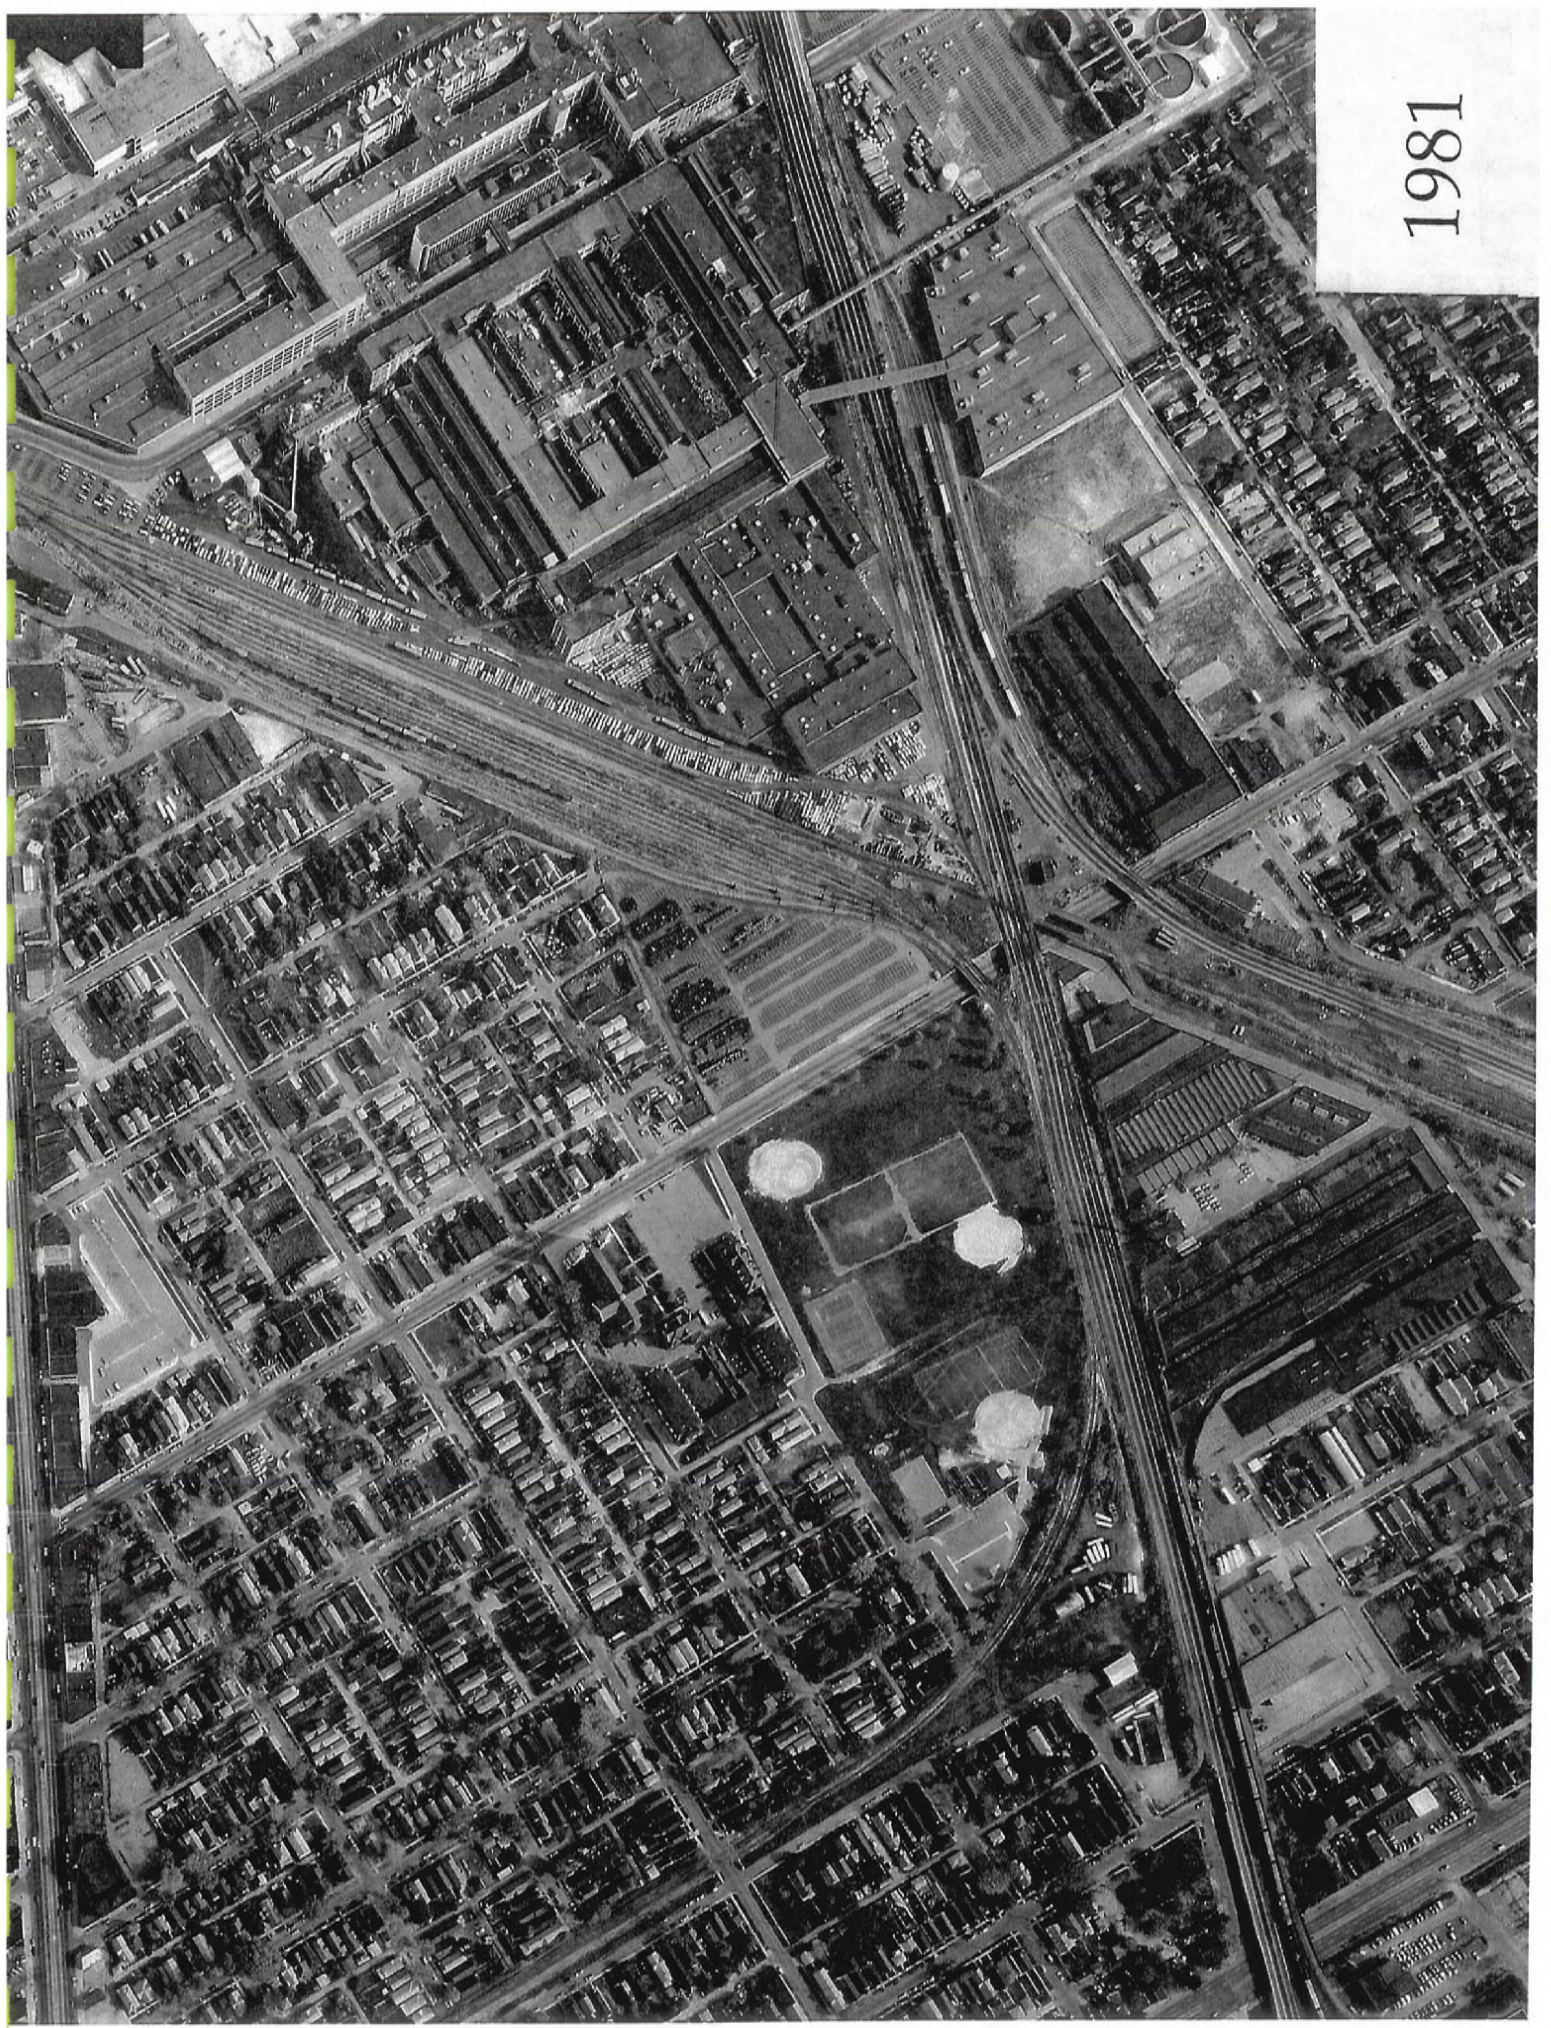

1985



1985

1990



1990

1995



1995

APPENDIX D

MDEQ – WMD CLOSURE CERTIFICATION APPROVAL

STATE OF MICHIGAN



JOHN ENGLER, Governor

DEPARTMENT OF ENVIRONMENTAL QUALITY

HOLLISTER BUILDING, PO BOX 30473, LANSING MI 48909-7873

INTERNET: <http://www.deq.state.mi.us>

RUSSELL J. HARDING, Director

REPLY TO:

WASTE MANAGEMENT DIVISION
PO BOX 30241
LANSING MI 48909-7741

February 27, 1997

CERTIFIED MAIL

Ms. Bridget R. Pitlock
Environmental and Regulatory Support Remediation Team
Worldwide Facilities Group
General Motors Corporation
485 West Milwaukee Avenue, MC 482-310-004
Detroit, Michigan 48202-3220

Dear Ms. Pitlock:

SUBJECT: Acceptance of Closure Certification, Cadillac Motor Car-Clark Street Facility,
General Motors Corporation, Detroit, Wayne County: MID 005 356 704

The Michigan Department of Environmental Quality, Waste Management Division, has reviewed the closure certification and its addenda, received June 11, 1990, February 6, 1996, and December 26, 1996, respectively, for General Motors Corporation's (GM's) Cadillac Motor Car-Clark Street facility located in Detroit, Michigan (the facility). The closure certification was submitted pursuant to the requirements of Part 111 (Hazardous Waste Management) of Michigan's Natural Resources and Environmental Protection Act, 1994 PA 451, as amended. Based on our review, GM is hereby released from its closure responsibilities at the facility under Part 111. GM is, therefore, no longer required to demonstrate financial capability for closure and liability coverage at the facility.

Facility Status

With this acceptance of the certification of closure, the facility can no longer be operated as a hazardous waste treatment, storage, or disposal facility. If hazardous waste is generated at the facility, it must be managed in accordance with all applicable generator requirements in Part 3 of the Part 111 Administrative Rules.

Financial Capability

GM demonstrates financial assurance for closure of the facility by use of a Financial Test. In accordance with R 299.9703(5), this acceptance of the certification of closure constitutes a release from the requirement to maintain such financial assurance. GM is no longer required to demonstrate closure coverage for the facility with updated Financial Test information.

February 27, 1997


GM demonstrates financial responsibility for pollution liability coverage for its facility by use of a Financial Test. In accordance with R 299.9710(16), this acceptance of the certification of closure constitutes a release from the requirement to maintain such financial responsibility. GM is no longer required to demonstrate liability coverage for the facility with updated financial test information.

Corrective Action Responsibilities

This letter does not constitute a release from any facility-wide corrective action responsibilities GM may have under Part 111 or the federal Resource Conservation and Recovery Act of 1976, as amended. In addition to the responsibility to close regulated hazardous waste management units, owners and operators are responsible to conduct corrective actions for releases of hazardous wastes and hazardous constituents at waste management units.

If you have questions, please contact Mr. Dan Dailey of the Hazardous Waste Program Section, at 517-335-6610, or me.

Sincerely,

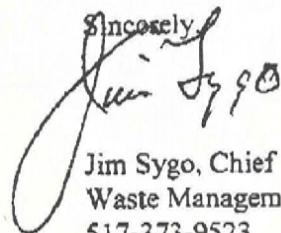

Jim Sygo, Chief
Waste Management Division
517-373-9523

cc: G. Turchan, CRA
K. West, GM
W. McFarland, GM
K. Richards, GM
Ms. Jean E. Caufield, GM
Dr. Ben Okwumabua/Mr. Larry AuBuchon, MDEQ-Southeast Michigan
Mr. Steve Buda, MDEQ
Mr. Steve Sliver, MDEQ, HWP/C&E File
Mr. Ron Stone/Mr. Clay Spencer, MDEQ
Mr. Dan Dailey, MDEQ